



VOLVO PENTA

COOLANT REPORT

CORROSION

NORMAL

CONTAMINANTS

NORMAL

COOLANT CONDITION

NORMAL

Area

DAVID BOVEE [SAM]

Machine Id

VOLVO PENTA 1012569559

Component

Port Coolant

Fluid

VOLVO COOLANT (GREEN) (--- GAL)

RECOMMENDATION

The fluid is suitable for further service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VPA036849	---	---
Sample Date		Client Info		05 Feb 2024	---	---
Machine Age	hrs	Client Info		1085	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		N/A	---	---
Sample Status				NORMAL	---	---









CORROSION

Total Dissolved Solids				349.5	---	---
Coolant Appearance		*Visual	Clear	normal	---	---

CONTAMINANTS

There is no indication of any contamination in the coolant.

Specific Gravity		*ASTM D1298		1.068	---	---
pH	Scale 0-14	ASTM D1287		10.3	---	---
Nitrites	ppm	AP-053:2009		2932	---	---
Reserve Alkalinity	Scale 0-20	*ASTM D1121		---	---	---
Percentage Glycol	%	ASTM D3321		50.1	---	---
Freezing Point	°F	ASTM D3321		-35	---	---
Carboxylate				n/a	---	---
Coolant Color		*Visual		Yellow	---	---

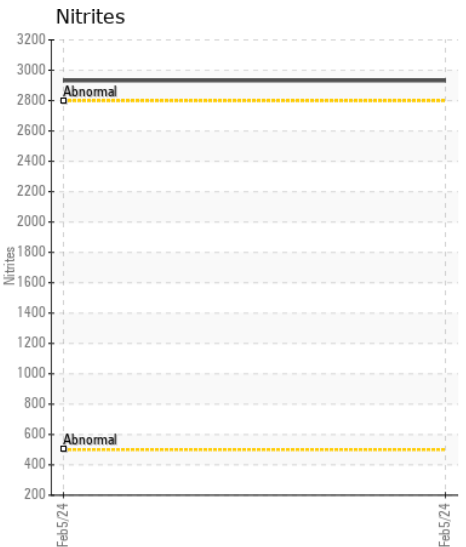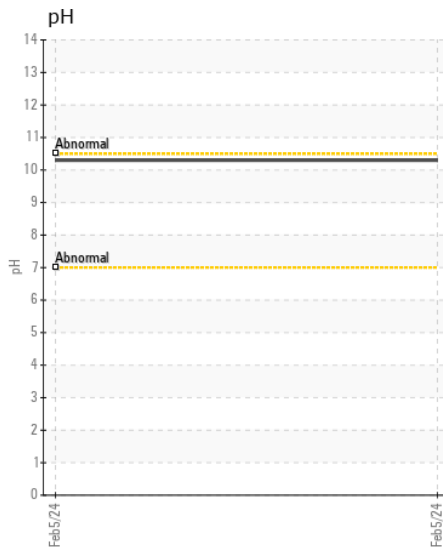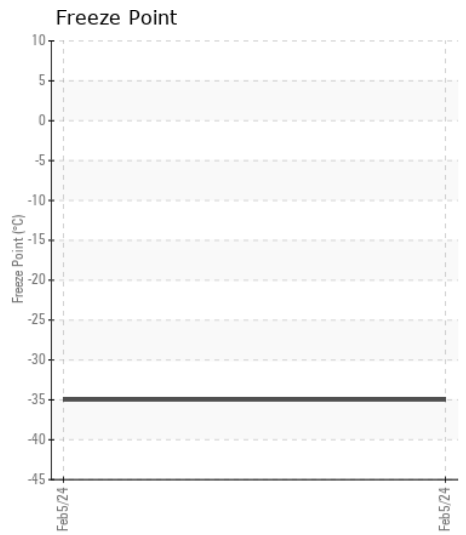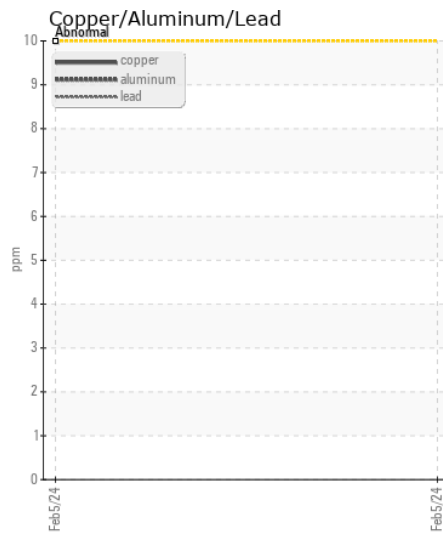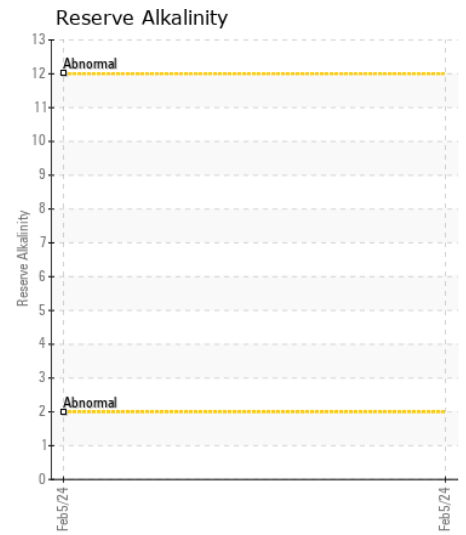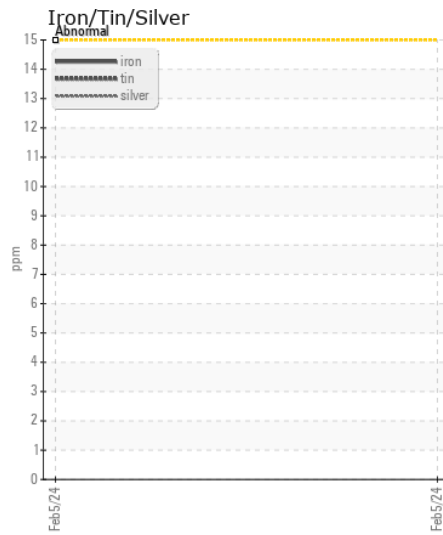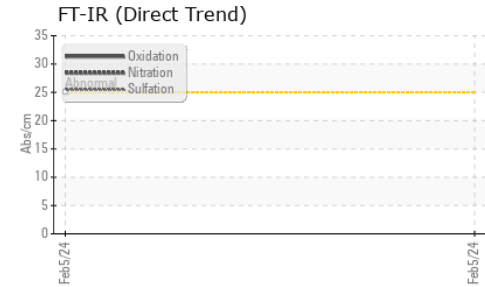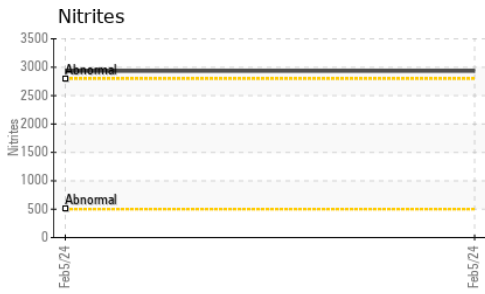

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VPA036849
Lab Number : 06085562
Unique Number : 10873007
Test Package : COOL- (Additional Tests: COOL, FT-IR)

Endor Marine LLC - Coastal Marine - 152124
 4300 11th Ave. NW
 SEATTLE, WA
 US 98107
 Contact: WILLOW YANARELLA
 service@coastalmarineengine.com
 T: (206)784-3703
 F: (206)784-8823

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)