
**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL NORMAL NORMAL** 

Machine Id

## FORKLIFT 1344

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		WC0893878		
	Sample Date		Client Info		29 Jan 2024		
	Machine Age	hrs	Client Info		2634		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	1		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>3	0		
	Aluminum	ppm	ASTM D5185m	>20	1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		0		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	<b>\</b> 25	8		
CONTAMINATION	Potassium	ppm	ASTM D5185m		0		
There is no indication of any contamination in the oil.	Fuel	ррпп	WC Method		<1.0		
	Water		WC Method		NEG		
	Glycol		WC Method	<i>&gt;</i> 0.2	NEG		
	Soot %	%	*ASTM D7844	~3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	4.6		
	Sulfation	Abs/.1mm	*ASTM D7415		17.0		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	>118	<1		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Boron	ppm	ASTM D5185m		6		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		58		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		928		
	Calcium	ppm	ASTM D5185m		1029		
	Phosphorus	ppm	ASTM D5185m		1054		
	Zinc	ppm	ASTM D5185m		1217		
		ppm	ASTM D5185m		3016		
	Sulfur		*AOTA 0744 *	0.5	40-		
	Oxidation	Abs/.1mm	*ASTM D7414	>25	12.7		
		Abs/.1mm	*ASTM D7414 ASTM D2896 ASTM D445	>25	12.7 8.8 14.1		

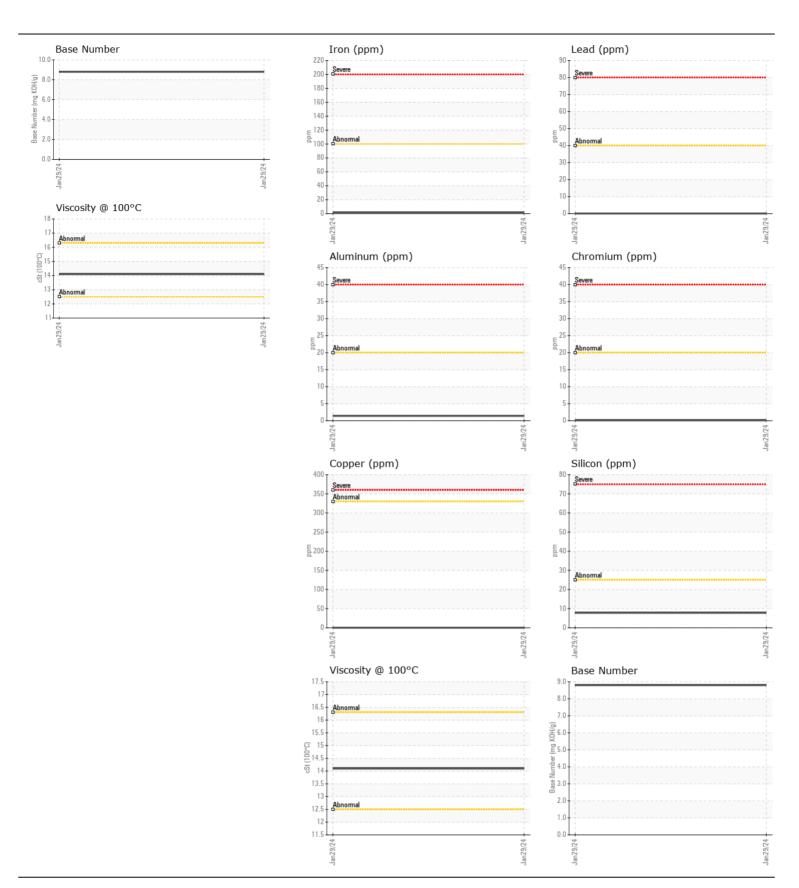



Laboratory Sample No.

: WC0893878 Lab Number : 06085863

Unique Number : 10873308 Test Package : MOB 1 ( Additional Tests: TBN )

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 12 Feb 2024 **Tested** : 13 Feb 2024

: 13 Feb 2024 - Wes Davis Diagnosed

**CONCRETE SERVICE CO - FAY BLOCK** 

161 BUILDERS BLVD FAYETTEVILLE, NC US 28301

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: