

[SPM646179] SENNEBOGEN 835 835.0.3282

Component Front Axle

Δro

GEAR OIL SAE 80W90 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP433680		
Sample Date		Client Info		08 Dec 2023		
Machine Age	hrs	Client Info		223		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Filter Changed		Client Info		Not Changd		
Sample Status				NORMAL		
Iron	ppm	ASTM D5185m	>500	6		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	9		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>75	2		
Potassium	ppm	ASTM D5185m	>20	0		
Water		WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium	ppm	ASTM D5185m	>170	1		
Boron	ppm	ASTM D5185m	400	13		
Barium	ppm	ASTM D5185m	200	367		
Molybdenum	ppm	ASTM D5185m	12	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	12	0		
Calcium	ppm	ASTM D5185m	150	14		
Phosphorus	ppm	ASTM D5185m	1650	1204		
Zinc	ppm	ASTM D5185m	125	2		
Sulfur	ppm	ASTM D5185m	22500	27793		


Visc @ 40°C


cSt

ASTM D445 143

Contact/Location: M. POZAN - BELBOU

179

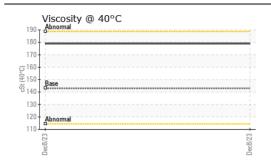

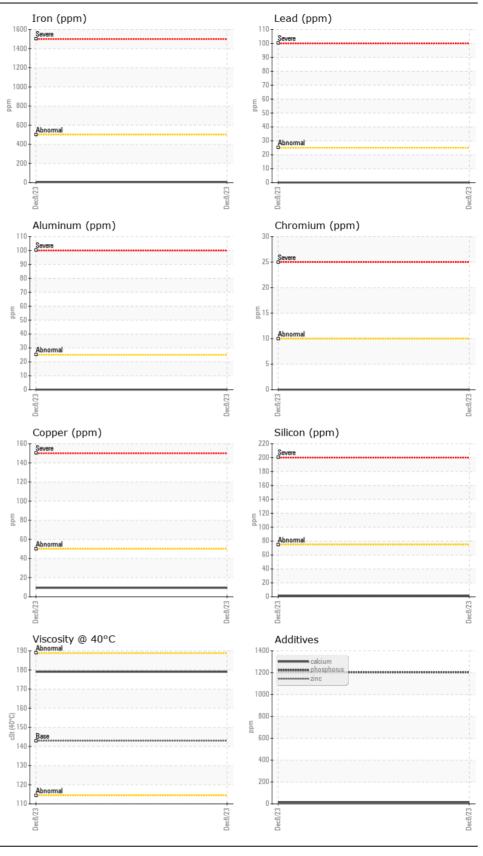

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 **BELSON STEEL** Sample No. Received 1685 N STATE RTE 50 : VCP433680 : 12 Feb 2024 Lab Number : 06086325 : 13 Feb 2024 BOURBONNAIS, IL Tested Unique Number : 10873770 : 13 Feb 2024 - Wes Davis US 60914 Diagnosed Test Package : MOB 1 Contact: M. POZAN Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. mpozan@belsonsteel.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (815)932-7416 F: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: M. POZAN - BELBOU