



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**JOHN DEERE 210G 1FF210GXEKF527620**  
 Component  
**Hydraulic System**  
 Fluid  
**HITACHI HYDRAULIC SUPER EX 46HN (--- LTR)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0179932</b>	JR0164289	JR0125810
Sample Date		Client Info		<b>09 Feb 2024</b>	28 Jul 2023	24 Aug 2022
Machine Age	hrs	Client Info		<b>3514</b>	2955	2385
Oil Age	hrs	Client Info		<b>3514</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Chngd</b>	Not Chngd	Not Chngd
Filter Changed		Client Info		<b>Not Chngd</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

PQ		ASTM D8184	>50	<b>13</b>	13	16
Iron	ppm	ASTM D5185m	>32	<b>2</b>	6	4
Chromium	ppm	ASTM D5185m	>9	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185m	>9	<b>&lt;1</b>	1	1
Lead	ppm	ASTM D5185m	>28	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>50	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185m	>5	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION











The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>11	<b>&lt;1</b>	1	<1
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	<1	0
Water		WC Method	>0.075	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>80000	<b>5897</b>	8255	16935
Particles >6µm		ASTM D7647	>20000	<b>433</b>	552	567
Particles >14µm		ASTM D7647	>640	<b>20</b>	26	7
Particles >21µm		ASTM D7647	>160	<b>5</b>	5	2
Particles >38µm		ASTM D7647	>40	<b>0</b>	0	2
Particles >71µm		ASTM D7647	>10	<b>0</b>	0	2
Oil Cleanliness		ISO 4406 (c)	>23/21/16	<b>20/16/11</b>	20/16/12	21/16/10
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.075	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>21	<b>&lt;1</b>	0	0
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Molybdenum	ppm	ASTM D5185m		<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Magnesium	ppm	ASTM D5185m		<b>0</b>	<1	0
Calcium	ppm	ASTM D5185m		<b>4</b>	14	0
Phosphorus	ppm	ASTM D5185m	827	<b>447</b>	460	490
Zinc	ppm	ASTM D5185m	0	<b>7</b>	16	11
Sulfur	ppm	ASTM D5185m	13	<b>62</b>	100	43
Acid Number (AN)	mg KOH/g	ASTM D8045	0.06	<b>0.18</b>	0.19	0.18
Visc @ 40°C	cSt	ASTM D445	47	<b>46.6</b>	46.9	46.6

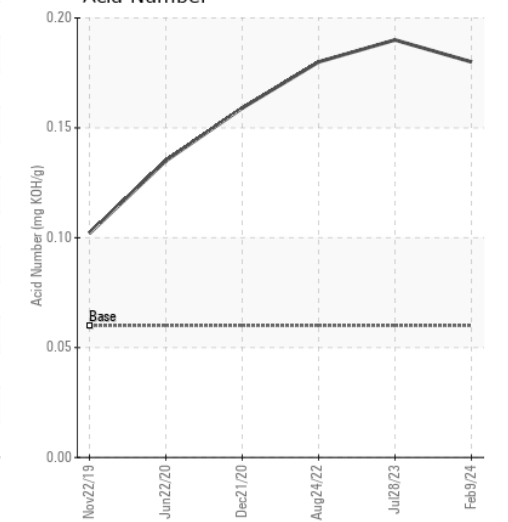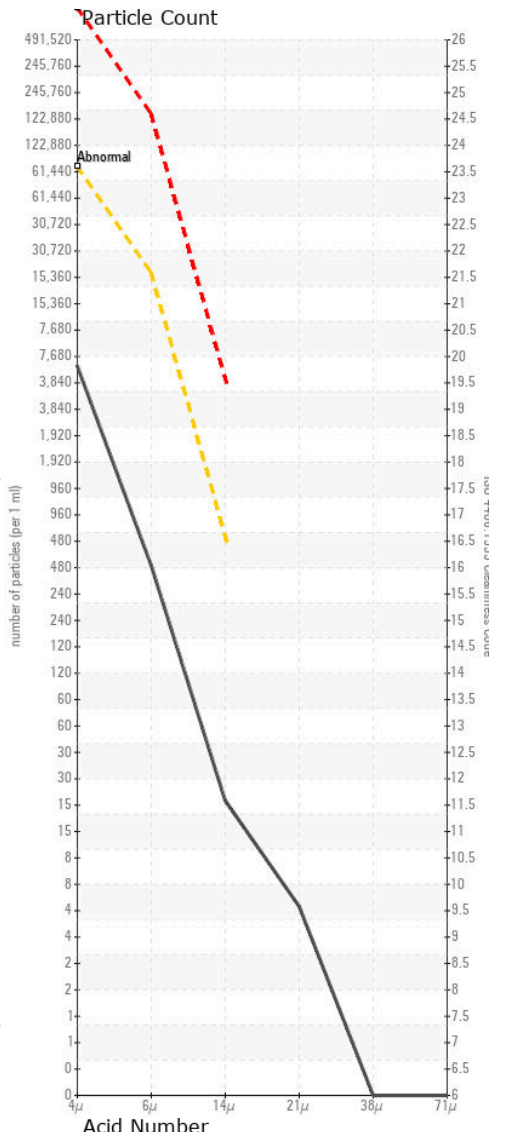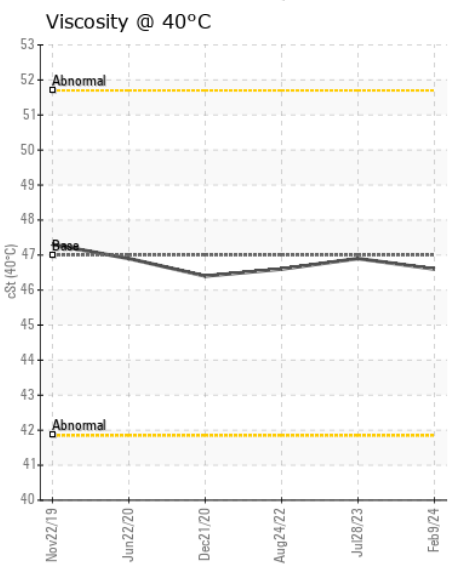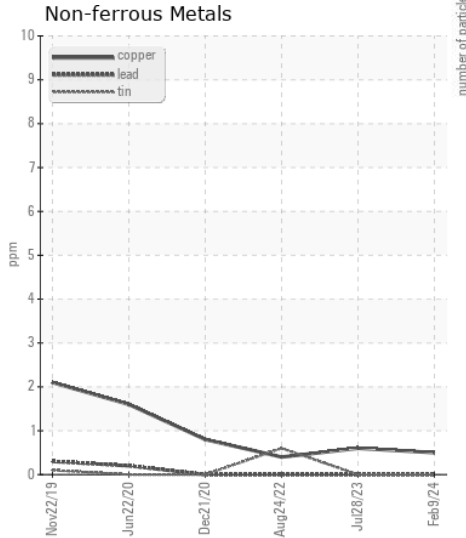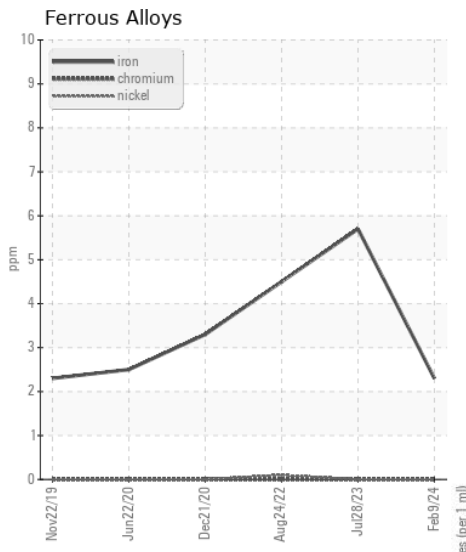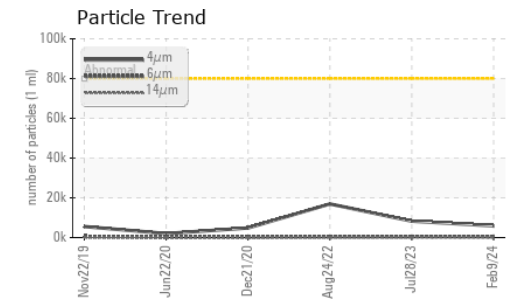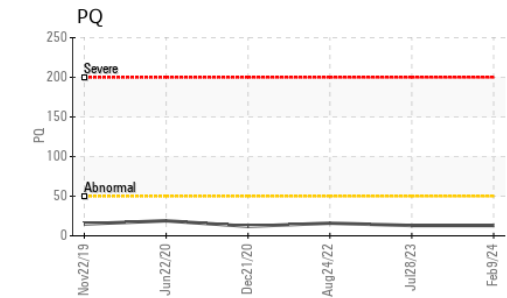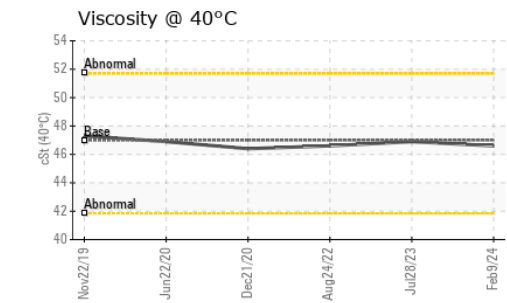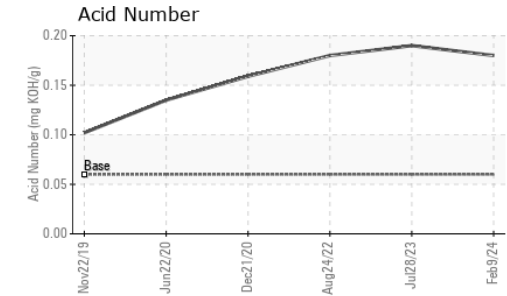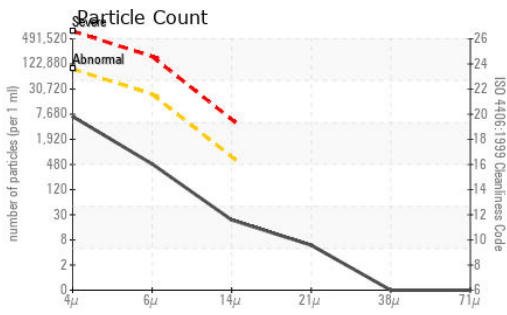

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0179932 **Received** : 13 Feb 2024  
**Lab Number** : 06087167 **Tested** : 14 Feb 2024  
**Unique Number** : 10874612 **Diagnosed** : 14 Feb 2024 - Angela Borella  
**Test Package** : CONST ( Additional Tests: PQ )

**JRE - ASHLAND**  
 11047 LEADBETTER RD  
 ASHLAND, VA  
 US 23005  
 Contact: DAVID ZIEG  
 dzieg@jamesriverequipment.com  
 T: (804)798-6001  
 F: (804)798-0292

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)