WEAR CONTAMINATION FLUID CONDITION


NORMAL NORMAL



[SWA478970-10 SACYR] Machine Id VOLVO A40G 353255

Component Transmission (Auto)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number	00111	Client Info	Ellille / toll	VCP431857		
	Sample Date		Client Info		07 Feb 2024		
	Machine Age	hrs	Client Info		1763		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
A/C A D							
WEAR	Iron	ppm	ASTM D5185m		25		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		0		
	Nickel	ppm	ASTM D5185m	>5	1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0 12		
		ppm	ASTM D5185m ASTM D5185m		0		
	Lead	ppm	ASTM D5185m		12		
	Copper Tin	ppm	ASTM D5185m		2		
	Vanadium	ppm	ASTM D5185m	>10	0		
	White Metal	ppm scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
		Scalai	visuai	NONL	·····		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>20	16		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m	>20	3		
	Water		WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		5		
The condition of the fluid is acceptable for the time in service.	Boron	ppm	ASTM D5185m		72		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		0		
	Manganese	ppm	ASTM D5185m		3		
	Magnesium	ppm	ASTM D5185m		<1		
	Calcium	ppm	ASTM D5185m		68		
	Phosphorus	ppm	ASTM D5185m		206		
	Zinc	ppm	ASTM D5185m		2		
	Sulfur	ppm	ASTM D5185m		2144		
	Visc @ 40°C	cSt	ASTM D445	05.0	28.1		

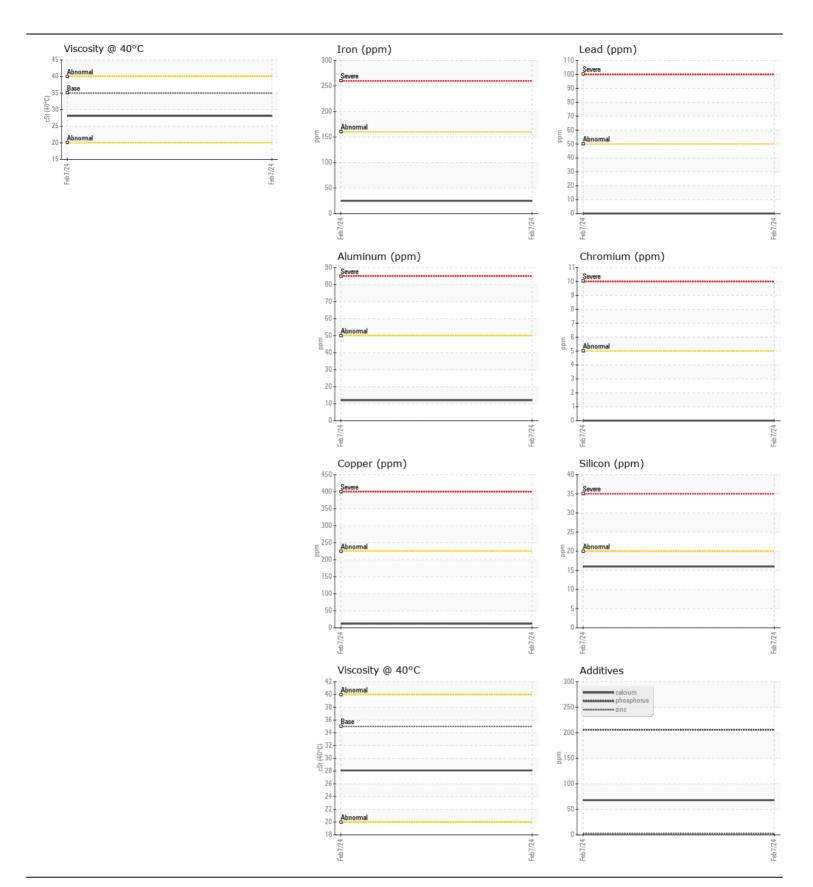



Certificate L2367

Laboratory Sample No.

Lab Number : 06088433 Unique Number: 10875878

Test Package : MOBCE

: VCP431857

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 13 Feb 2024 : 15 Feb 2024 **Tested**

: 15 Feb 2024 - Sean Felton Diagnosed

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD

TAMPA, FL US 33619

T: (813)630-0077

Contact: KENNY HANEY khaney@flaglerce.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (813)630-2233