



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**(369RBV)**  
Machine Id  
**1015A**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 15W40 (11 GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0065737</b>	GFL0065686	GFL0054454
Sample Date		Client Info		<b>09 Feb 2024</b>	21 Nov 2023	03 Oct 2022
Machine Age	hrs	Client Info		<b>0</b>	0	101592
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changd</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>Not Changd</b>	Not Changd	Not Changd
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>120	<b>5</b>	<1	17
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	<1
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185m	>20	<b>1</b>	<1	4
Lead	ppm	ASTM D5185m	>40	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185m	>330	<b>1</b>	1	3
Tin	ppm	ASTM D5185m	>15	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**







There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>6</b>	15	5
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	0	5
Fuel		WC Method	>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>4	<b>0.2</b>	0.1	1
Nitration	Abs/cm	*ASTM D7624	>20	<b>6.3</b>	4.9	10.4
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>17.4</b>	17.3	23.1
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>0</b>	3	5
Boron	ppm	ASTM D5185m	0	<b>2</b>	2	3
Barium	ppm	ASTM D5185m	0	<b>8</b>	0	0
Molybdenum	ppm	ASTM D5185m	60	<b>58</b>	59	60
Manganese	ppm	ASTM D5185m	0	<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185m	1010	<b>858</b>	950	954
Calcium	ppm	ASTM D5185m	1070	<b>952</b>	1077	1114
Phosphorus	ppm	ASTM D5185m	1150	<b>876</b>	1076	969
Zinc	ppm	ASTM D5185m	1270	<b>1112</b>	1241	1268
Sulfur	ppm	ASTM D5185m	2060	<b>2846</b>	3213	3053
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>13.7</b>	13.4	18.4
Base Number (BN)	mg KOH/g	ASTM D2896	9.8	<b>6.9</b>	9.6	6.9
Visc @ 100°C	cSt	ASTM D445	15.4	<b>14.0</b>	14.4	14.1

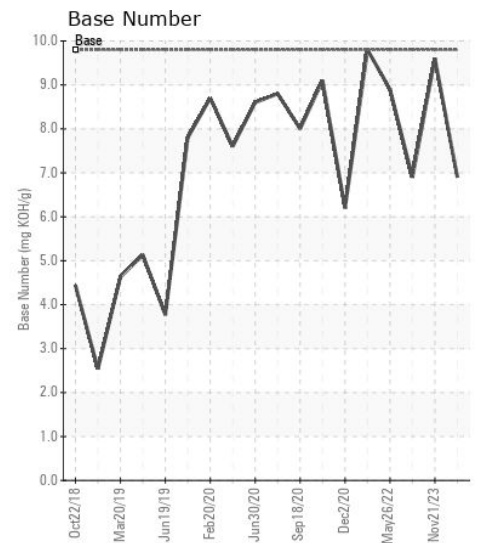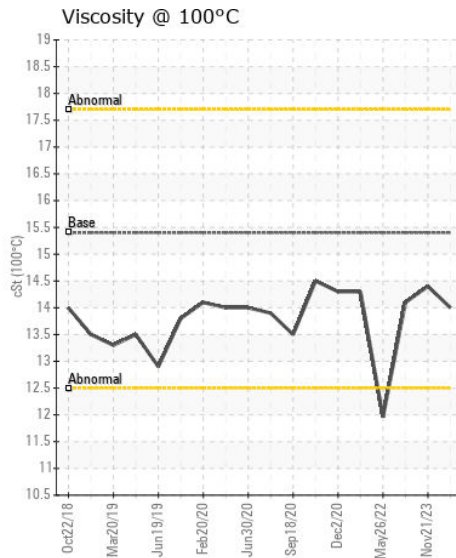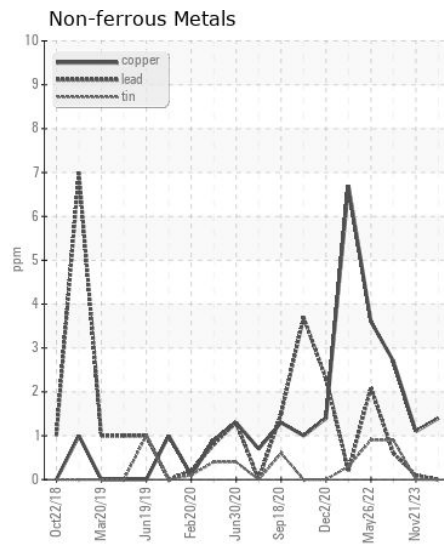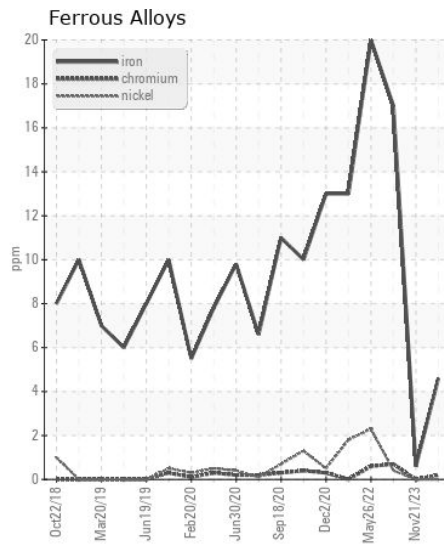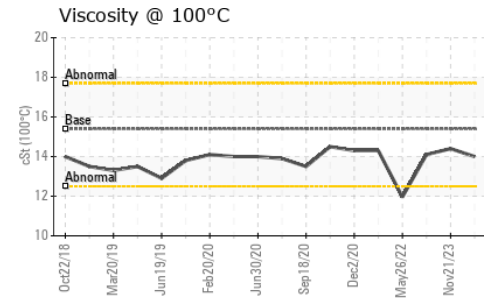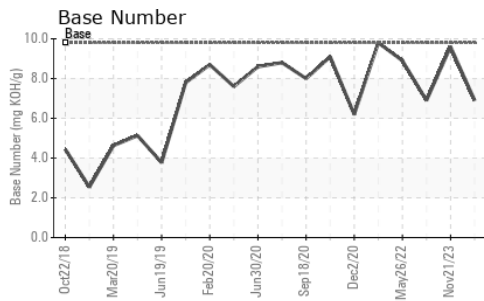

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : GFL0065737  
**Lab Number** : 06088481  
**Unique Number** : 10875926  
**Test Package** : FLEET

**Received** : 14 Feb 2024  
**Tested** : 15 Feb 2024  
**Diagnosed** : 15 Feb 2024 - Wes Davis

**GFL Environmental - 823 - Central Missouri Hauling**  
 24461 Oak Grove Lane  
 Sedalia, MO  
 US 65301

Contact: Terry Randolph  
 trandolph@gflenv.com

T: (660)631-2116

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)