



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH30M 1253-146764**  
Component  
**Front Left Wheel Hub**  
Fluid  
**{not provided} (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0276514</b>	---	---
Sample Date		Client Info		<b>08 Feb 2024</b>	---	---
Machine Age	hrs	Client Info		<b>1019</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Changed</b>	---	---
Filter Changed		Client Info		<b>Not Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>450	<b>50</b>	---	---
Chromium	ppm	ASTM D5185m	>4	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>15	<b>1</b>	---	---
Lead	ppm	ASTM D5185m	>4	<b>&lt;1</b>	---	---
Copper	ppm	ASTM D5185m	>75	<b>11</b>	---	---
Tin	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>60	<b>5</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>10</b>	---	---
Boron	ppm	ASTM D5185m		<b>55</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>0</b>	---	---
Manganese	ppm	ASTM D5185m		<b>1</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>8</b>	---	---
Calcium	ppm	ASTM D5185m		<b>1786</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>816</b>	---	---
Zinc	ppm	ASTM D5185m		<b>778</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>10152</b>	---	---
Visc @ 40°C	cSt	ASTM D445		<b>87.4</b>	---	---

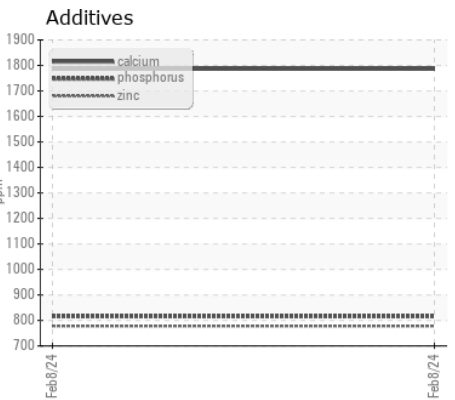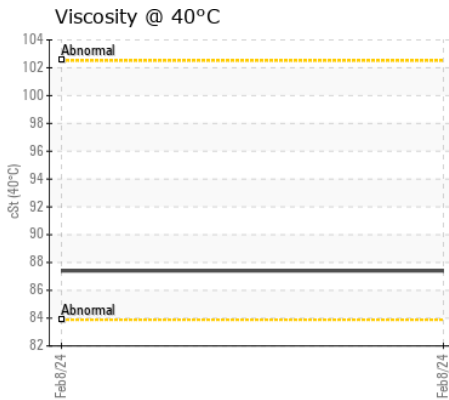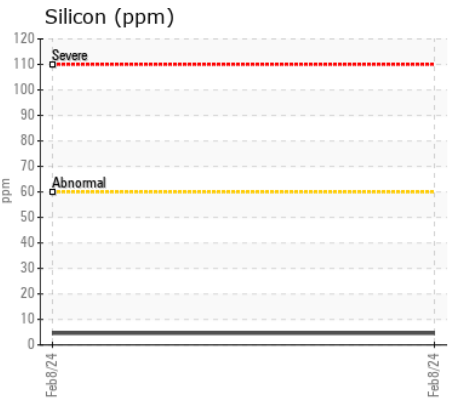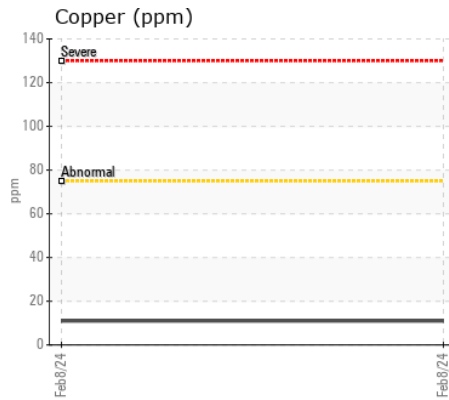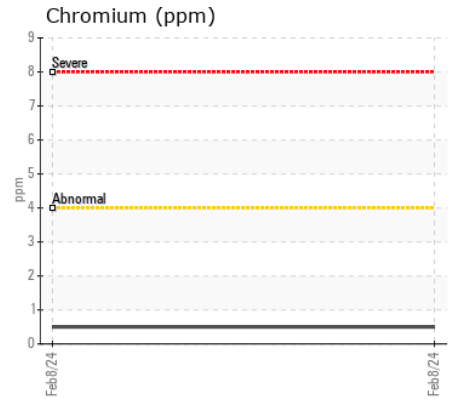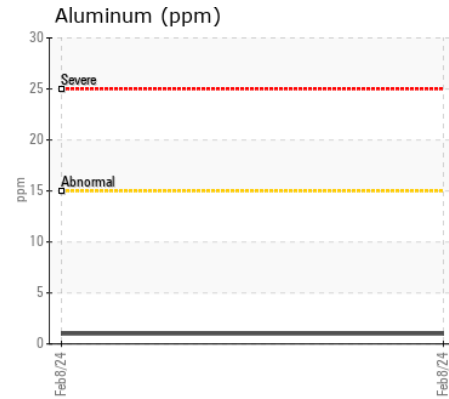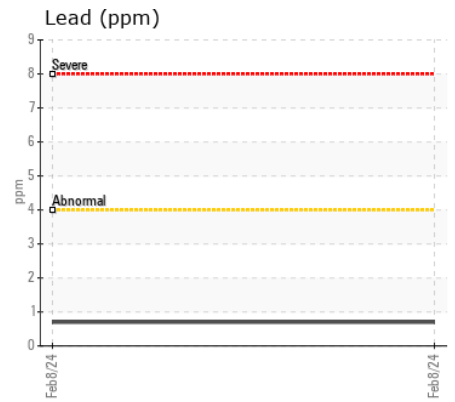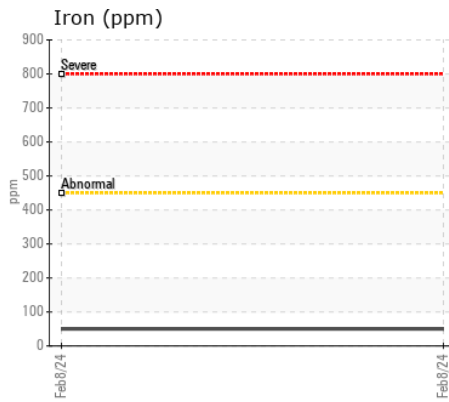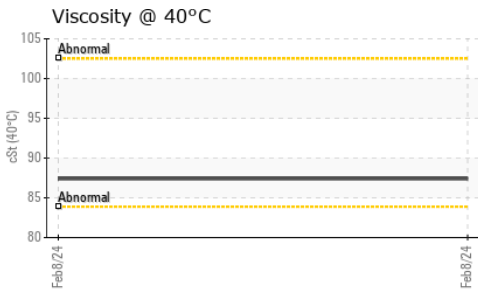

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513

**Sample No.** : LH0276514

**Lab Number** : 06089744

**Unique Number** : 10877189

**Test Package** : MOBCE

**Received** : 14 Feb 2024

**Tested** : 16 Feb 2024

**Diagnosed** : 16 Feb 2024 - Wes Davis

**TRAM CONSTRUCTION**

9279 E KY 8

GARRISON, KY

US 41141

Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: