
**WEAR** CONTAMINATION **FLUID CONDITION** 


**NORMAL NORMAL NORMAL** 


Machine Id 414123


Component
Transmission (Auto)
Fluid

DEXRON III ( GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm.	Sample Number		Client Info		GFL0112115		
	Sample Date		Client Info		17 Feb 2024		
	Machine Age	hrs	Client Info		1115		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>160	45		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>5	0		
	Aluminum	ppm	ASTM D5185m	>50	14		
	Lead	ppm	ASTM D5185m	>50	6		
	Copper	ppm	ASTM D5185m	>225	7		
	Tin	ppm	ASTM D5185m	>10	4		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	nnm	ASTM D5185m	>20	3		
There is no indication of any contamination in the fluid.	Potassium	ppm	ASTM D5185m		2		
	Water	ppiii	WC Method	>0.1	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.1	NEG		
FLUID CONDITION	Sodium	nnm	ACTM DE10Em		4		
	Boron	ppm	ASTM D5185m ASTM D5185m		4 89		
The condition of the fluid is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m		0		
	Calcium	ppm	ASTM D5185m		114		
	Phosphorus	ppm	ASTM D5185m		252		
	Zinc	ppm	ASTM D5185m		13		
	Zinc Sulfur	ppm	ASTM D5185m ASTM D5185m		13 1125		
				35.0			

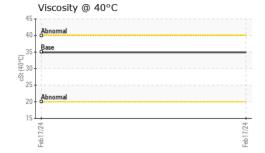

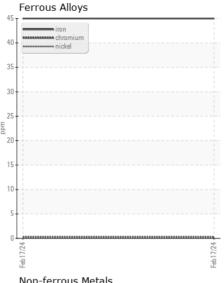

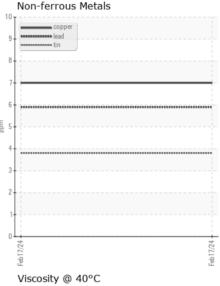

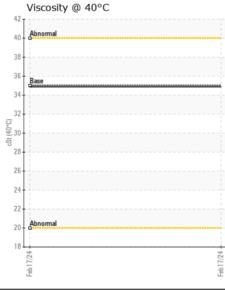



Certificate L2367

Laboratory Sample No.

: GFL0112115 Lab Number : 06097327 Unique Number : 10890180 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 22 Feb 2024 **Tested** : 23 Feb 2024 Diagnosed

: 23 Feb 2024 - Wes Davis

GFL Environmental - 983 - Sugar Land Hauling

16011 West Belfort Street Sugar Land, TX

US 77498 Contact: TECHNICIAN ACCOUNT wcgfldemo@gmail.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: