

Area [74852 LAKE CONWAY] Machine Id TAKEUCHI TB225 122600181

Rear Right Final Drive

{not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

WEAR

All component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP445674		
Sample Date		Client Info		19 Feb 2024		
Machine Age	hrs	Client Info		811		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Filter Changed		Client Info		Not Changd		
Sample Status				NORMAL		
			500			
Iron	ppm	ASTM D5185m	>500	70		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	0.5	0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m	NONE	0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>75	6		
Potassium	ppm	ASTM D5185m	>20	0		
Water		WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium	ppm	ASTM D5185m		2		
Boron	ppm	ASTM D5185m		143		
Barium	ppm	ASTM D5185m		5		
Molybdenum	ppm	ASTM D5185m		8		
Manganese	ppm	ASTM D5185m		1		
Magnesium	ppm	ASTM D5185m		35		
magnoolam	ppm	ASTM D5185m		647		
Calcium	PPIT			1		
Calcium	nnm	ASTM D5185m		860		
Phosphorus	ppm	ASTM D5185m		869 227		
	ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m		869 227 19960		


Visc @ 40°C


cSt

ASTM D445

Contact/Location: KENNY HANEY - VOLVO0093

221

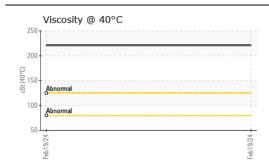

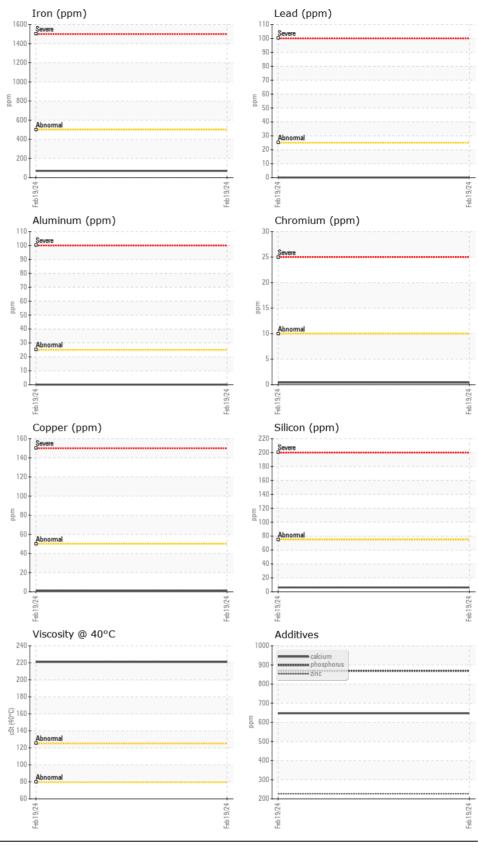

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP445674 : 23 Feb 2024 Lab Number : 06098754 TAMPA, FL Tested : 26 Feb 2024 : 26 Feb 2024 - Don Baldridge US 33619 Unique Number : 10896984 Diagnosed Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

Contact/Location: KENNY HANEY - VOLVO0093