



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**VOLVO PENTA 51220367304**

Component  
**Port Transmission (Auto)**

Fluid  
**ATF (--- GAL)**

### RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VPA036567</b>	---	---
Sample Date		Client Info		<b>22 Feb 2024</b>	---	---
Machine Age	hrs	Client Info		<b>365</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>N/A</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

PQ		ASTM D8184	>50	<b>27</b>	---	---
Iron	ppm	ASTM D5185m	>500	<b>30</b>	---	---
Chromium	ppm	ASTM D5185m	>7	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	>5	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m	>5	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>15	<b>1</b>	---	---
Lead	ppm	ASTM D5185m	>350	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>300	<b>6</b>	---	---
Tin	ppm	ASTM D5185m	>5	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION











There is no indication of any contamination in the fluid.

Silicon	ppm	ASTM D5185m	>25	<b>3</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---

### FLUID CONDITION

The condition of the fluid is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>3</b>	---	---
Boron	ppm	ASTM D5185m		<b>43</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>0</b>	---	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>13</b>	---	---
Calcium	ppm	ASTM D5185m		<b>123</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>197</b>	---	---
Zinc	ppm	ASTM D5185m		<b>21</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>1228</b>	---	---
Visc @ 40°C	cSt	ASTM D445	35.0	<b>25.73</b>	---	---

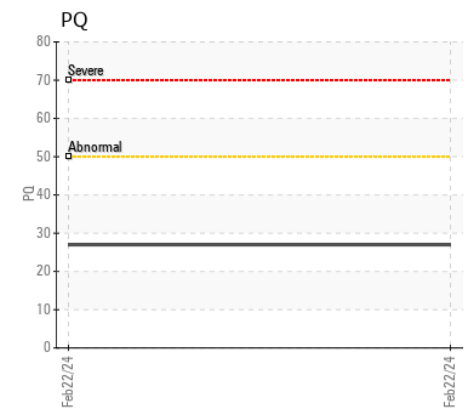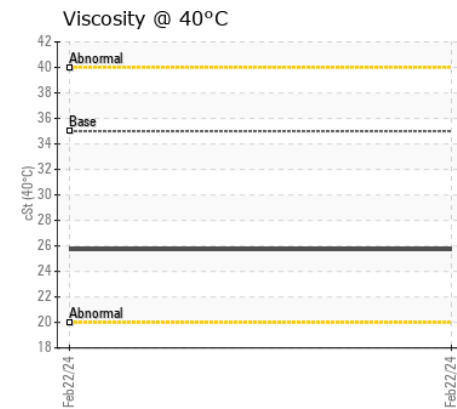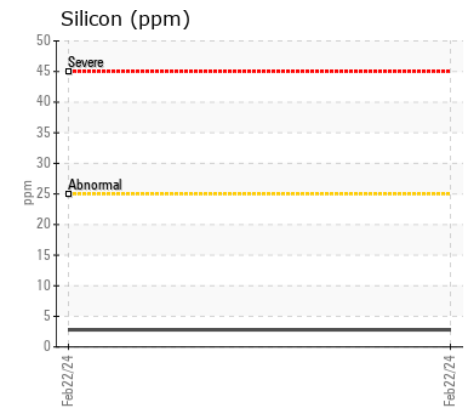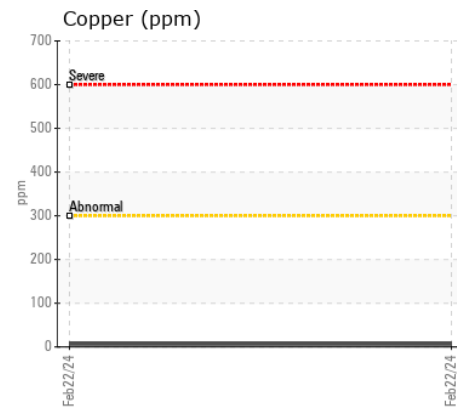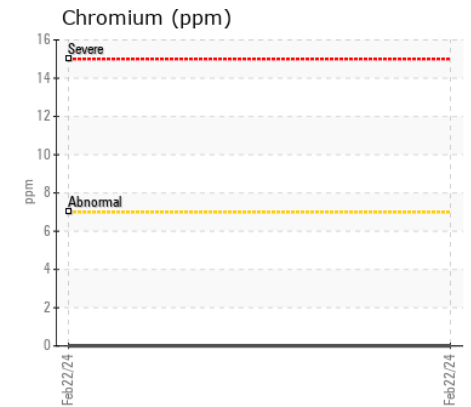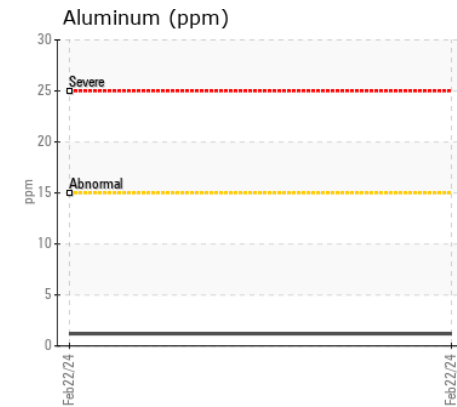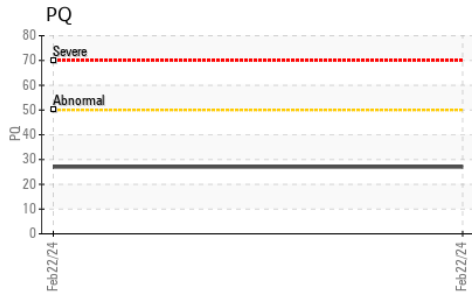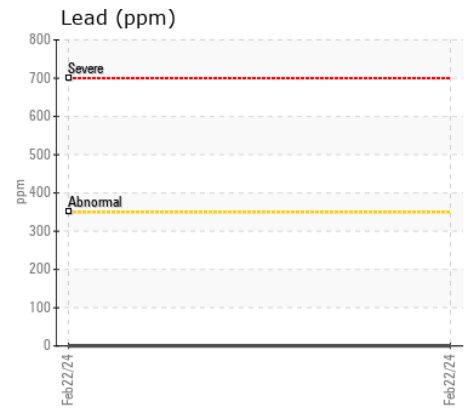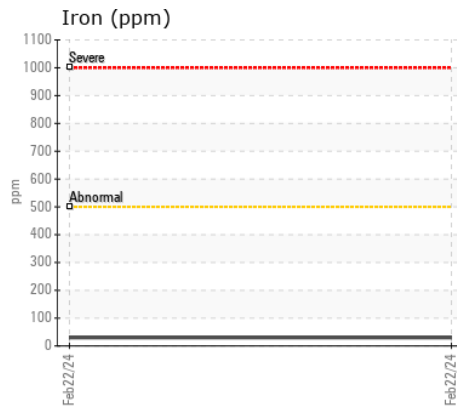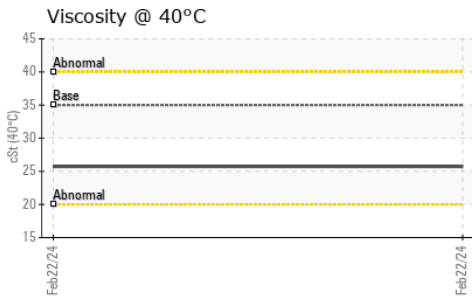

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VPA036567 **Received** : 23 Feb 2024  
**Lab Number** : 06098853 **Tested** : 23 Feb 2024  
**Unique Number** : 10897083 **Diagnosed** : 23 Feb 2024 - Doug Bogart  
**Test Package** : MOB 1 ( Additional Tests: PQ )

**SUNCOAST DIESEL MARINE**  
 6341 PORTER ROAD, SUITE 6  
 SARASOTA, FL  
 US 34240  
 Contact: SERVICE MANAGER  
 info@suncoastdmi.com  
 T: (941)342-0033  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)