



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**VOLVO A40G 352351**  
Component  
**Bogie/Center Axle**  
Fluid  
**MOBIL MOBILUBE HD 80W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP416788</b>	VCP339705	VCP406637
Sample Date		Client Info		<b>13 Feb 2024</b>	07 Nov 2023	24 Aug 2023
Machine Age	hrs	Client Info		<b>8269</b>	7750	7188
Oil Age	hrs	Client Info		<b>1081</b>	562	1168
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Not Changd	Changed
Filter Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Sample Status				<b>NORMAL</b>	NORMAL	ABNORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>10</b>	4	10
Chromium	ppm	ASTM D5185m	>20	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>30	<b>&lt;1</b>	0	0
Lead	ppm	ASTM D5185m	>50	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185m	>150	<b>&lt;1</b>	0	0
Tin	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>2</b>	1	2
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	0	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Boron	ppm	ASTM D5185m		<b>171</b>	173	223
Barium	ppm	ASTM D5185m		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	0	<1
Magnesium	ppm	ASTM D5185m		<b>9</b>	4	14
Calcium	ppm	ASTM D5185m		<b>168</b>	170	141
Phosphorus	ppm	ASTM D5185m		<b>998</b>	1006	1014
Zinc	ppm	ASTM D5185m		<b>64</b>	71	48
Sulfur	ppm	ASTM D5185m		<b>24401</b>	24847	30362
Visc @ 40°C	cSt	ASTM D445	136	<b>139</b>	139	138

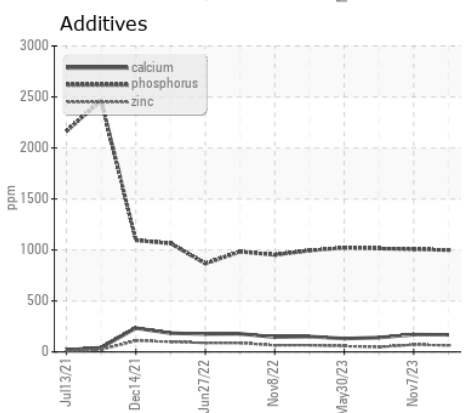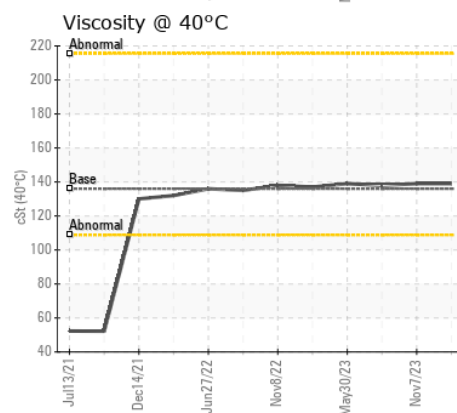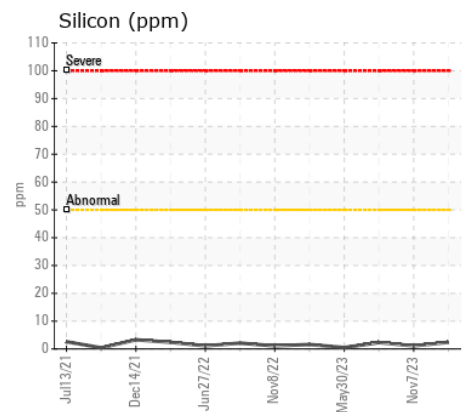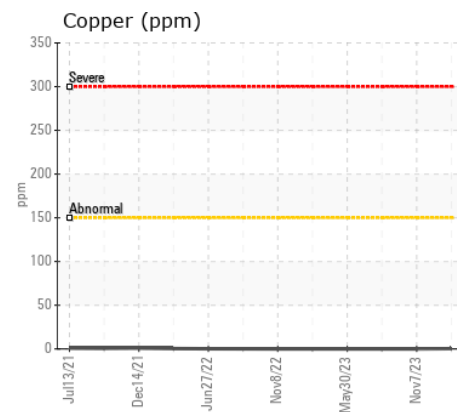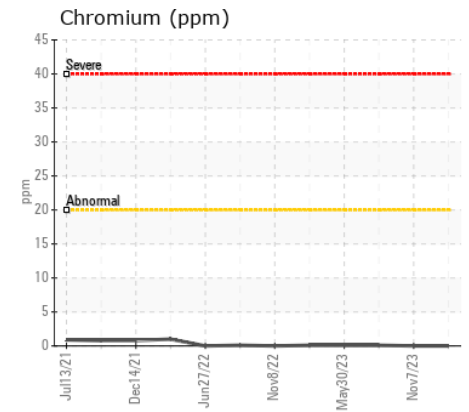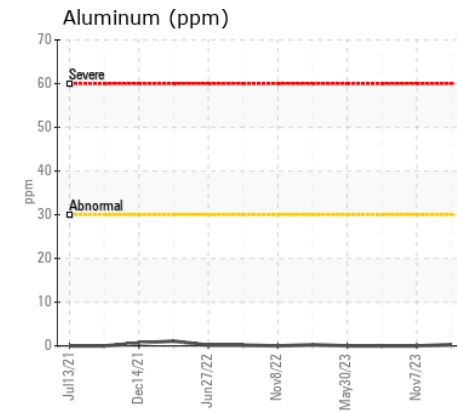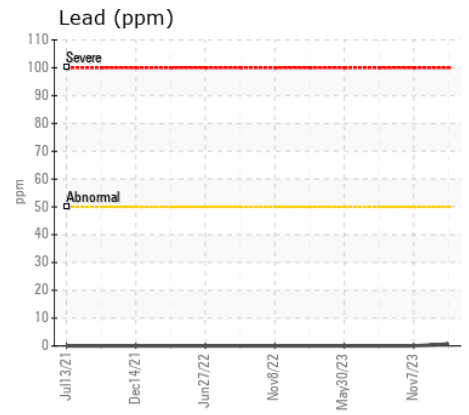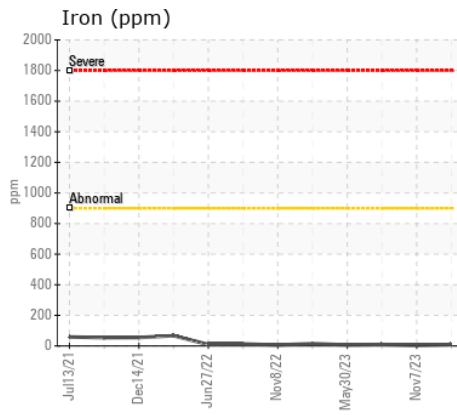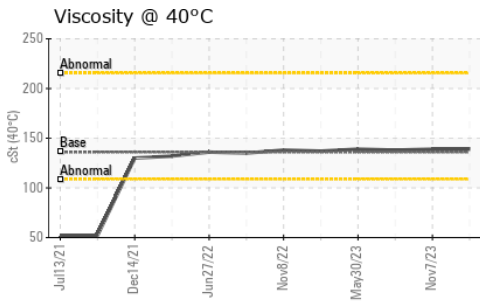

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP416788  
**Lab Number** : 06100408  
**Unique Number** : 10898638  
**Test Package** : MOB 1

**Received** : 26 Feb 2024  
**Tested** : 27 Feb 2024  
**Diagnosed** : 27 Feb 2024 - Wes Davis

**SCHILDBERG CONSTRUCTION COMPANY**  
 PO BOX 358  
 GREENFIELD, IA  
 US 50849  
 Contact: SCOTT ARMSTRONG  
 sarmstrong@schildberg.com  
 T: (641)743-8237  
 F: (641)743-2486

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)