**WEAR** CONTAMINATION **FLUID CONDITION** 


**NORMAL NORMAL NORMAL** 

Machine Id

2818365

Component Diesel Engine

ECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History
Resample at the next service interval to monitor.	Sample Number		Client Info		IL06100866	,	
	Sample Date		Client Info		31 Jan 2024		
	Machine Age	mls	Client Info		235774		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
/EAR	Iron	ppm	ASTM D5185m	>100	70		
	Chromium	ppm	ASTM D5185m		2		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m	77	0		
	Silver	ppm	ASTM D5185m	<b>\3</b>	0		
	Aluminum	ppm	ASTM D5185m		16		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		3		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
ONTAMINATION	Silicon	ppm	ASTM D5185m	>25	18		
ONTAIMINATION	Potassium	ppm	ASTM D5185m		8		
There is no indication of any contamination in the oil.	Fuel	ррпп	WC Method		<1.0		
	Water		WC Method		NEG		
	Glycol		WC Method	70.2	NEG		
	Soot %	%	*ASTM D7844	<b>\3</b>	2.4		
	Nitration	Abs/cm	*ASTM D7624	>20	18.2		
	Sulfation	Abs/.1mm	*ASTM D7415		31.6		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.2	NEG		
LUID CONDITION	Sodium	nnm	ASTM D5185m		0		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		17		
	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		47		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		535		
	Calcium	ppm	ASTM D5185m		1681		
	Phosphorus	ppm	ASTM D5185m		748		
	Zinc	ppm	ASTM D5185m		953		
	Sulfur	ppm	ASTM D5185m		2141		
	Oxidation	Abs/.1mm	*ASTM D7414	>25	34.0		
	Base Number (BN)			720	6.5		
	Visc @ 100°C	cSt	ASTM D2030		12.7		

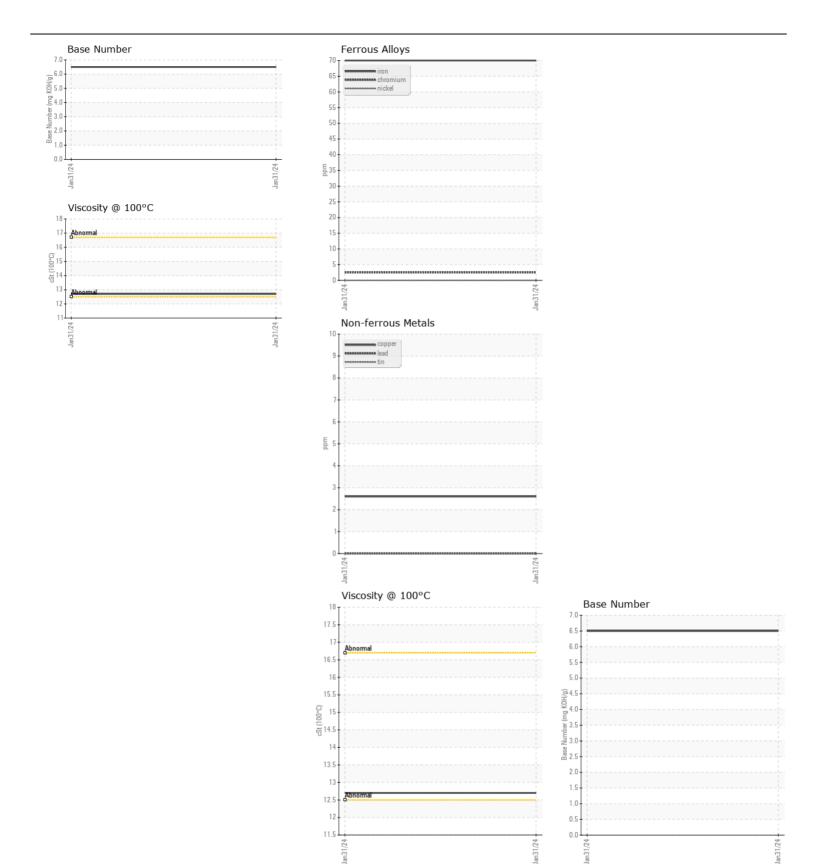





Certificate L2367

Laboratory Sample No.

: IL06100866 Lab Number : 06100866 Unique Number : 10899096 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 26 Feb 2024

: 27 Feb 2024 **Tested** : 28 Feb 2024 - Sean Felton Diagnosed

**IDEALEASE OF ATLANTA - FULTON** 

4675 BAKERS FERRY ROAD ATLANTA, GA US 30331

Contact: DAVID JOHNS davidjohns@idealease.com T: (404)699-5571

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (404)699-7420 Contact/Location: DAVID JOHNS - IDEATLGA