



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>ABNORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**JOHN DEERE 700L 1T0700LXCPF437254**

Component  
**Hydraulic System**

Fluid  
**JOHN DEERE HYDRAU (--- GAL)**

### RECOMMENDATION

We recommend you service the filters on this component. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0192853</b>	---	---
Sample Date		Client Info		<b>22 Feb 2024</b>	---	---
Machine Age	hrs	Client Info		<b>462</b>	---	---
Oil Age	hrs	Client Info		<b>462</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Chngd</b>	---	---
Filter Changed		Client Info		<b>Not Chngd</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---

### WEAR

All component wear rates are normal.

PQ	UOM	Method	Limit/Abn	Current	History1	History2
Iron	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>0</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>75	<b>0</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION










There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>5000	<b>20425</b>	---	---
Particles >6µm		ASTM D7647	>1300	<b>1892</b>	---	---
Particles >14µm		ASTM D7647	>160	<b>58</b>	---	---
Particles >21µm		ASTM D7647	>40	<b>12</b>	---	---
Particles >38µm		ASTM D7647	>10	<b>0</b>	---	---
Particles >71µm		ASTM D7647	>3	<b>0</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>22/18/13</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---

### FLUID CONDITION

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

Sodium	ppm	ASTM D5185m		<b>0</b>	---	---
Boron	ppm	ASTM D5185m		<b>0</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>3</b>	---	---
Manganese	ppm	ASTM D5185m		<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>15</b>	---	---
Calcium	ppm	ASTM D5185m	87	<b>121</b>	---	---
Phosphorus	ppm	ASTM D5185m	727	<b>611</b>	---	---
Zinc	ppm	ASTM D5185m	900	<b>817</b>	---	---
Sulfur	ppm	ASTM D5185m	1500	<b>1475</b>	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	<b>0.84</b>	---	---
Visc @ 40°C	cSt	ASTM D445	65	<b>62.4</b>	---	---

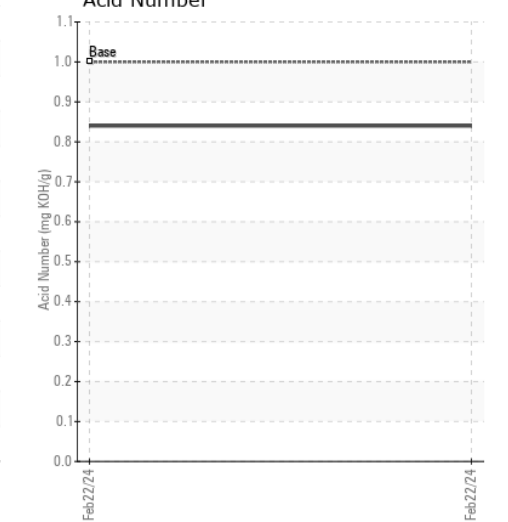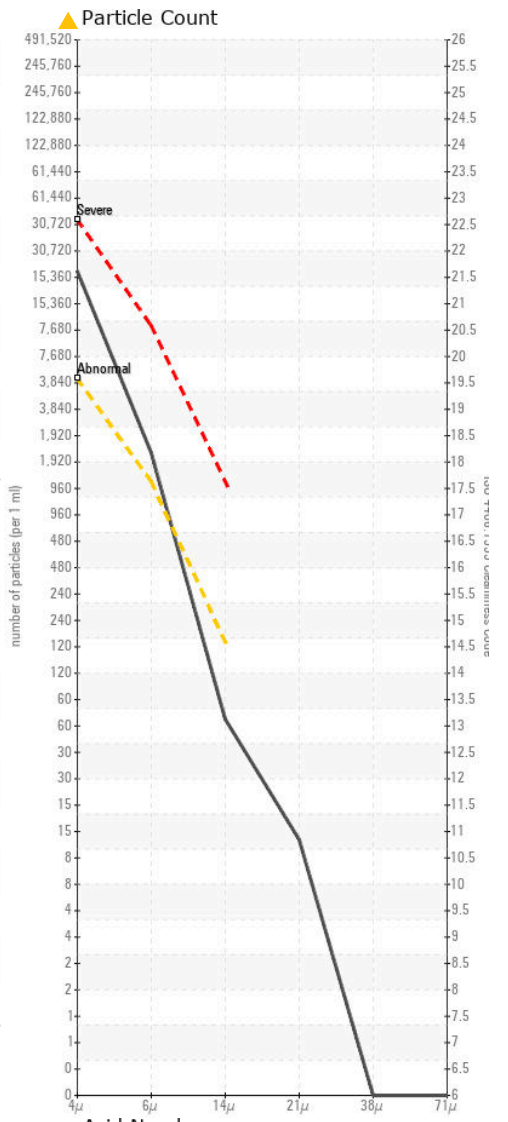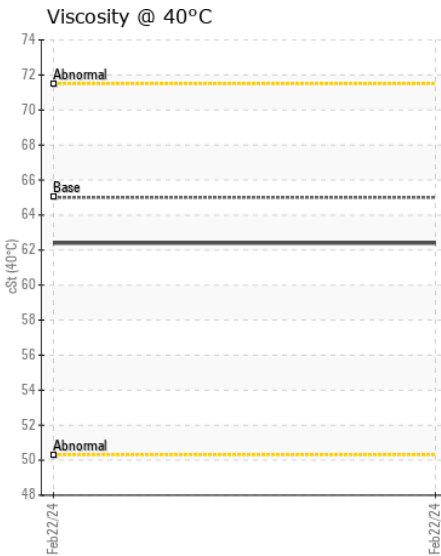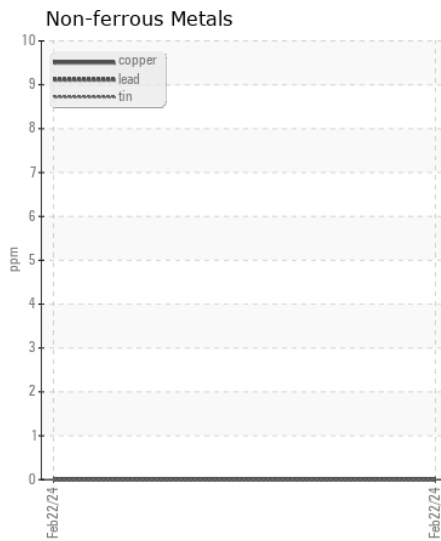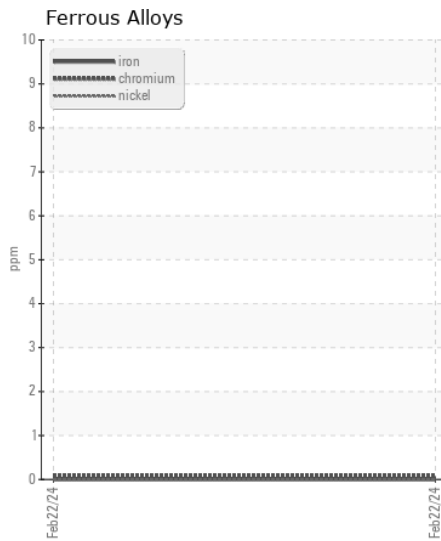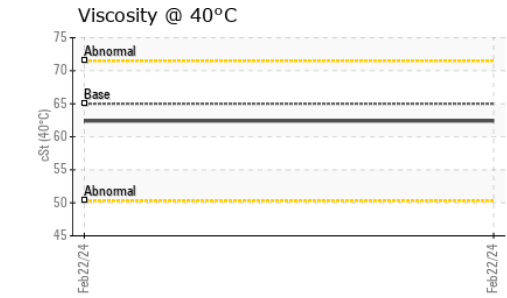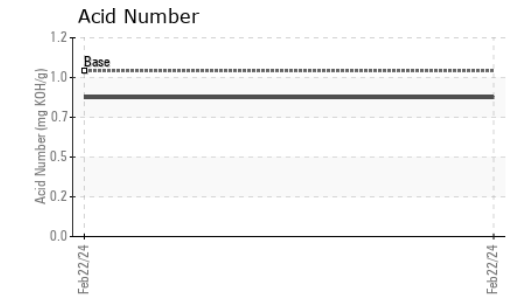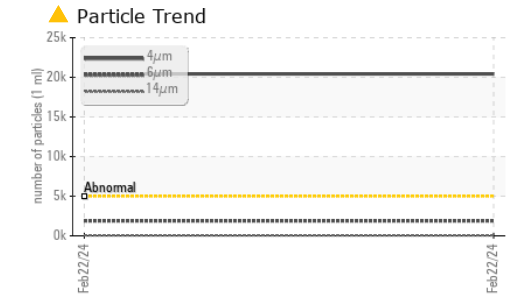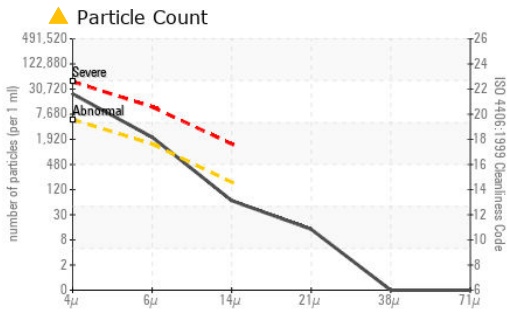

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0192853 **Received** : 27 Feb 2024  
**Lab Number** : 06101521 **Tested** : 28 Feb 2024  
**Unique Number** : 10899751 **Diagnosed** : 28 Feb 2024 - Wes Davis  
**Test Package** : CONST ( Additional Tests: PQ )

**JRE - CHARLOTTE**  
 9550 STATESVILLE ROAD  
 CHARLOTTE, NC  
 US 28269  
 Contact: CHARLOTTE SHOP  
 myoung@jamesriverequipment.com  
 T: (704)597-0211  
 F: (704)596-6198

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)