



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
[674847 LAKE CONWAY]
Machine Id
VOLVO L20H 1220453
Component
Hydraulic System
Fluid
VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP440773	VCP389633	---
Sample Date		Client Info		20 Feb 2024	21 Oct 2022	---
Machine Age	hrs	Client Info		1164	307	---
Oil Age	hrs	Client Info		0	0	---
Filter Age	hrs	Client Info		0	0	---
Oil Changed		Client Info		Not Changd	Not Changd	---
Filter Changed		Client Info		Not Changd	Not Changd	---
Sample Status				NORMAL	NORMAL	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	<1	1	---
Chromium	ppm	ASTM D5185m	>20	<1	0	---
Nickel	ppm	ASTM D5185m	>10	0	0	---
Titanium	ppm	ASTM D5185m		0	0	---
Silver	ppm	ASTM D5185m		0	0	---
Aluminum	ppm	ASTM D5185m	>20	<1	<1	---
Lead	ppm	ASTM D5185m	>20	2	1	---
Copper	ppm	ASTM D5185m	>150	4	2	---
Tin	ppm	ASTM D5185m	>20	0	0	---
Vanadium	ppm	ASTM D5185m		0	0	---
White Metal	scalar	*Visual	NONE	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	---

CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	2	<1	---
Potassium	ppm	ASTM D5185m	>20	0	0	---
Water		WC Method	>0.1	NEG	NEG	---
Particles >4µm		ASTM D7647		8389	2653	---
Particles >6µm		ASTM D7647	>2500	697	204	---
Particles >14µm		ASTM D7647	>80	32	23	---
Particles >21µm		ASTM D7647	>20	7	5	---
Particles >38µm		ASTM D7647	>4	0	1	---
Particles >71µm		ASTM D7647	>3	0	0	---
Oil Cleanliness		ISO 4406 (c)	>-/18/13	20/17/12	19/15/12	---
Silt	scalar	*Visual	NONE	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	VLITE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	---

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		0	0	---
Boron	ppm	ASTM D5185m	14	0	0	---
Barium	ppm	ASTM D5185m	0.0	0	0	---
Molybdenum	ppm	ASTM D5185m	0.0	0	0	---
Manganese	ppm	ASTM D5185m	0.0	<1	<1	---
Magnesium	ppm	ASTM D5185m	2.6	3	0	---
Calcium	ppm	ASTM D5185m	49	328	49	---
Phosphorus	ppm	ASTM D5185m	354	339	317	---
Zinc	ppm	ASTM D5185m	419	483	422	---
Sulfur	ppm	ASTM D5185m	3719	1231	1350	---
Acid Number (AN)	mg KOH/g	ASTM D8045		0.49	0.47	---
Visc @ 40°C	cSt	ASTM D445	46	44.1	42.4	---

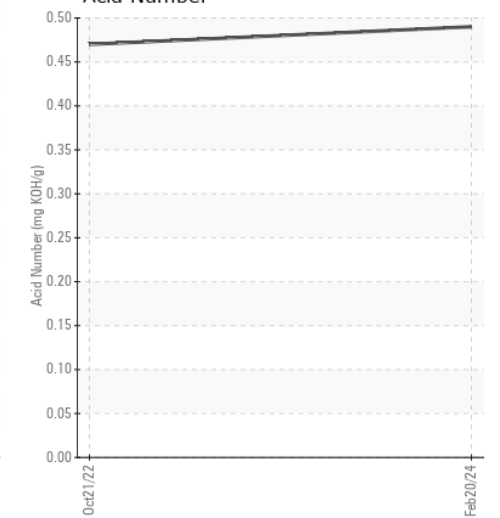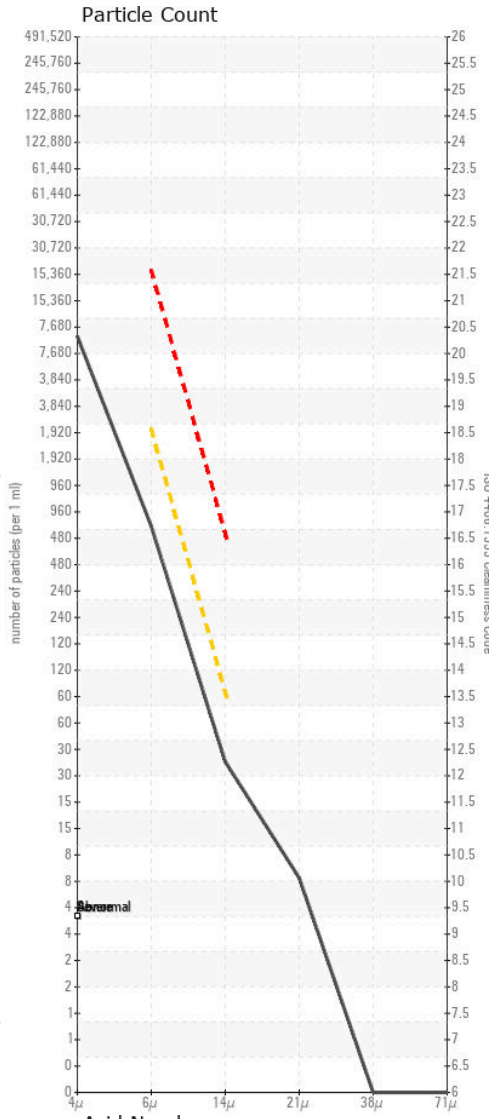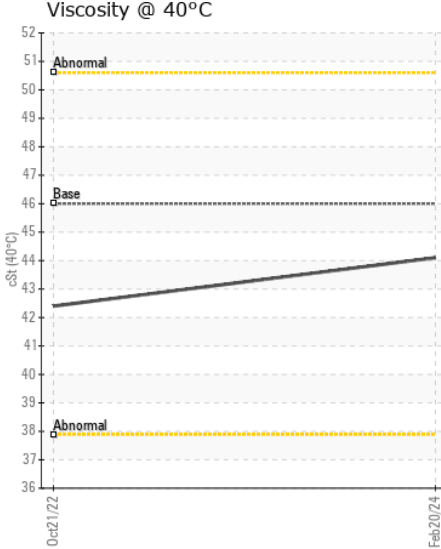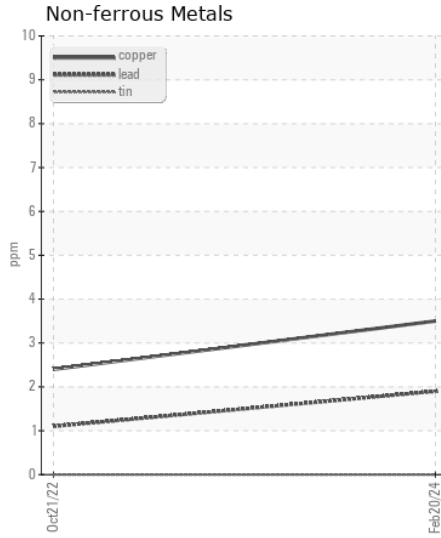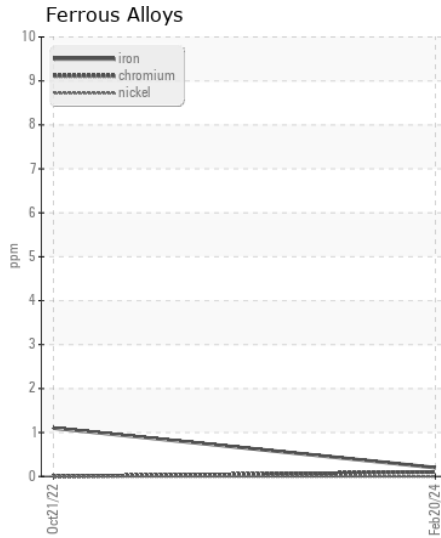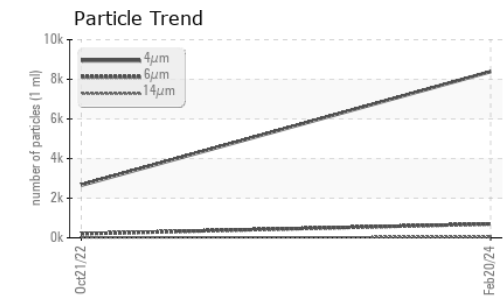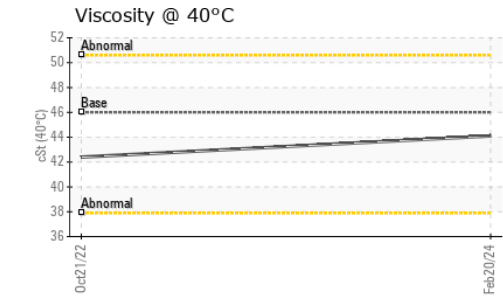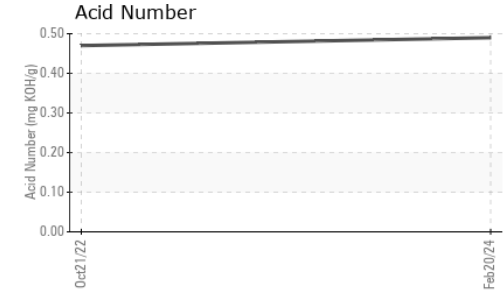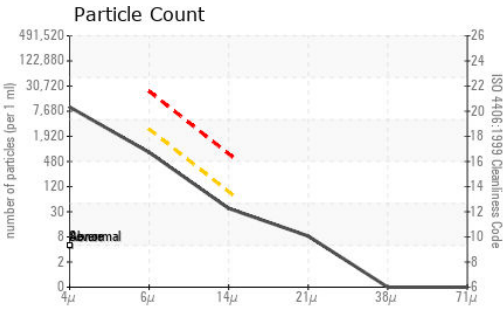

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP440773
Lab Number : 06101552
Unique Number : 10899782
Test Package : MOB 2
Received : 27 Feb 2024
Tested : 28 Feb 2024
Diagnosed : 28 Feb 2024 - Wes Davis

ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC
 9601 BOGGY CREEK RD
 ORLANDO, FL
 US 32824
 Contact: Robert LaPlante
 robert.laplante@altg.com
 T: (407)508-9736
 F: (407)659-8720

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)