



RECOMMENDATION

Resample at the next service interval to monitor.

WEAR

All component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP438955		
Sample Date		Client Info		22 Feb 2024		
Machine Age	hrs	Client Info		951		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Filter Changed		Client Info		Not Changd		
Sample Status				NORMAL		
Iron	ppm	ASTM D5185m	>500	66		
Chromium	ppm	ASTM D5185m	>20	1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m	, 10	0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>30	1		
Lead	ppm	ASTM D5185m	>50	<1		
Copper	ppm	ASTM D5185m	>300	25		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>50	8		
Potassium	ppm	ASTM D5185m	>20	1		
Water		WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium	ppm	ASTM D5185m		14		
Boron	ppm	ASTM D5185m		106		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		8		
Manganese	ppm	ASTM D5185m		4		
Magnesium	ppm	ASTM D5185m		12		
Calcium	ppm	ASTM D5185m		3273		
Phosphorus	ppm	ASTM D5185m		1134		
Zinc	ppm	ASTM D5185m		1363		

Sulfur

Visc @ 40°C

ASTM D5185m

ASTM D445 55


ppm


cSt

Contact/Location: Robert LaPlante - VOLVO0096

3498

55.6

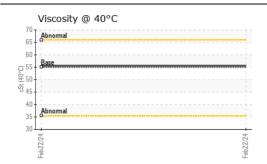

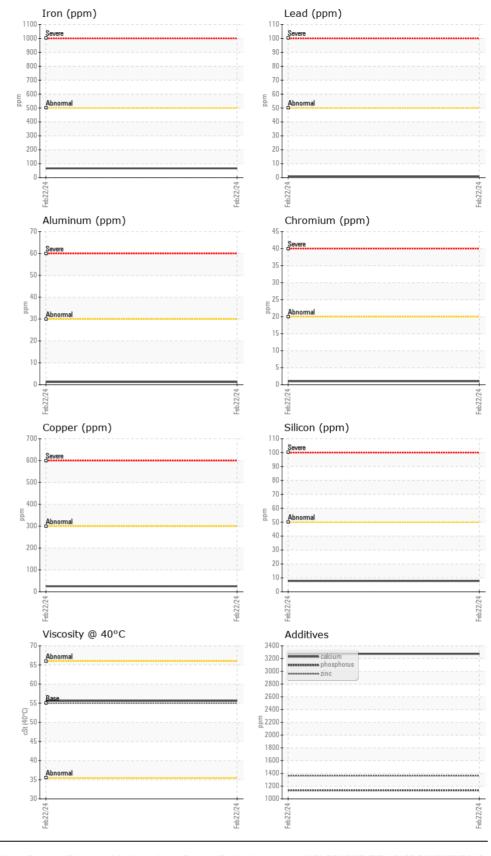



ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 9601 BOGGY CREEK RD : VCP438955 : 27 Feb 2024 Lab Number : 06102059 : 28 Feb 2024 ORLANDO, FL Tested Unique Number : 10900289 : 28 Feb 2024 - Wes Davis US 32824 Diagnosed Test Package : MOB 1 Contact: Robert LaPlante Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. robert.laplante@altg.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (407)508-9736 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (407)659-8720

Contact/Location: Robert LaPlante - VOLVO0096

Page 2 of 2