



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
[661511 PRIMORIS]
 Machine Id
VOLVO A40G 352782
 Component
Hydraulic System
 Fluid
VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP435951	VCP411093	VCP364277
Sample Date		Client Info		29 Jan 2024	28 Apr 2023	15 Aug 2022
Machine Age	hrs	Client Info		4045	3519	2306
Oil Age	hrs	Client Info		4045	0	500
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Not Changd	Not Changd
Filter Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	4	7	6
Chromium	ppm	ASTM D5185m	>20	0	0	<1
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>20	1	6	3
Lead	ppm	ASTM D5185m	>20	2	2	2
Copper	ppm	ASTM D5185m	>150	2	3	5
Tin	ppm	ASTM D5185m	>20	0	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	5	9	7
Potassium	ppm	ASTM D5185m	>20	<1	0	0
Water		WC Method	>0.1	NEG	NEG	NEG
Particles >4µm		ASTM D7647		2717	3664	9756
Particles >6µm		ASTM D7647	>5000	552	901	2716
Particles >14µm		ASTM D7647	>160	30	66	148
Particles >21µm		ASTM D7647	>40	3	16	20
Particles >38µm		ASTM D7647	>10	0	0	0
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>-/19/14	19/16/12	19/17/13	20/19/14
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		2	3	1
Boron	ppm	ASTM D5185m	14	<1	0	0
Barium	ppm	ASTM D5185m	0.0	0	0	0
Molybdenum	ppm	ASTM D5185m	0.0	0	<1	<1
Manganese	ppm	ASTM D5185m	0.0	<1	<1	0
Magnesium	ppm	ASTM D5185m	2.6	9	9	1
Calcium	ppm	ASTM D5185m	49	122	135	143
Phosphorus	ppm	ASTM D5185m	354	347	341	357
Zinc	ppm	ASTM D5185m	419	461	445	445
Sulfur	ppm	ASTM D5185m	3719	1724	1589	1504
Acid Number (AN)	mg KOH/g	ASTM D8045		0.41	0.29	0.678
Visc @ 40°C	cSt	ASTM D445	46	45.8	45.5	45.6

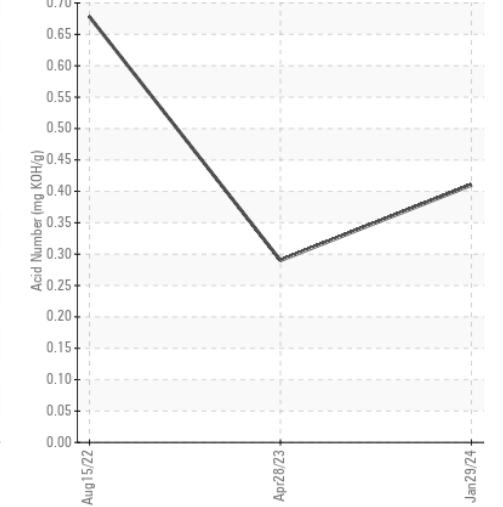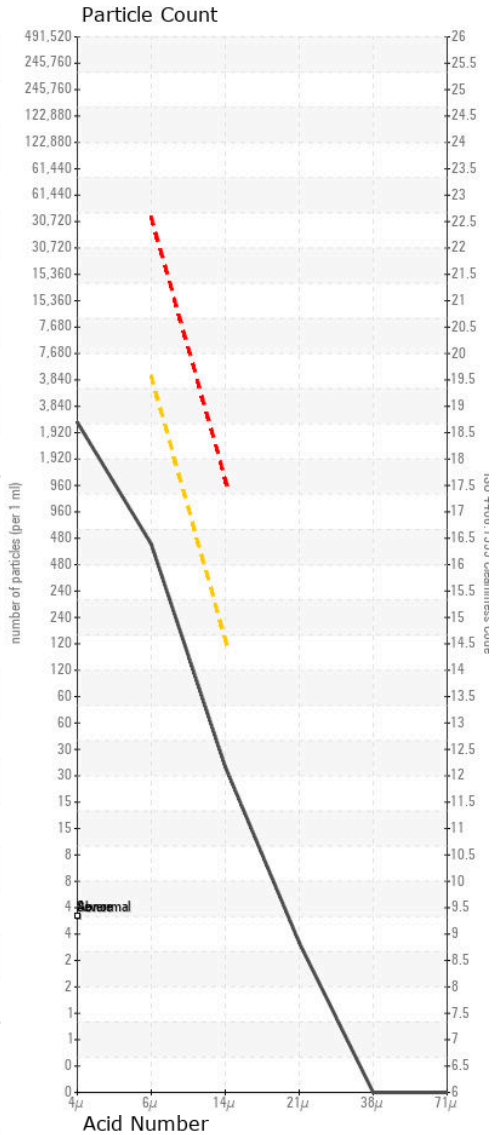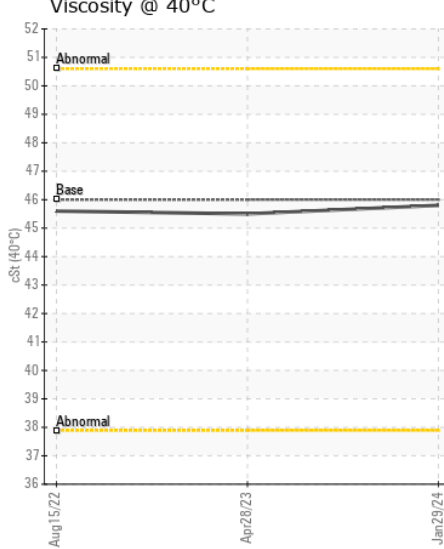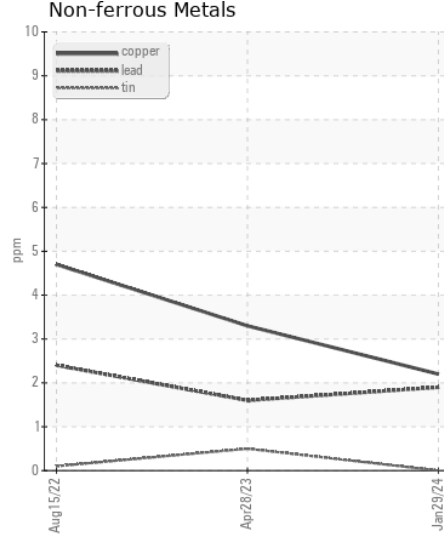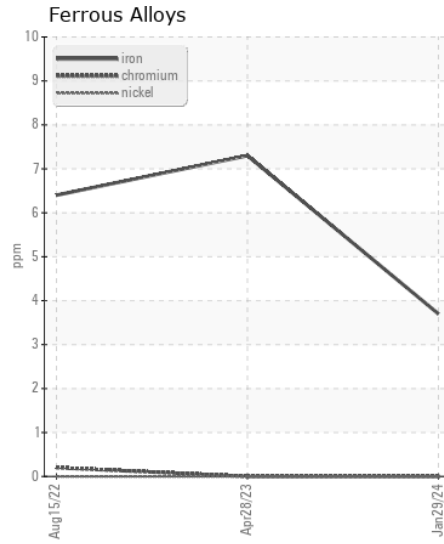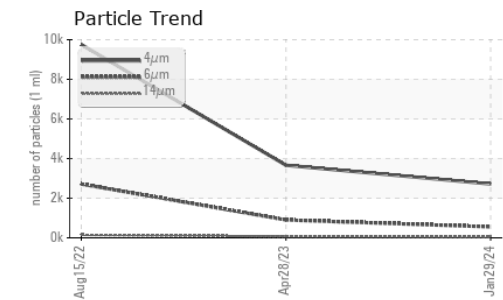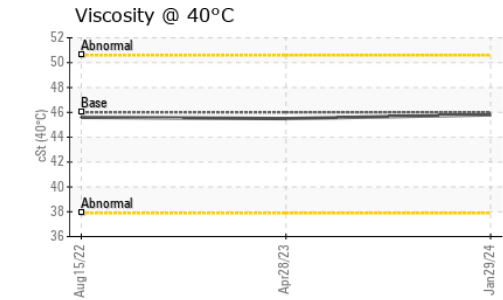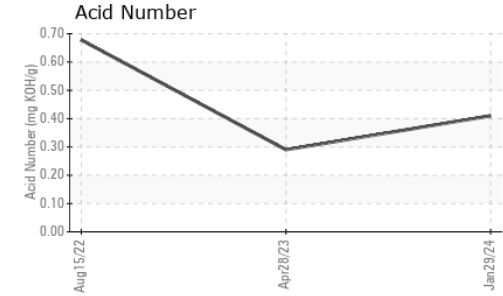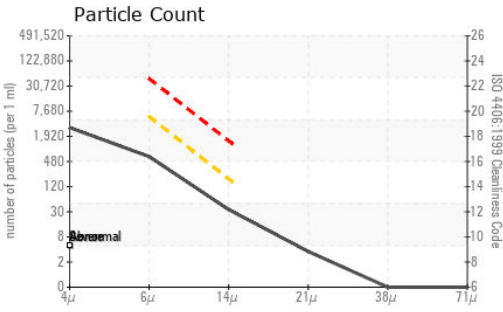

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP435951 **Received** : 28 Feb 2024
Lab Number : 06102902 **Tested** : 29 Feb 2024
Unique Number : 10901132 **Diagnosed** : 29 Feb 2024 - Wes Davis
Test Package : MOB 2

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: JOHN FARDELLA
 john.fardella@altg.com
 T: (813)630-0077
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)