



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[661511 PRIMORIS]**  
Machine Id  
**VOLVO A40G 352782**  
Component  
**Bogie/Center Axle**  
Fluid  
**VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP441650</b>	VCP420211	VCP364276
Sample Date		Client Info		<b>29 Jan 2024</b>	28 Apr 2023	15 Aug 2022
Machine Age	hrs	Client Info		<b>4045</b>	3514	2306
Oil Age	hrs	Client Info		<b>3000</b>	0	500
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Sample Status				<b>NORMAL</b>	ATTENTION	ATTENTION

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>308</b>	301	208
Chromium	ppm	ASTM D5185m	>20	<b>4</b>	2	2
Nickel	ppm	ASTM D5185m	>10	<b>2</b>	<1	<1
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>30	<b>10</b>	3	3
Lead	ppm	ASTM D5185m	>50	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>150	<b>4</b>	2	1
Tin	ppm	ASTM D5185m	>20	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	MODER	MODER
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>43</b>	13	12
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	2	2
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	0
Boron	ppm	ASTM D5185m	111	<b>174</b>	171	172
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0.9	<b>3</b>	3	3
Manganese	ppm	ASTM D5185m	0.0	<b>6</b>	5	4
Magnesium	ppm	ASTM D5185m	39	<b>21</b>	9	8
Calcium	ppm	ASTM D5185m	93	<b>105</b>	46	38
Phosphorus	ppm	ASTM D5185m	920	<b>1149</b>	1003	1079
Zinc	ppm	ASTM D5185m	104	<b>78</b>	37	43
Sulfur	ppm	ASTM D5185m	20179	<b>33318</b>	32124	29035
Visc @ 40°C	cSt	ASTM D445	333	<b>287</b>	293	296

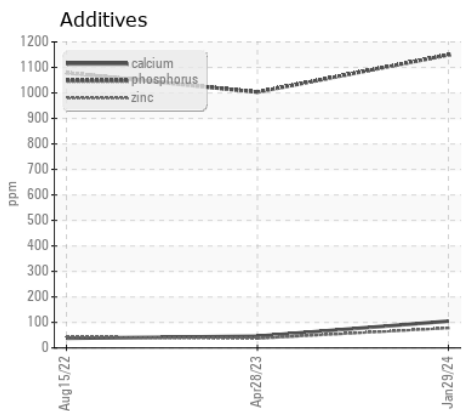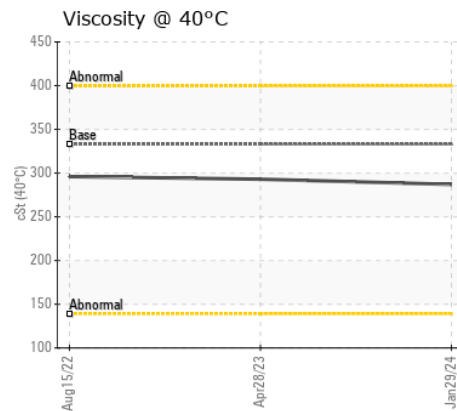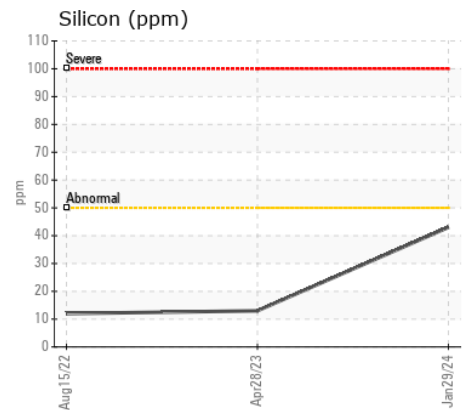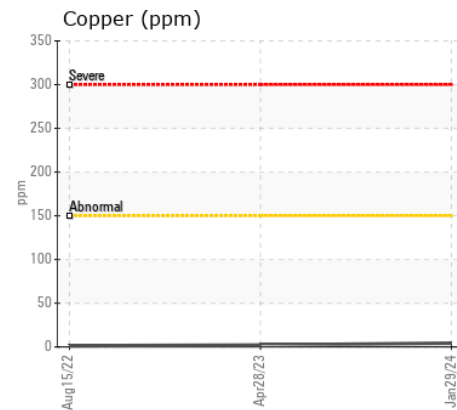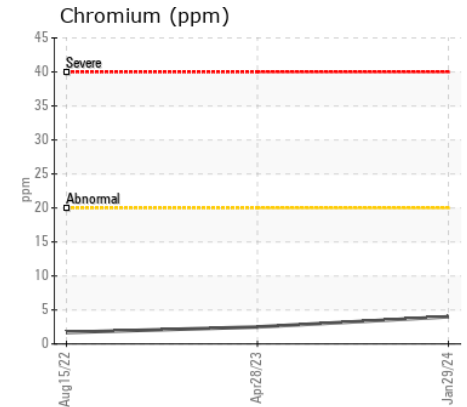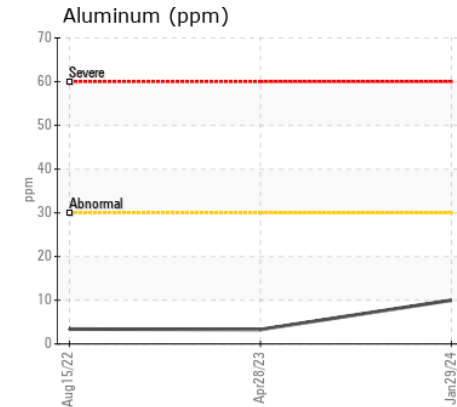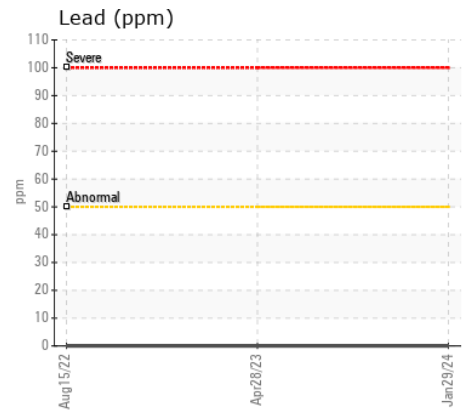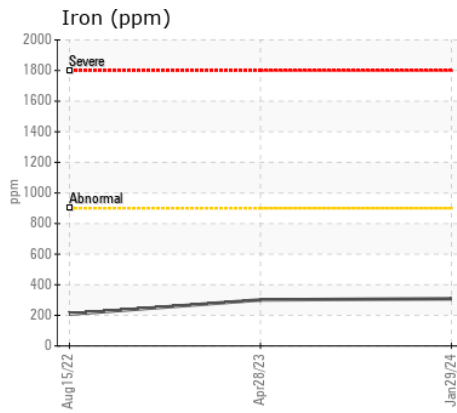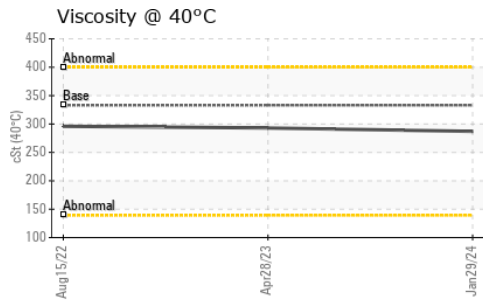

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP441650  
**Lab Number** : 06103342  
**Unique Number** : 10901572  
**Test Package** : MOB 1

**Received** : 28 Feb 2024  
**Tested** : 29 Feb 2024  
**Diagnosed** : 29 Feb 2024 - Wes Davis

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC  
 8418 PALM RIVER ROAD  
 TAMPA, FL  
 US 33619  
 Contact: KENNY HANEY  
 khaney@flaglerce.com  
 T: (813)630-0077  
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)