
**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL NORMAL NORMAL** 

C0014 - TROLLEY

Component Gearbox

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.	Test	UOM	Method	Limit/Abn	Current	History1	History2
	Sample Number		Client Info		DC0033184		
	Sample Date		Client Info		08 Feb 2024		
	Machine Age	hrs	Client Info		0		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>200	8		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		<1		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m	710	<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>25	<1		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m	>200	17		
	Tin	ppm	ASTM D5185m	>10	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTARMINATION							
CONTAMINATION	Silicon	ppm	ASTM D5185m		12		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		2		
	Water	analar	WC Method	>0.2	NEG		
	Silt Debris	scalar	*Visual	NONE	NONE NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	ppm	ASTM D5185m		1		
The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185m		8		
	Barium	ppm	ASTM D5185m		2		
	Molybdenum	ppm	ASTM D5185m		1		
	Manganese	ppm	ASTM D5185m		1		
	Magnesium	ppm	ASTM D5185m		4		
	Calcium	ppm	ASTM D5185m		242		
	Phosphorus	ppm	ASTM D5185m		707		
	Zinc	ppm	ASTM D5185m		117		
	Sulfur	ppm	ASTM D5185m		889		



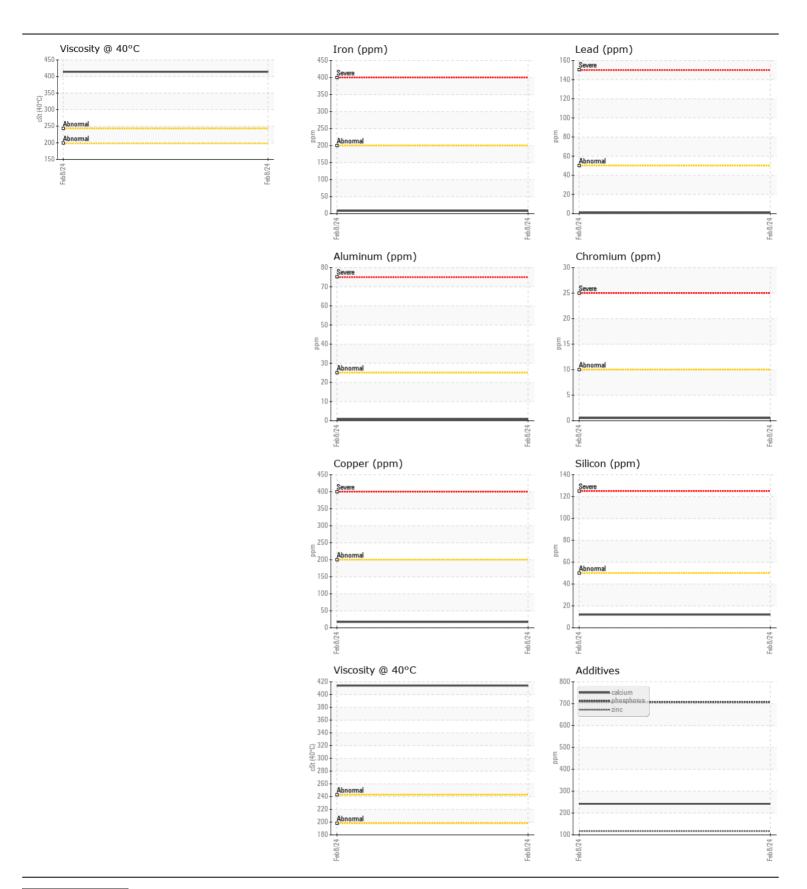

Certificate L2367

Laboratory Sample No.

Lab Number : 06103928 Unique Number: 10902158

: DC0033184 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 28 Feb 2024 **Tested** : 29 Feb 2024

: 01 Mar 2024 - Don Baldridge Diagnosed

**CRANEWORKS INC - MID-ATLANTIC** 

Contact/Location: JASON WILDE - CRAASHMA

11089 LEADBETTER ROAD ASHLAND, VA US 23005

Contact: JASON WILDE jcwilde@vacraneworks.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: