
**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL** NORMAL **NORMAL** 

## Pillen Family Farms Machine Id MILTK37

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		SBP0005330		
	Sample Date		Client Info		05 Feb 2024		
	Machine Age	mls	Client Info		350		
	Oil Age	mls	Client Info		350		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	Iron	nnm	ASTM D5185m	- 00	20	[	
VEAR		ppm			29 2		
All component wear rates are normal.	Chromium Nickel	ppm	ASTM D5185m				
		ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		5		
	Lead	ppm	ASTM D5185m		2		
	Copper	ppm	ASTM D5185m		<1		
	Tin	ppm	ASTM D5185m	>15	<1 0		
	Vanadium	ppm	ASTM D5185m	NONE	_		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	8		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	5		
	Fuel		WC Method	>3.0	<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>6	0.4		
	Nitration	Abs/cm	*ASTM D7624	>20	9.3		
	Sulfation	Abs/.1mm	*ASTM D7415	>30	20.0		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	<b>Emulsified Water</b>	scalar	*Visual	>0.2	NEG		
LUID CONDITION							
FLUID CONDITION	Sodium	ppm	ASTM D5185m		3		
The BN result indicates that there is suitable alkalinity remaining in the	Boron	ppm	ASTM D5185m		3		
oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m	0	67		
	Manganese	ppm	ASTM D5185m	0	<1		
	Magnesium	ppm	ASTM D5185m	0	1052		
	Calcium	ppm	ASTM D5185m		1138		
	Phosphorus	ppm	ASTM D5185m		1055		
	Zinc	ppm	ASTM D5185m		1343		
	Sulfur	ppm	ASTM D5185m	0.5	3102		
	Oxidation Base Number (BN)	Abs/.1mm	*ASTM D7414		16.3		
	Poor Number (DNI)	ma KINLIA	ASTIVIT19806	u /ı	7.6		



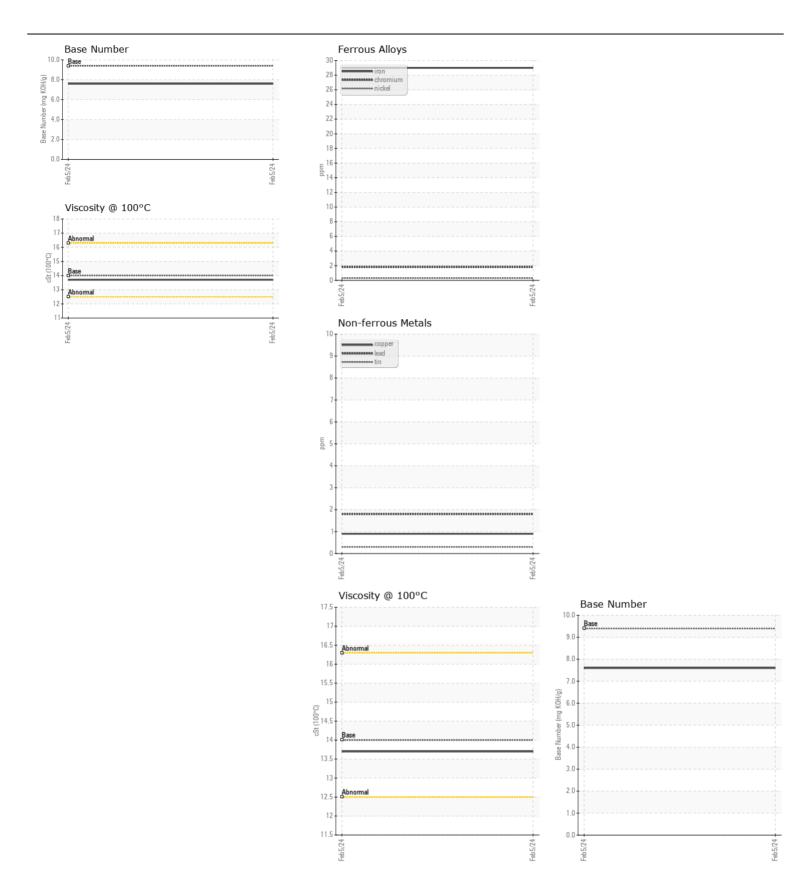



Certificate L2367

Laboratory Sample No.

Lab Number : 06104896 Unique Number: 10903126 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : SBP0005330 Received : 29 Feb 2024 : 01 Mar 2024 **Tested** 

Diagnosed

: 04 Mar 2024 - Sean Felton

Pillen Family Farms - 722828 26741 NE-91 Humphrey, NE

US 61357 Contact: Troy Runge troyfr@pillenfamilyfarms.com T: (308)390-6733

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)