



OIL ANALYSIS REPORT

WEAR	ABNORMAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL

Area
RIG 2
Machine Id
WHITE STAR 2450 R2-P-01G-NKL
Component
Gearbox
Fluid
Gearbox Oil (--- GAL)

RECOMMENDATION

We advise that you check all areas where dirt can enter the system. We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

WEAR

Gear wear is indicated.











CONTAMINATION

There is a high amount of silt (particulates < 14 microns in size) present in the oil. Elemental levels of silicon (Si) and aluminum (Al) indicate alumina-silicate (coarse dirt) ingress.

FLUID CONDITION

The AN level is acceptable for this fluid.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		KL0013899	KL0013830	KL0014049
Sample Date		Client Info		15 Feb 2024	24 Jan 2024	29 Dec 2023
Machine Age	days	Client Info		45337	0	45290
Oil Age	days	Client Info		0	0	0
Filter Age	days	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Iron	ppm	ASTM D5185m	>200	▲ 401	▲ 400	▲ 344
Chromium	ppm	ASTM D5185m	>10	3	3	3
Nickel	ppm	ASTM D5185m	>10	3	4	2
Titanium	ppm	ASTM D5185m		1	<1	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	● 16	● 15	● 10
Lead	ppm	ASTM D5185m	>50	3	0	<1
Copper	ppm	ASTM D5185m	>200	112	26	94
Tin	ppm	ASTM D5185m	>10	<1	<1	1
Vanadium	ppm	ASTM D5185m		<1	<1	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Silicon	ppm	ASTM D5185m	>50	▲ 80	▲ 63	▲ 51
Potassium	ppm	ASTM D5185m	>20	30	8	13
Water		WC Method	>0.2	NEG	NEG	NEG
Particles >4µm		ASTM D7647		646879	279999	---
Particles >6µm		ASTM D7647	>5000	▲ 439539	▲ 213410	---
Particles >14µm		ASTM D7647	>640	▲ 5564	▲ 12317	---
Particles >21µm		ASTM D7647	>160	131	▲ 249	---
Particles >38µm		ASTM D7647	>40	0	1	---
Particles >71µm		ASTM D7647	>10	0	0	---
Oil Cleanliness		ISO 4406 (c)	>19/16	▲ 26/20	▲ 25/21	---
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Sodium	ppm	ASTM D5185m		420	136	150
Boron	ppm	ASTM D5185m		19	25	31
Barium	ppm	ASTM D5185m		97	30	56
Molybdenum	ppm	ASTM D5185m		288	17	330
Manganese	ppm	ASTM D5185m		3	3	3
Magnesium	ppm	ASTM D5185m		31	26	18
Calcium	ppm	ASTM D5185m		130	131	69
Phosphorus	ppm	ASTM D5185m		218	267	160
Zinc	ppm	ASTM D5185m		63	48	56
Sulfur	ppm	ASTM D5185m		7601	7101	8046
Acid Number (AN)	mg KOH/g	ASTM D8045		0.60	0.41	---
Visc @ 40°C	cSt	ASTM D445		428	404	423

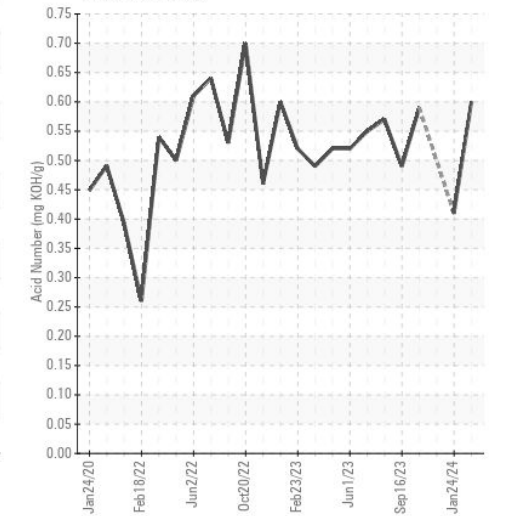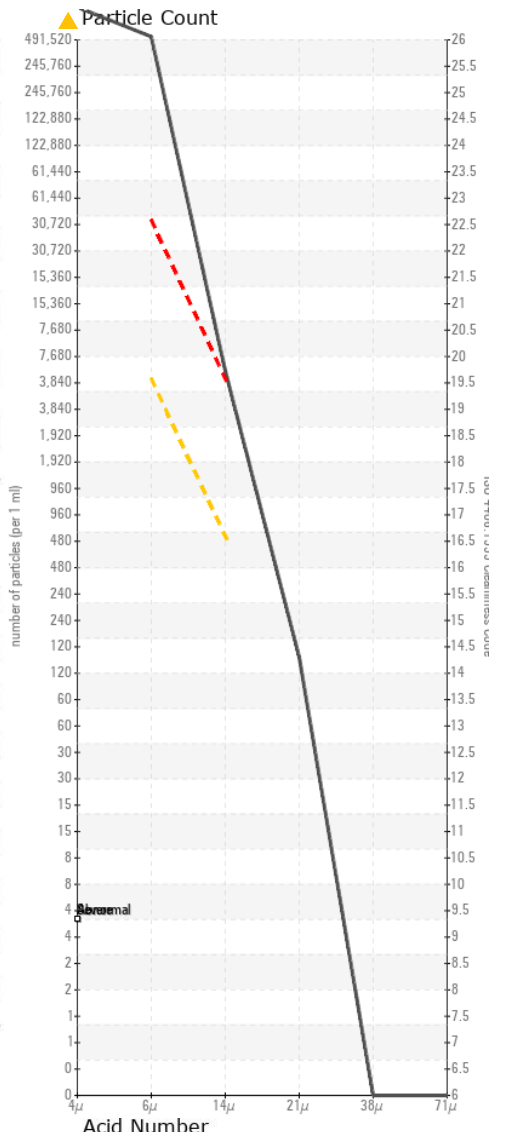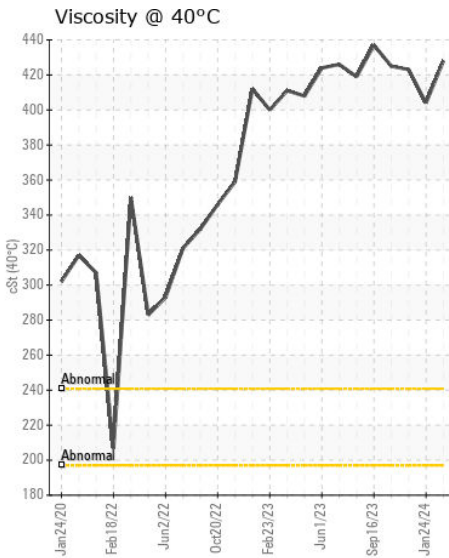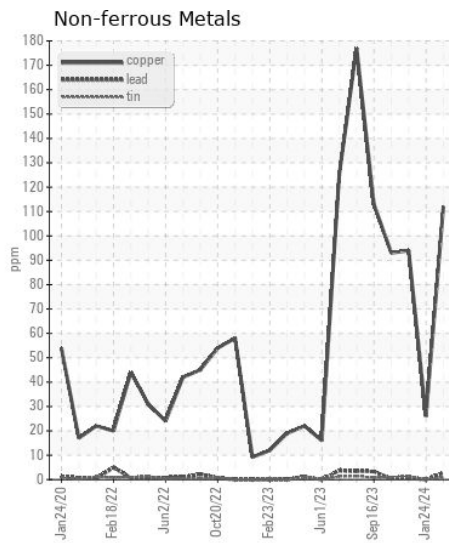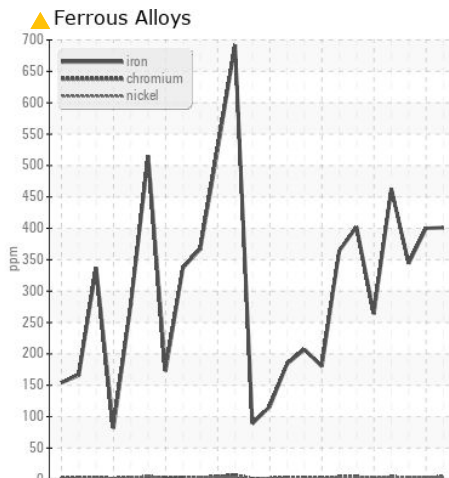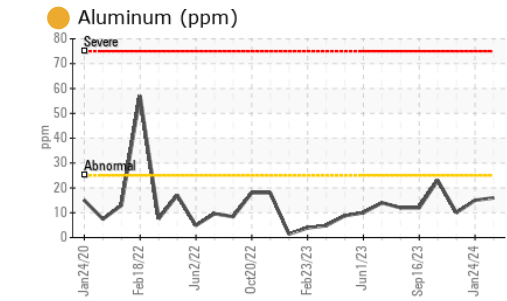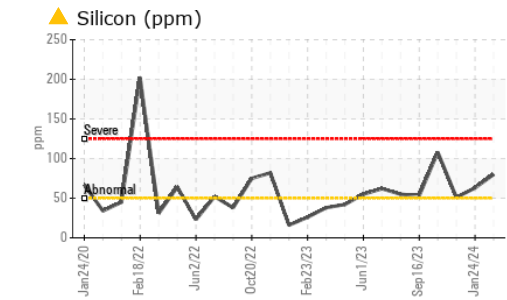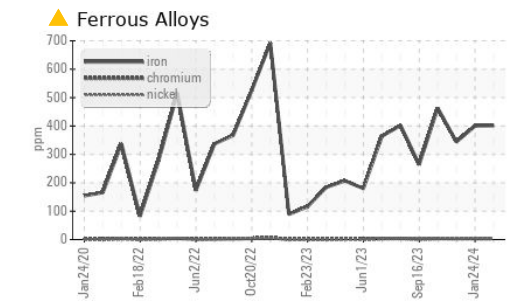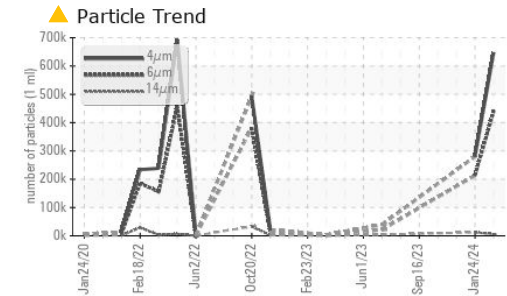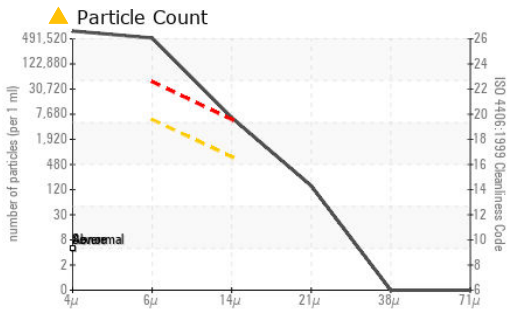

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KL0013899 **Received** : 29 Feb 2024
Lab Number : 06105187 **Tested** : 01 Mar 2024
Unique Number : 10903417 **Diagnosed** : 04 Mar 2024 - Don Baldrige
Test Package : MOB 2 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

CITADEL DRILLING
 7550 W I20
 ODESSA, TX
 US 79763
 Contact: MIKE COMBDEN
 mcombden@citadelldrilling.com
 T: (780)955-5509
 F: