



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[61239]**  
Machine Id  
**VOLVO A25G 740358**  
Component  
**Front Axle**  
Fluid  
**VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP454345</b>	VCP421081	VCP353503
Sample Date		Client Info		<b>23 Feb 2024</b>	31 Mar 2023	10 Jun 2022
Machine Age	hrs	Client Info		<b>10241</b>	9085	8321
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>85</b>	144	125
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	2
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	<1
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>30	<b>0</b>	1	0
Lead	ppm	ASTM D5185m	>50	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>150	<b>9</b>	9	7
Tin	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>2</b>	3	2
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Boron	ppm	ASTM D5185m	111	<b>137</b>	166	184
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	2
Molybdenum	ppm	ASTM D5185m	0.9	<b>&lt;1</b>	2	2
Manganese	ppm	ASTM D5185m	0.0	<b>2</b>	2	2
Magnesium	ppm	ASTM D5185m	39	<b>7</b>	8	7
Calcium	ppm	ASTM D5185m	93	<b>90</b>	100	95
Phosphorus	ppm	ASTM D5185m	920	<b>996</b>	1015	972
Zinc	ppm	ASTM D5185m	104	<b>42</b>	33	47
Sulfur	ppm	ASTM D5185m	20179	<b>27457</b>	25056	24109
Visc @ 40°C	cSt	ASTM D445	333	<b>286</b>	287	287

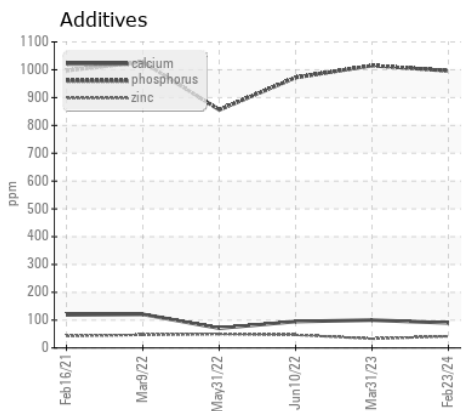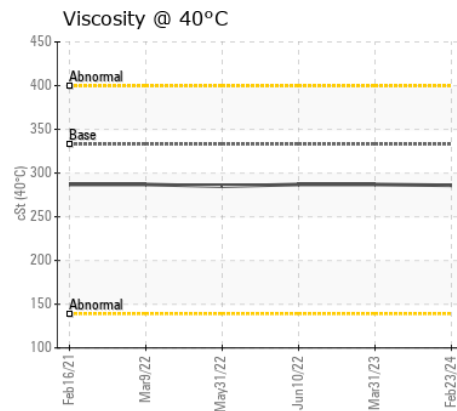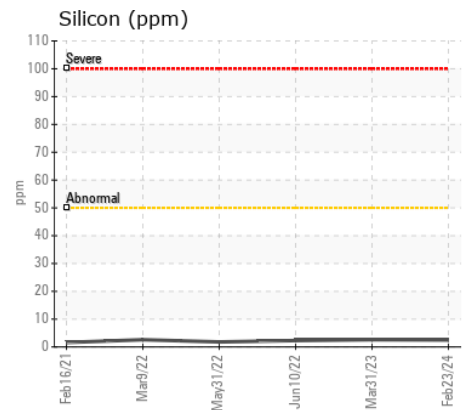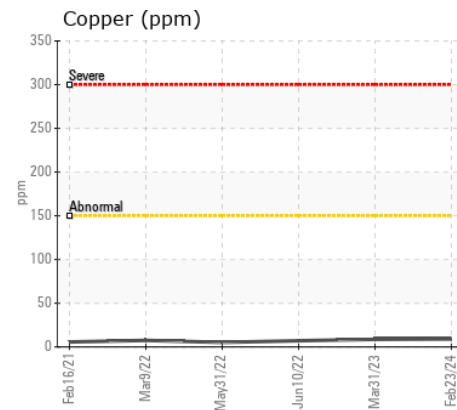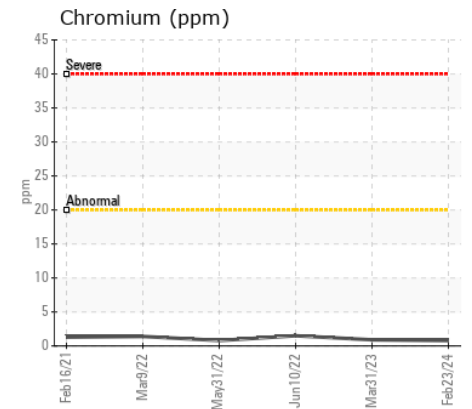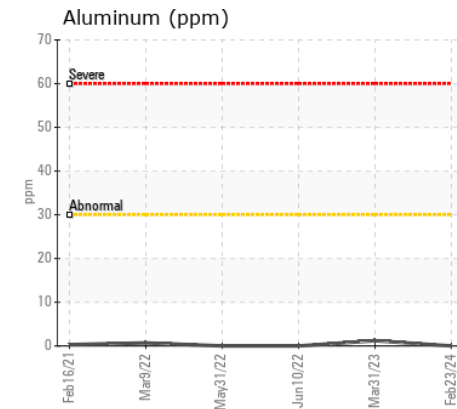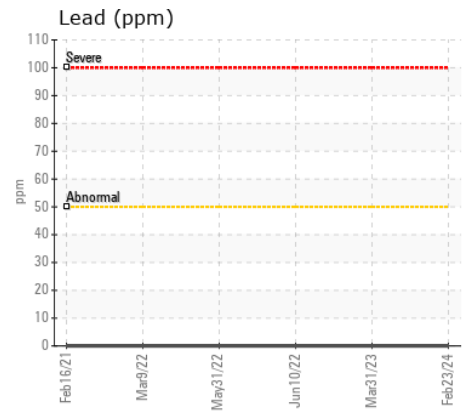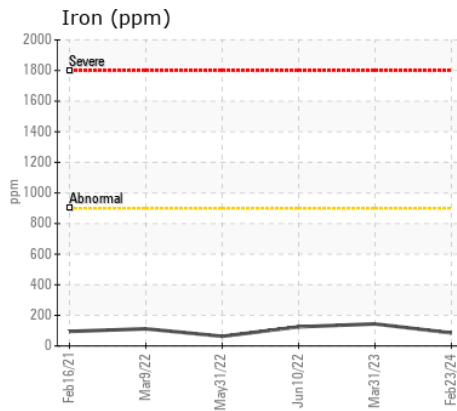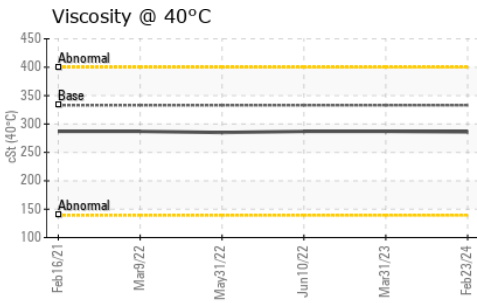

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP454345  
**Lab Number** : 06105488  
**Unique Number** : 10903718  
**Test Package** : MOB 1  
**Received** : 29 Feb 2024  
**Tested** : 02 Mar 2024  
**Diagnosed** : 02 Mar 2024 - Wes Davis

**WLW CONSTRUCTION**  
 PO BOX 377  
 MT DORA, FL  
 US 32756-0377  
 Contact: ELAINE STULTZ  
 elaine@wlwconstruction.com  
 T: (352)383-7305  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)