



OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area  
**AMR-St Louis**  
 Machine Id  
**574183 SENNEBOGEN 840M 85001185**  
 Component  
**Rear Right Final Drive**  
 Fluid  
**SHELL SPIRAX HD 80W90 (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>DJJ0020854</b>	DJJ0020679	DJJ0012681
Sample Date		Client Info		<b>29 Jan 2024</b>	13 Oct 2023	14 Jul 2023
Machine Age	hrs	Client Info		<b>9415</b>	8892	8358
Oil Age	hrs	Client Info		<b>1000</b>	500	1000
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Not Changd	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>500	<b>2</b>	2	5
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>25	<b>0</b>	0	0
Lead	ppm	ASTM D5185m	>25	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>50	<b>0</b>	0	<1
Tin	ppm	ASTM D5185m	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>75	<b>0</b>	<1	<1
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	0	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>2</b>	2	<1
Boron	ppm	ASTM D5185m	234	<b>255</b>	269	323
Barium	ppm	ASTM D5185m	0.1	<b>0</b>	<1	0
Molybdenum	ppm	ASTM D5185m	0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	<1	<1
Calcium	ppm	ASTM D5185m	0.4	<b>3</b>	21	35
Phosphorus	ppm	ASTM D5185m	864	<b>1067</b>	967	999
Zinc	ppm	ASTM D5185m	0.6	<b>0</b>	3	17
Sulfur	ppm	ASTM D5185m	16893	<b>21100</b>	17789	20622
Visc @ 40°C	cSt	ASTM D445	139	<b>133</b>	132	137

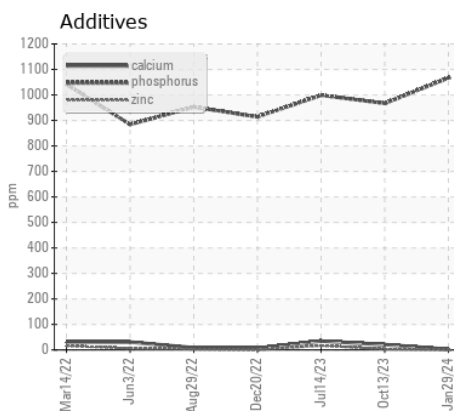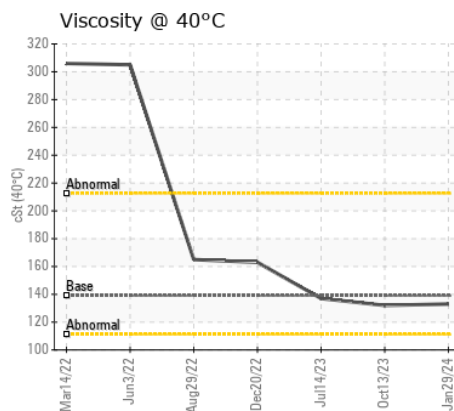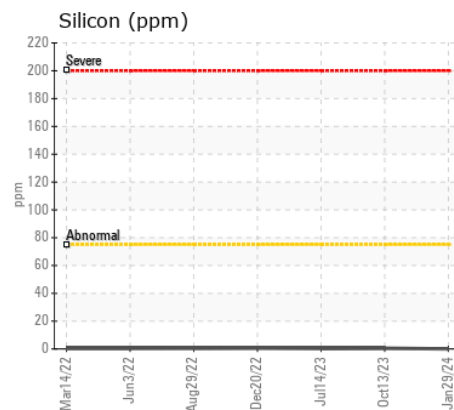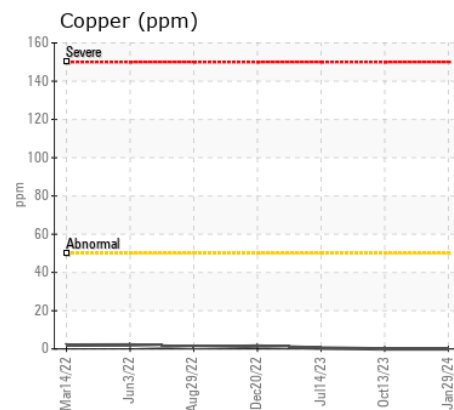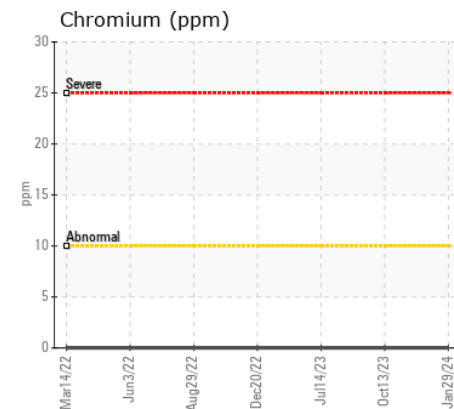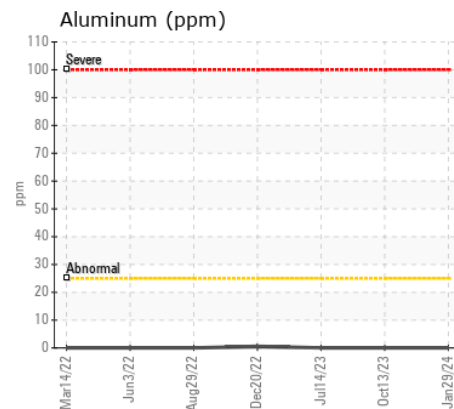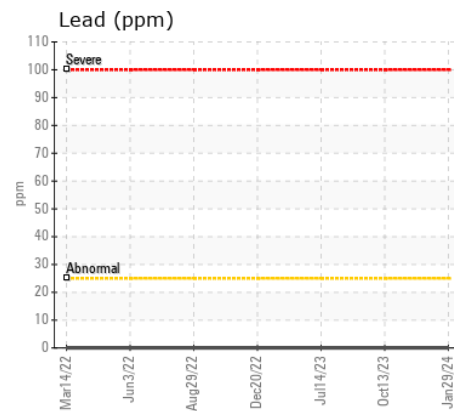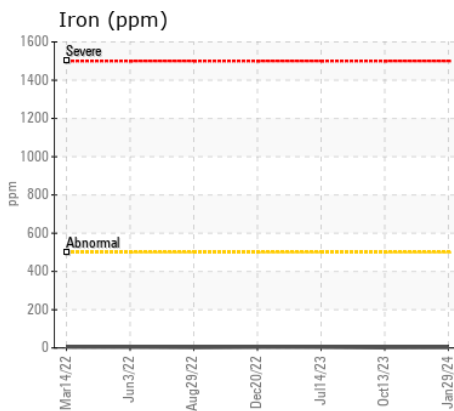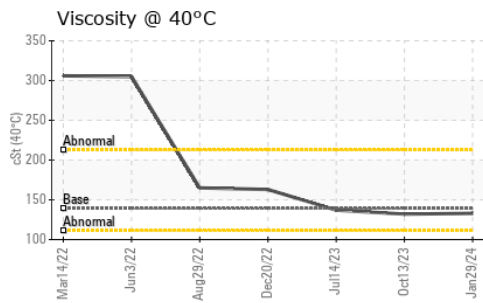

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : DJJ0020854 **Received** : 29 Feb 2024  
**Lab Number** : 06105565 **Tested** : 02 Mar 2024  
**Unique Number** : 10903795 **Diagnosed** : 02 Mar 2024 - Wes Davis  
**Test Package** : MOBCE

**ADVANTAGE METALS RECYCLING - ST LOUIS**  
 5 N MARKET  
 ST LOUIS, MO  
 US 63102  
 Contact: JEANETTE VAGO  
 jeanette.vago@advantagerecycling.com  
 T:  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)