


WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**

SKYJACK 9250 PL2043

Component Diesel Engine

ECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History
Resample at the next service interval to monitor.	Sample Number		Client Info		HPL0004501		
	Sample Date		Client Info		05 Mar 2024		
	Machine Age	hrs	Client Info		1400		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
EAR	Iron	ppm	ASTM D5185m	>100	5		
	Chromium	ppm	ASTM D5185m	>20	0		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m		0		
	Silver	ppm	ASTM D5185m	>3	0		
	Aluminum	ppm	ASTM D5185m		<1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m	>330	0		
	Tin	ppm	ASTM D5185m		0		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
ONTAMINATION	Silicon	ppm	ASTM D5185m	>25	5		
SITAMINATION	Potassium	ppm	ASTM D5185m		0		
There is no indication of any contamination in the oil.	Fuel	ppiii	WC Method		<1.0		
	Water		WC Method		NEG		
	Glycol		WC Method	7 O.L	NEG		
	Soot %	%	*ASTM D7844	>3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	5.3		
	Sulfation	Abs/.1mm	*ASTM D7415		19.8		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.2	NEG		
LUD CONDITION	Sodium	nnm	ASTM D5185m		0		
FLUID CONDITION	Boron	ppm	ASTM D5185m	250	370		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		70		
	Manganese	ppm	ASTM D5185m	100	0		
	Magnesium	ppm	ASTM D5185m	450	367		
	Calcium	ppm	ASTM D5185m		1535		
	Phosphorus	ppm ppm	ASTM D5185m		958		
	Zinc		ASTM D5185m		1255		
	Sulfur	ppm	ASTM D5185m		3778		
	Oxidation	ppm Abs/.1mm	*ASTM D7414		14.8		
					8.82		
	Base Number (BN)	cSt	ASTM D2896 ASTM D445		13.0		

Contact/Location: DAVE KOEHNE - STEBOL

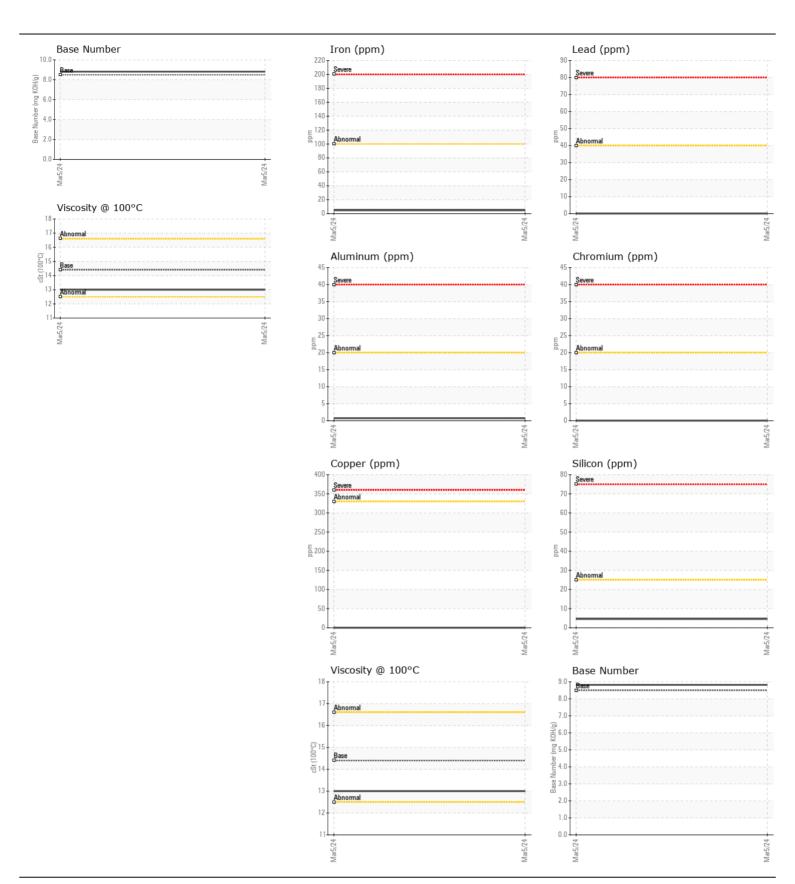



Certificate L2367

Laboratory

Sample No. Lab Number : 06122610 Unique Number : 10936761

Test Package : MOB 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : HPL0004501 Received : 19 Mar 2024 : 20 Mar 2024 **Tested**

: 20 Mar 2024 - Wes Davis Diagnosed

BOLINGBROOK, IL US 60440 Contact: DAVE KOEHNE davidk@stevensoncrane.com T: (630)972-9199

STEVENSON CRANE

410 STEVENSON DR

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)