


**WEAR** CONTAMINATION **FLUID CONDITION**  **NORMAL NORMAL NORMAL** 

Machine Id 146-1370

Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		RPL0011119		
	Sample Date		Client Info		08 Mar 2024		
	Machine Age	mls	Client Info		41180		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
VEAR	Iron	ppm	ASTM D5185m	>100	52		
VEAIL	Chromium	ppm	ASTM D5185m		1		
All component wear rates are normal.	Nickel	ppm	ASTM D5185m		0		
	Titanium	ppm	ASTM D5185m	77	0		
	Silver	ppm	ASTM D5185m	~3	0		
	Aluminum	ppm	ASTM D5185m		6		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		4		
	Tin	ppm	ASTM D5185m		1		
	Vanadium	ppm	ASTM D5185m	710	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m		11		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m		2		
	Fuel		WC Method		<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844		1		
	Nitration	Abs/cm	*ASTM D7624	>20	12.5		
	Sulfation	Abs/.1mm	*ASTM D7415		25.7		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m	>158	3		
	Boron	ppm	ASTM D5185m		47		
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.	Barium	ppm	ASTM D5185m		<1		
	Molybdenum	ppm	ASTM D5185m		83		
	Manganese	ppm	ASTM D5185m		2		
	Magnesium	ppm	ASTM D5185m	450	613		
	Calcium	ppm	ASTM D5185m		1554		
	Phosphorus	ppm	ASTM D5185m		756		
	Zinc	ppm	ASTM D5185m		922		
	Sulfur	ppm	ASTM D5185m		2864		
	Oxidation	Abs/.1mm	*ASTM D7414		27.4		
	Base Number (BN)				5.5		
		99					

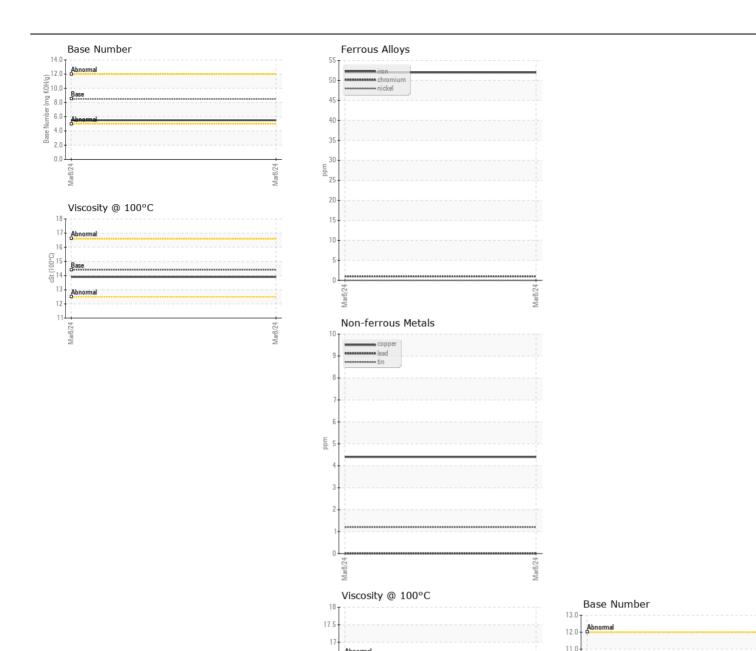





Certificate L2367

Laboratory Sample No.

: RPL0011119 Lab Number : 06124168 Unique Number: 10938319 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 20 Mar 2024 : 21 Mar 2024 **Tested** 

: 23 Mar 2024 - Don Baldridge Diagnosed

10.0

6.0 5.0

KOH/g) (mg

RTL PACLEASE - 7008 - Phoenix

625 South 27th Ave Phoenix, AZ US 85009

Contact: Maurice Pilotte

PilotteM@rushenterprises.com T: (602)566-5712

To discuss this sample report, contact Customer Service at 1-800-237-1369.

16.

15.5

ਲੂੱ 14.5

13.

12.

11.5

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)