

Machine Id  
**M6 (S/N 1457485)**  
Component  
**Biogas Engine**  
Fluid  
**PETRO CANADA SENTRON LD 8000 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PCA0120734</b>	PCA0106208	PCA0106204
Sample Date		Client Info		<b>11 Mar 2024</b>	14 Feb 2024	23 Jan 2024
Machine Age	hrs	Client Info		<b>6292</b>	5764	5274
Oil Age	hrs	Client Info		<b>4390</b>	3890	3390
Filter Age	hrs	Client Info		<b>0</b>	3890	3390
Oil Changed		Client Info		<b>N/A</b>	N/A	Changed
Filter Changed		Client Info		<b>N/A</b>	N/A	Changed
Sample Status				<b>NORMAL</b>	ABNORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>45	<b>9</b>	11	6
Chromium	ppm	ASTM D5185m	>2	<b>0</b>	<1	<1
Nickel	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	<1
Silver	ppm	ASTM D5185m	>5	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>10	<b>2</b>	3	2
Lead	ppm	ASTM D5185m	>5	<b>4</b>	▲ 7	4
Copper	ppm	ASTM D5185m	>14	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185m	>13	<b>0</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION













Fuel content negligible. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>200	<b>1</b>	2	2
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	4	3
Fuel	%	ASTM D3524	>4.0	<b>0.2</b>	0.3	0.3
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844		<b>0.1</b>	0.1	0.1
Nitration	Abs/cm	*ASTM D7624	>20	<b>7.0</b>	7.1	6.9
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>21.4</b>	21.2	20.9
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>4</b>	5	2
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Manganese	ppm	ASTM D5185m		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m		<b>14</b>	12	8
Calcium	ppm	ASTM D5185m	1351	<b>1788</b>	2562	1681
Phosphorus	ppm	ASTM D5185m	302	<b>316</b>	441	281
Zinc	ppm	ASTM D5185m	358	<b>406</b>	638	407
Sulfur	ppm	ASTM D5185m	2758	<b>3432</b>	4949	3067
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>16.9</b>	17.1	16.5
Acid Number (AN)	mg KOH/g	ASTM D8045	0.86	<b>1.87</b>	1.92	1.79
Base Number (BN)	mg KOH/g	ASTM D2896	4.64	<b>3.10</b>	3.30	3.44
Visc @ 100°C	cSt	ASTM D445	13.3	<b>14.2</b>	14.1	13.8

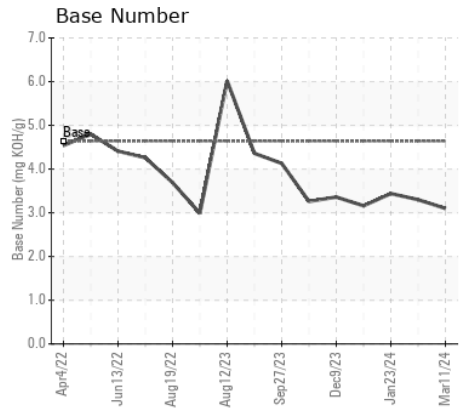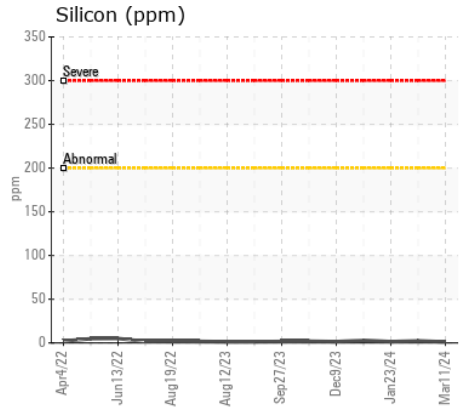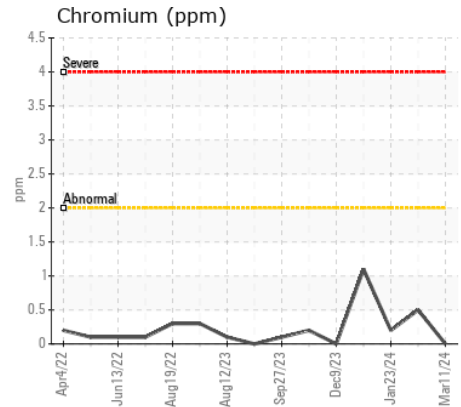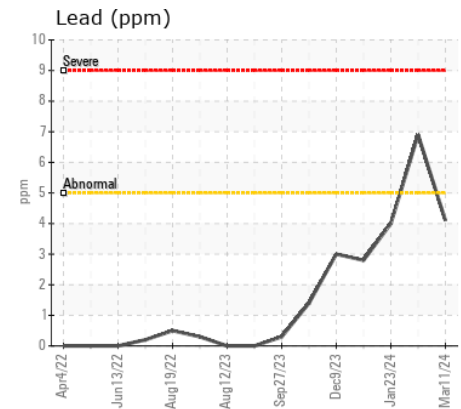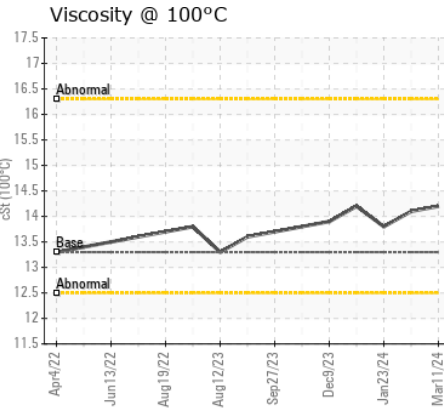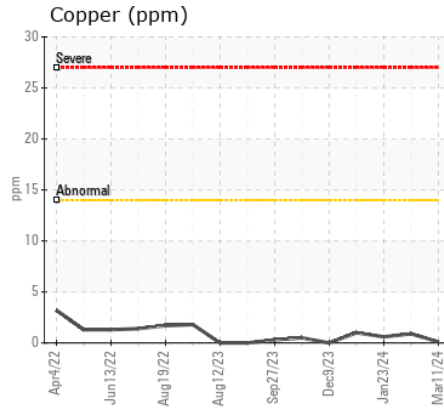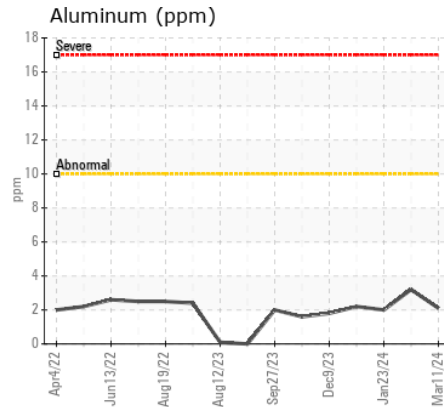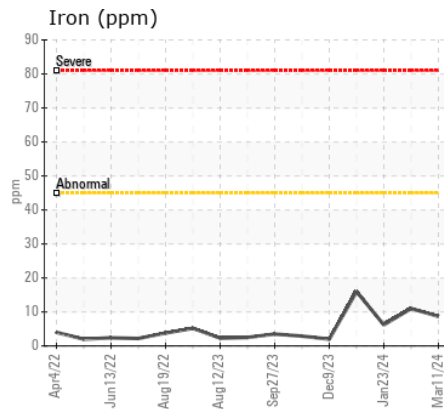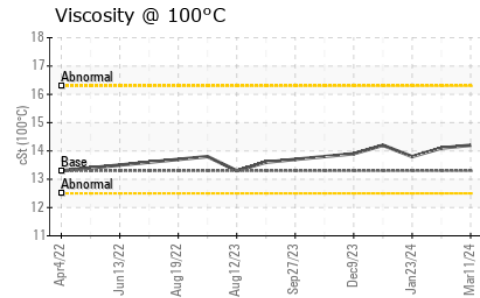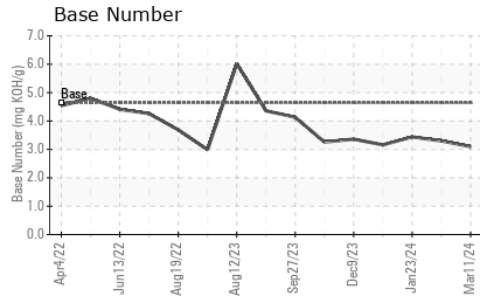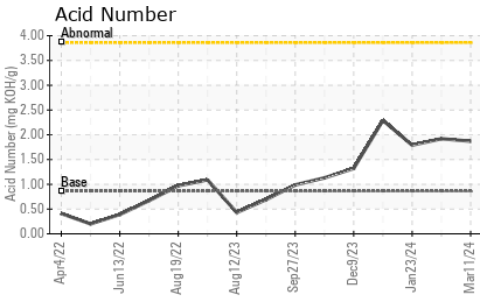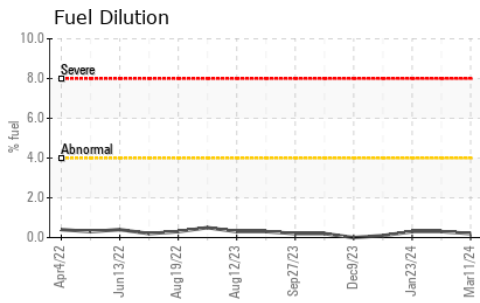

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : PCA0120734 **Received** : 20 Mar 2024  
**Lab Number** : 06124364 **Tested** : 23 Mar 2024  
**Unique Number** : 10938515 **Diagnosed** : 23 Mar 2024 - Don Baldrige  
**Test Package** : MOB 2 ( Additional Tests: FuelDilution, PercentFuel )

**AMERICAN PETROLEUM**  
 CARR 865 KM 0.2 CAMPANILA  
 TOA BAJA, PR  
 US 00949  
 Contact: NEFTALI ORTIZ  
 nortiz@americanpetroleumpr.com  
 T: (787)794-1985  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)