



| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |



Area
(99293V)
Machine Id
428040-402374
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (10 GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | GFL0101843 | GFL0101983 | GFL0101980 |
| Sample Date | | Client Info | | 20 Mar 2024 | 21 Feb 2024 | 26 Jan 2024 |
| Machine Age | hrs | Client Info | | 15736 | 15558 | 15378 |
| Oil Age | hrs | Client Info | | 577 | 399 | 219 |
| Filter Age | hrs | Client Info | | 0 | 0 | 0 |
| Oil Changed | | Client Info | | Changed | Not Changd | Not Changd |
| Filter Changed | | Client Info | | Changed | Not Changd | Not Changd |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|--------------|--------|-------------|------|--------------|------|------|
| Iron | ppm | ASTM D5185m | >120 | 8 | 5 | 4 |
| Chromium | ppm | ASTM D5185m | >20 | <1 | <1 | <1 |
| Nickel | ppm | ASTM D5185m | >5 | <1 | 0 | 0 |
| Titanium | ppm | ASTM D5185m | >2 | <1 | <1 | <1 |
| Silver | ppm | ASTM D5185m | >2 | 0 | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | 4 | 2 | 3 |
| Lead | ppm | ASTM D5185m | >40 | <1 | <1 | <1 |
| Copper | ppm | ASTM D5185m | >330 | <1 | <1 | <1 |
| Tin | ppm | ASTM D5185m | >15 | <1 | <1 | 0 |
| Vanadium | ppm | ASTM D5185m | | 0 | <1 | 0 |
| White Metal | scalar | *Visual | NONE | NONE | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | NONE | NONE | NONE |

CONTAMINATION







There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|----------|-------------|-------|----------------|-------|-------|
| Silicon | ppm | ASTM D5185m | >25 | 6 | 4 | 3 |
| Potassium | ppm | ASTM D5185m | >20 | 2 | 0 | 0 |
| Fuel | | WC Method | >3.0 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.2 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | *ASTM D7844 | >4 | 0.3 | 0.3 | 0.2 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 9.3 | 7.2 | 6.9 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 19.6 | 16.0 | 18.2 |
| Silt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Debris | scalar | *Visual | NONE | NONE | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | NONE | NONE | NONE |
| Appearance | scalar | *Visual | NORML | NORML | NORML | NORML |
| Odor | scalar | *Visual | NORML | NORML | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | NEG | NEG | NEG |

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|-------------|------|--------------|------|------|
| Sodium | ppm | ASTM D5185m | | 2 | 2 | <1 |
| Boron | ppm | ASTM D5185m | 0 | <1 | 2 | 2 |
| Barium | ppm | ASTM D5185m | 0 | 0 | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | 60 | 61 | 55 | 60 |
| Manganese | ppm | ASTM D5185m | 0 | <1 | <1 | 0 |
| Magnesium | ppm | ASTM D5185m | 1010 | 949 | 836 | 1025 |
| Calcium | ppm | ASTM D5185m | 1070 | 1140 | 1024 | 1133 |
| Phosphorus | ppm | ASTM D5185m | 1150 | 1103 | 947 | 1092 |
| Zinc | ppm | ASTM D5185m | 1270 | 1275 | 1106 | 1329 |
| Sulfur | ppm | ASTM D5185m | 2060 | 3056 | 2726 | 3272 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 16.4 | 12.3 | 14.5 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | 6.4 | 4.4 | 7.9 |
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | 13.8 | 13.9 | 14.0 |

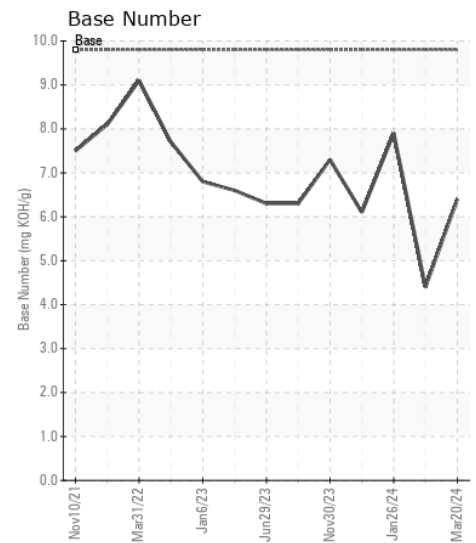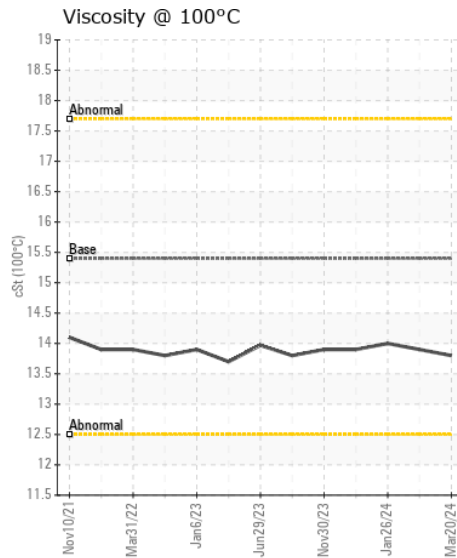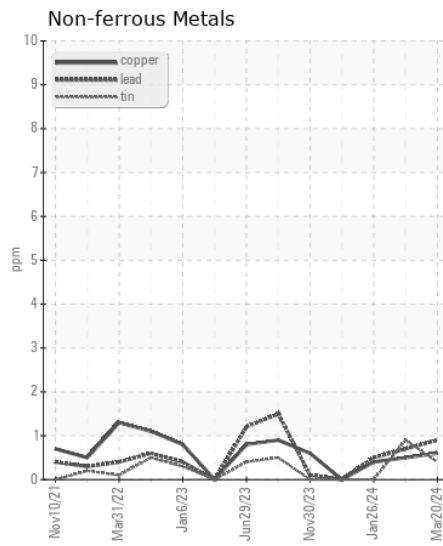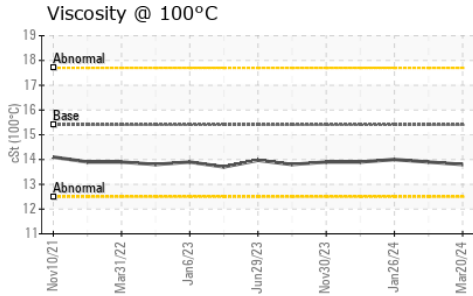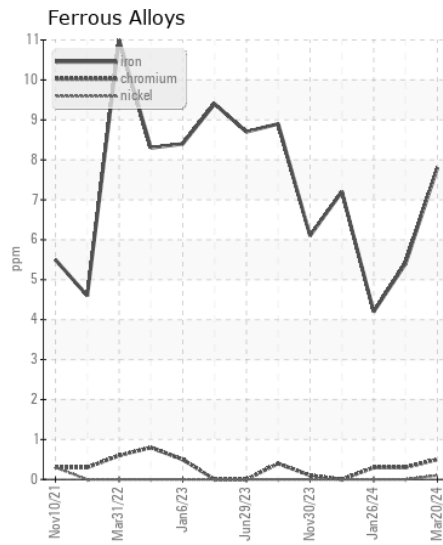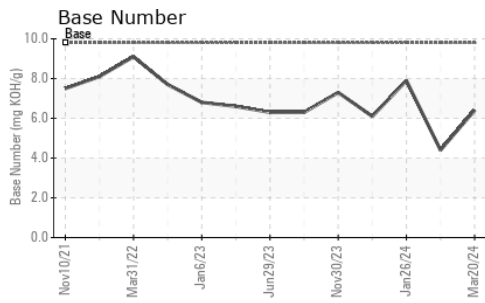

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0101843
Lab Number : 06125479
Unique Number : 10939630
Test Package : FLEET

Received : 21 Mar 2024
Tested : 22 Mar 2024
Diagnosed : 22 Mar 2024 - Wes Davis

GFL Environmental - 894 - Ada Hauling
 1904 North Broadway, Suite D
 Ada, OK
 US 74820

Contact: Johnny Spurlock
 jspurlock@gflenv.com

T: (405)664-4476

F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)