



WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id  
**CATERPILLAR D3K 7004**  
Component  
**Hydrostatic**  
Fluid  
**{not provided} (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>CL0005281</b>	---	---
Sample Date		Client Info		<b>02 Apr 2024</b>	---	---
Machine Age	hrs	Client Info		<b>515</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Chngd</b>	---	---
Filter Changed		Client Info		<b>Not Chngd</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>200	<b>15</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Nickel	ppm	ASTM D5185m		<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>50	<b>2</b>	---	---
Lead	ppm	ASTM D5185m	>50	<b>3</b>	---	---
Copper	ppm	ASTM D5185m	>200	<b>8</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

**CONTAMINATION**










The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>6</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>10000	<b>3718</b>	---	---
Particles >6µm		ASTM D7647	>2500	<b>90</b>	---	---
Particles >14µm		ASTM D7647	>320	<b>5</b>	---	---
Particles >21µm		ASTM D7647	>80	<b>2</b>	---	---
Particles >38µm		ASTM D7647	>20	<b>0</b>	---	---
Particles >71µm		ASTM D7647	>4	<b>0</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>20/18/15	<b>19/14/10</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---

**FLUID CONDITION**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Boron	ppm	ASTM D5185m		<b>0</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Manganese	ppm	ASTM D5185m		<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>8</b>	---	---
Calcium	ppm	ASTM D5185m		<b>262</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>594</b>	---	---
Zinc	ppm	ASTM D5185m		<b>698</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>1662</b>	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.93</b>	---	---
Visc @ 40°C	cSt	ASTM D445		<b>39.6</b>	---	---

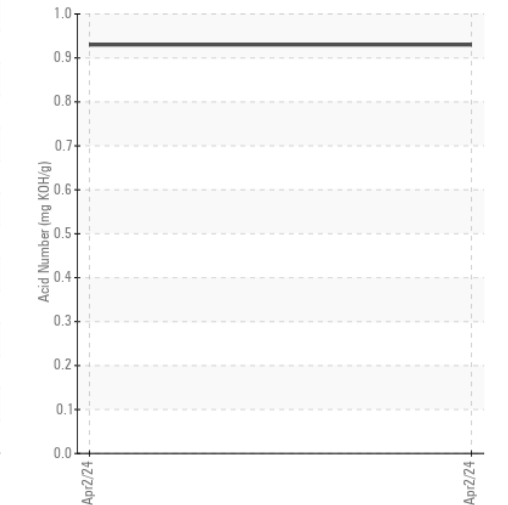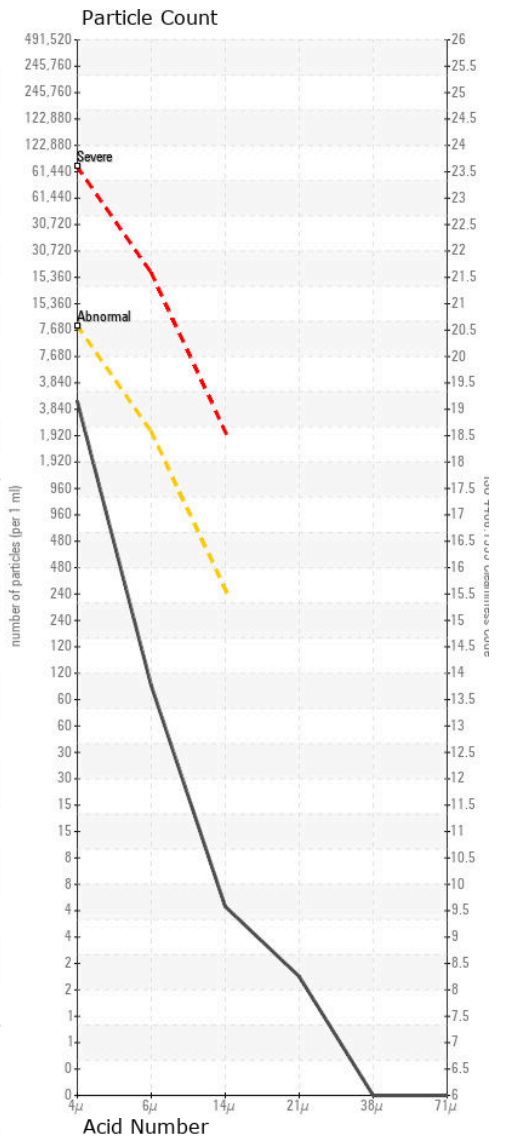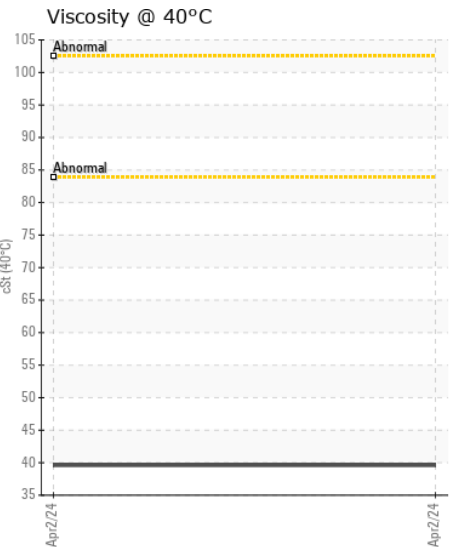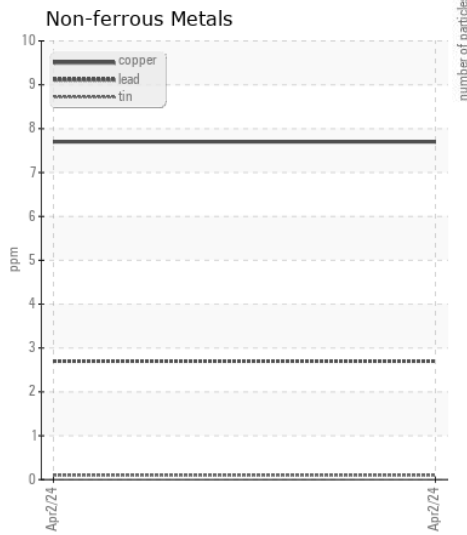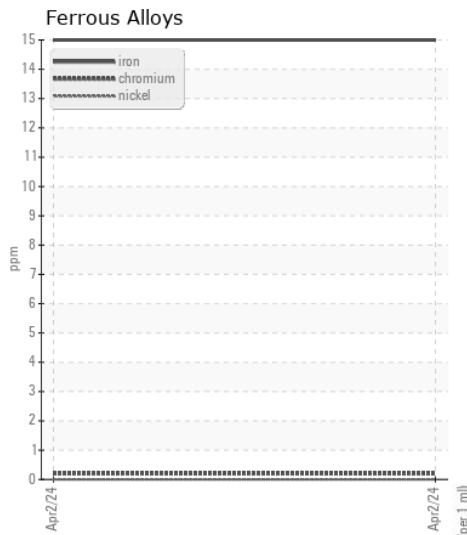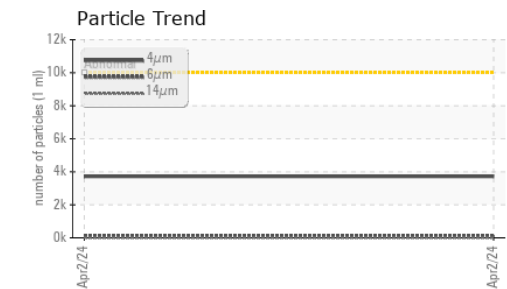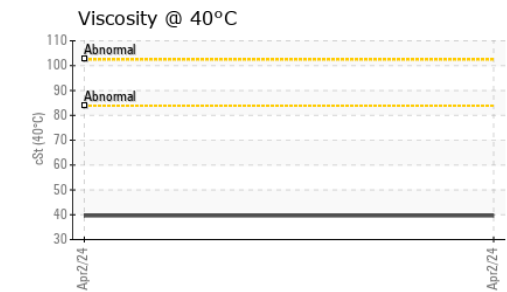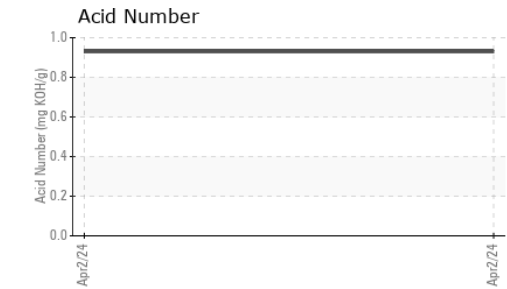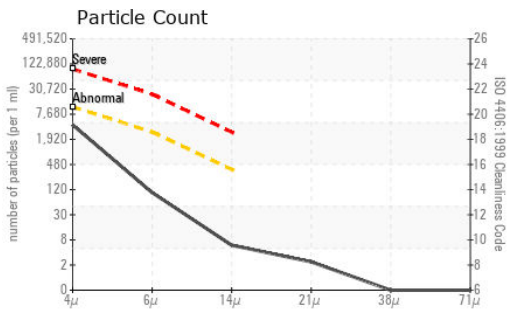

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : CL0005281 **Received** : 10 Apr 2024  
**Lab Number** : 06145263 **Tested** : 12 Apr 2024  
**Unique Number** : 10970071 **Diagnosed** : 13 Apr 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: PrtCount )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**PURCELL CONSTRUCTION**  
 3100 HIGH RIDGE RD  
 CHARLOTTE, NC  
 US 28270  
 Contact: BEN MILKE  
 ben@purcellconst.com

T:  
F: