



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**GENERAC SOUTH PARK DR(NSTATE)**  
 Component  
**Liquid Petroleum Gas**  
 Fluid  
**SHELL ROTELLA T 15W40 (4 QTS)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0848581</b>	WC0647407	WC0395619
Sample Date		Client Info		<b>29 Jan 2024</b>	17 Jan 2022	22 Nov 2019
Machine Age	hrs	Client Info		<b>386</b>	358	324
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>120	<b>0</b>	1	1
Chromium	ppm	ASTM D5185m	>10	<b>0</b>	<1	<1
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	0	<1
Silver	ppm	ASTM D5185m	>5	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>20	<b>&lt;1</b>	1	2
Lead	ppm	ASTM D5185m	>40	<b>&lt;1</b>	2	2
Copper	ppm	ASTM D5185m	>300	<b>0</b>	1	1
Tin	ppm	ASTM D5185m	>10	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>16</b>	13	17
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	<1	0
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844		<b>0</b>	0	0
Nitration	Abs/cm	*ASTM D7624	>20	<b>7.4</b>	11.3	5.2
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>18.4</b>	21.2	17.9
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>2</b>	2	2
Boron	ppm	ASTM D5185m	316	<b>93</b>	92	10
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	1.2	<b>75</b>	57	62
Manganese	ppm	ASTM D5185m		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185m	24	<b>225</b>	521	1027
Calcium	ppm	ASTM D5185m	2292	<b>2273</b>	1754	1193
Phosphorus	ppm	ASTM D5185m	1064	<b>1156</b>	1081	1088
Zinc	ppm	ASTM D5185m	1160	<b>1296</b>	1230	1242
Sulfur	ppm	ASTM D5185m	4996	<b>4474</b>	3149	2787
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>14.7</b>	18.7	13.8
Base Number (BN)	mg KOH/g	ASTM D2896	10.1	<b>7.4</b>	5.9	---
Visc @ 100°C	cSt	ASTM D445	15.7	<b>13.8</b>	14.1	14.1

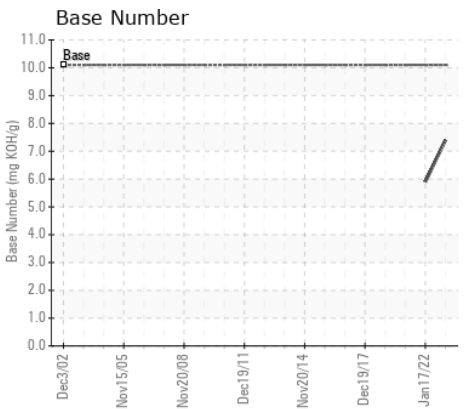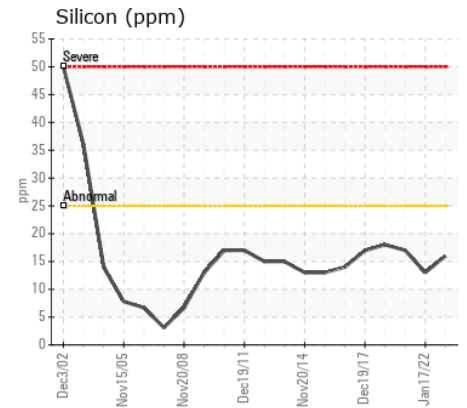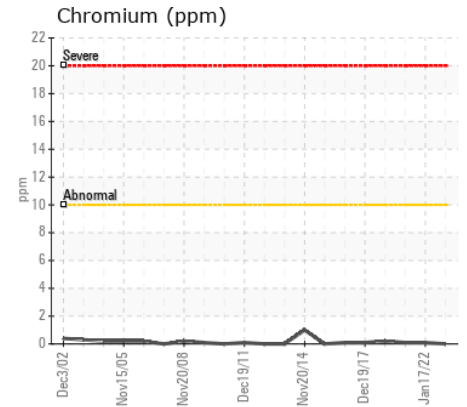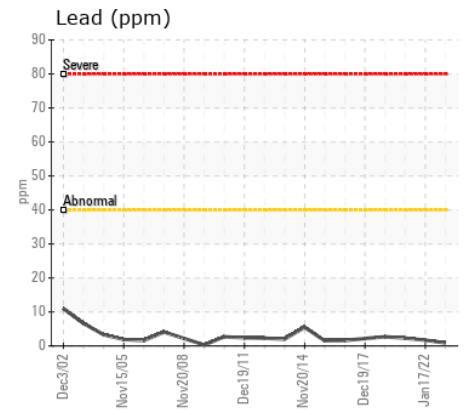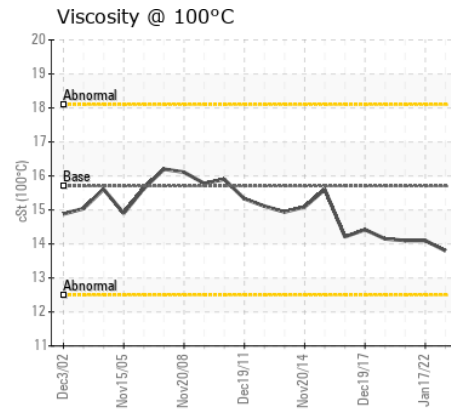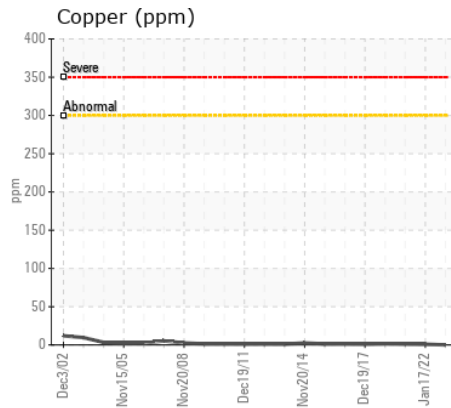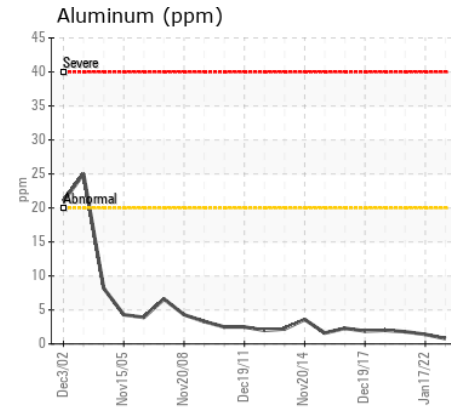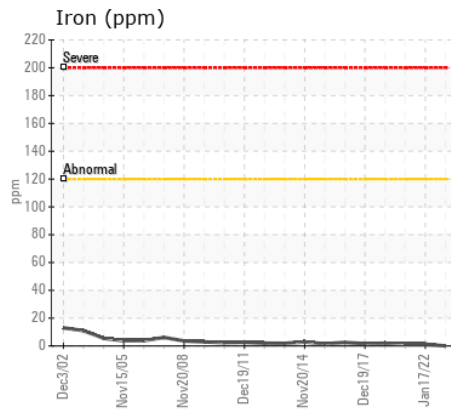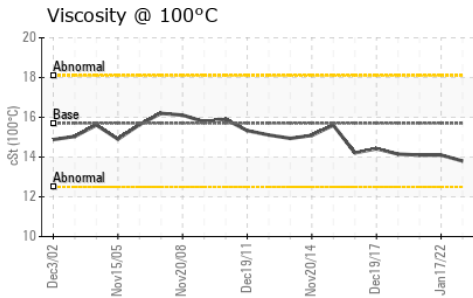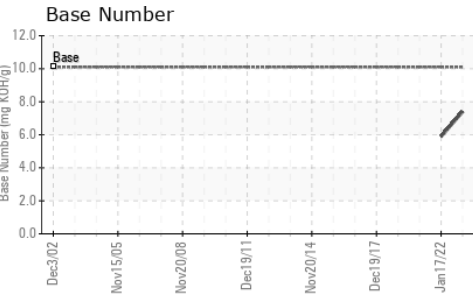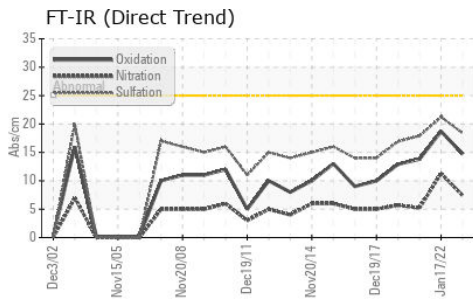

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0848581 **Received** : 12 Apr 2024  
**Lab Number** : 06146951 **Tested** : 15 Apr 2024  
**Unique Number** : 10977029 **Diagnosed** : 15 Apr 2024 - Sean Felton  
**Test Package** : MOB 1 ( Additional Tests: TBN )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**PIEDMONT GENERATOR**  
 7560 NC HWY 22 NORTH  
 CLIMAX, NC  
 US 27233

Contact: TERRY SHEPPARD  
 terry1pg@bellsouth.net; bill3pg@bellsouth.net

T: (336)685-4859  
 F: (336)685-5297