
WEAR CONTAMINATION **FLUID CONDITION** **NORMAL NORMAL NORMAL**

[25356]

VOLVO L350 5031



			VB102 (
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP455253		
	Sample Date		Client Info		05 Apr 2024		
	Machine Age	hrs	Client Info		938		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Changed		
	Filter Changed		Client Info		Changed		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m	>100	4		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m		<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	>30	2		
	Lead	ppm	ASTM D5185m	>50	<1		
	Copper	ppm	ASTM D5185m	>50	4		
	Tin	ppm	ASTM D5185m	>20	<1		
	Vanadium	ppm	ASTM D5185m		0		
	White Metal	scalar	*Visual	NONE	LIGHT		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Ciliana		ACTM DE105		40		
There is no indication of any contamination in the fluid.	Silicon	ppm	ASTM D5185m ASTM D5185m	>50	13 3		
	Water	ppm	WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water		*Visual	>0.2	NEG		
FLUID CONDITION	Sodium	nnm	ASTM D5185m		0		
	Boron	ppm	ASTM D5185m		144		
The condition of the fluid is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		<1		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		12		
	Calcium	ppm	ASTM D5185m		4138		
		ppm	ASTM D5185m		1410		
	Phosphorus						
	Phosphorus Zinc						
	Zinc Sulfur	ppm	ASTM D5185m ASTM D5185m		1669 4345		

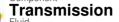



Laboratory Sample No.

Lab Number : 06147847 Unique Number : 10977925

: VCP455253

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 12 Apr 2024 : 16 Apr 2024 **Tested**

: 16 Apr 2024 - Don Baldridge Diagnosed

218 - ASCENDUM MACHINERY INC - N. CHARLESTON 7235 CROSS COUNTRY RD.

NORTH CHARLESTON, SC US 29418

Contact: MATT MITCHAM

Test Package : MOB 1 Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

matt.mitcham@ascendummachinery.com T:

Contact/Location: MATT MITCHAM - VOLVO3387

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (843)414-1129