



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ATTENTION
FLUID CONDITION	NORMAL

Area  
**BARRIER DEPARTMENT SAMPLES**

Machine Id  
**WEB 16 CC**

Component  
**Gearbox**

Fluid  
**TEXACO MEROPA 220 (--- GAL)**

**RECOMMENDATION**

We recommend you service the filters on this component. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0913508</b>	WC0757230	WC0692857
Sample Date		Client Info		<b>14 Apr 2024</b>	04 Apr 2023	08 May 2022
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>ATTENTION</b>	NORMAL	ABNORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>200	<b>63</b>	73	26
Chromium	ppm	ASTM D5185m	>15	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>15	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m		<b>0</b>	0	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>25	<b>0</b>	0	<1
Lead	ppm	ASTM D5185m	>100	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>200	<b>&lt;1</b>	<1	1
Tin	ppm	ASTM D5185m	>25	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**









There is a light amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>6</b>	8	4
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>20000	<b>20748</b>	16834	▲ 118280
Particles >6µm		ASTM D7647	>5000	<b>2579</b>	1988	▲ 12418
Particles >14µm		ASTM D7647	>640	<b>154</b>	83	160
Particles >21µm		ASTM D7647	>160	<b>24</b>	19	24
Particles >38µm		ASTM D7647	>40	<b>0</b>	0	0
Particles >71µm		ASTM D7647	>10	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<b>22/19/14</b>	21/18/14	▲ 24/21/14
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>1</b>	0	0
Boron	ppm	ASTM D5185m	3.2	<b>0</b>	0	5
Barium	ppm	ASTM D5185m	0.5	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	1.1	<b>0</b>	<1	<1
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m	0.1	<b>1</b>	0	3
Calcium	ppm	ASTM D5185m	1.6	<b>2</b>	0	17
Phosphorus	ppm	ASTM D5185m	159	<b>192</b>	240	224
Zinc	ppm	ASTM D5185m	0.5	<b>8</b>	12	11
Sulfur	ppm	ASTM D5185m	10342	<b>8638</b>	9852	5814
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.54</b>	0.52	0.42
Visc @ 40°C	cSt	ASTM D445	219	<b>213</b>	211	194

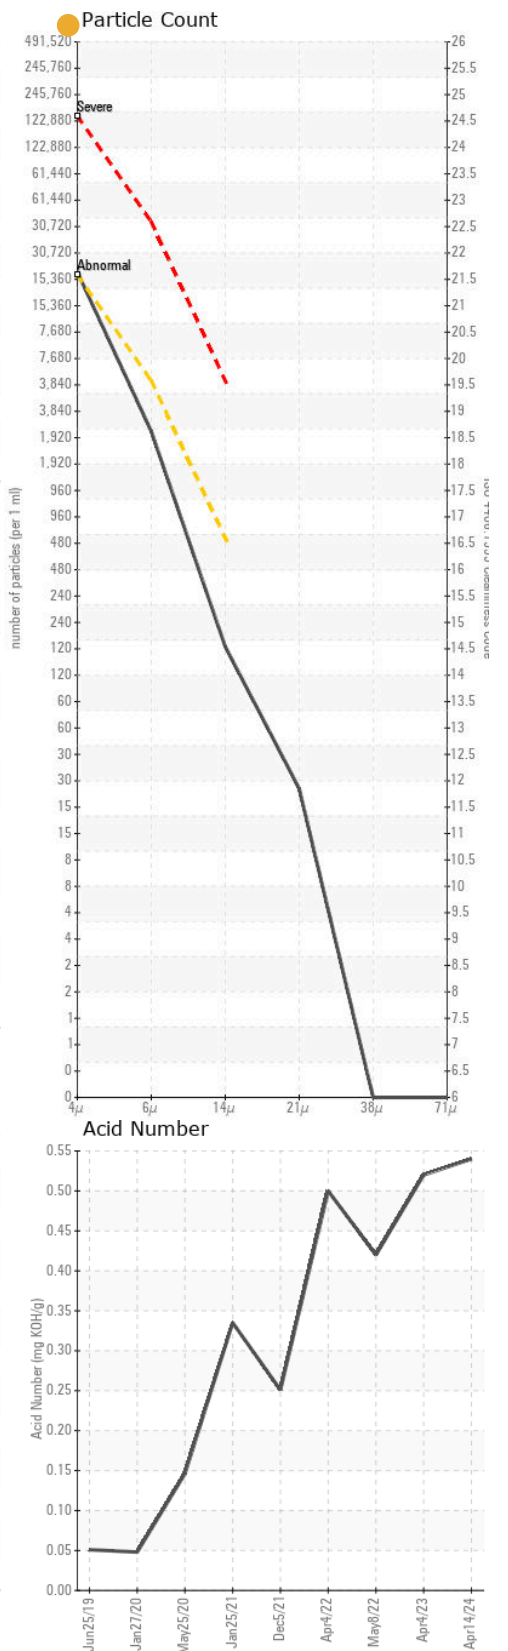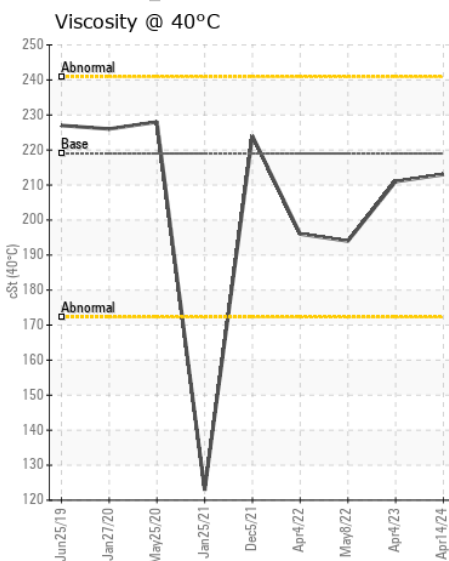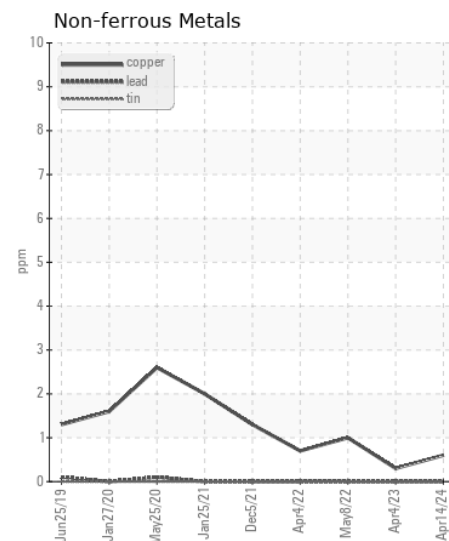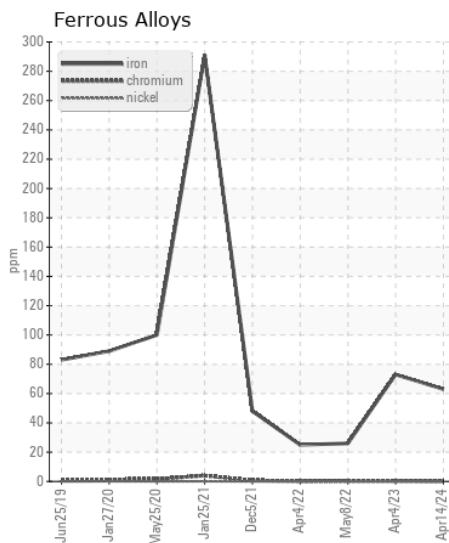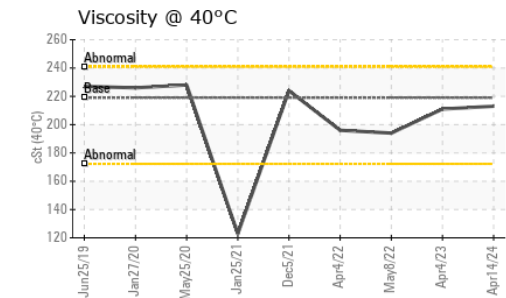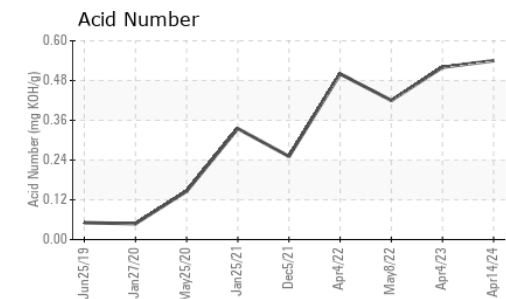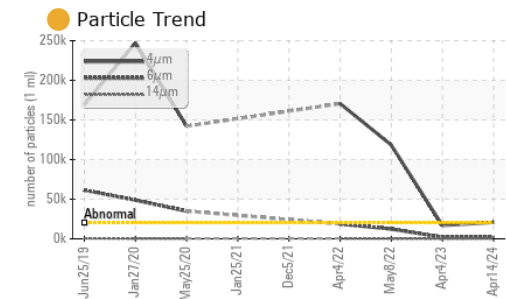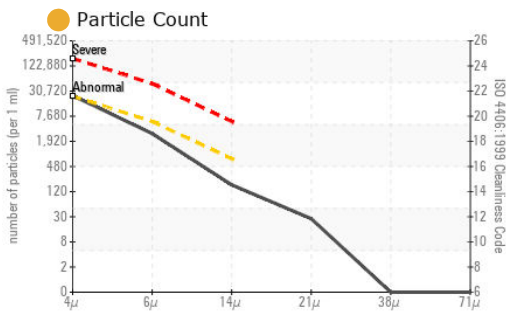

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0913508  
**Lab Number** : 06148699  
**Unique Number** : 10978777  
**Test Package** : IND 2 ( Additional Tests: PrtCount )  
**Received** : 15 Apr 2024  
**Tested** : 16 Apr 2024  
**Diagnosed** : 16 Apr 2024 - Wes Davis

**SEALED AIR CORP - CRYOVAC DIVISION**  
 1301 WEST MAGNOLIA AVE  
 IOWA PARK, TX  
 US 76367  
 Contact: KEVIN KETCHERSID  
 kevin.a.ketchersid@sealedair.com  
 T: (940)592-2111  
 F: (940)592-2513

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)