WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL NORMAL

Area


KEMP QUARRIES / PRYOR STONE [68156]

WL141

Front Front Left Final Drive

PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

DECOMMENDATION				
RECOMMENDATION Test UOM Met	thod Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor. (Customer Sample Sample Number Clie	ent Info	PCA0086638	PCA0084333	PCA0084547
·	ent Info	06 Apr 2024	17 Nov 2023	24 Jul 2023
filters changed.) Machine Age hrs Clie	ent Info	26330	25744	25250
Oil Age hrs Clie	ent Info	2223	1637	25250
Filter Age hrs Clie	ent Info	0	0	0
Oil Changed Clie	ent Info	Changed	Oil Added	Oil Added
Filter Changed Clie	ent Info	N/A	N/A	N/A
Sample Status		NORMAL	NORMAL	NORMAL
WEAR Iron ppm ASTM	M D5185m >800	46	19	19
Chromium pom ASTI	M D5185m >10	1	0	<1
All component wear rates are normal.	M D5185m >5	<1	0	0
	M D5185m >15	<1	0	<1
	M D5185m >2	0	0	0
	M D5185m >75	5	1	<1
	M D5185m >10	<1	<1	0
	M D5185m >75	7	4	3
	M D5185m >8	<1	<1	0
	M D5185m	<1	<1	<1
White Metal scalar *Vis	sual NONE	NONE	NONE	NONE
Yellow Metal scalar *Vis	sual NONE	NONE	NONE	NONE
CONTAMINATION				
	M D5185m >400	34	18	19
There is no indication of any contamination in the oil.	M D5185m >20	2	0	0
	Method >0.2	NEG	NEG	NEG
Silt scalar *Vis			NONE	NONE
Debris scalar *Vis			NONE	NONE
Sand/Dirt scalar *Vis			NONE	NONE
· ·	sual NORML	NORML	NORML	NORML
Odor scalar *Vis		NORML NEG	NORML	NORML
Emulsified Water scalar *Vis	sual >0.2	NEG	NEG	NEG
FLUID CONDITION Sodium ppm ASTM	M D5185m	3	2	1
The condition of the oil is acceptable for the time in service. Boron ppm ASTM	M D5185m 2	3	0	0
	M D5185m O	<1	0	0
Molybdenum ppm ASTM	M D5185m O	1	<1	<1
	M D5185m O	1	0	<1
Magnesium ppm ASTM	M D5185m 9	19	13	9
	M D5185m 3114	3538	3320	3465
Phosphorus ppm ASTM	M D5185m 1099	1072	1064	1052
Zinc ppm ASTN	M D5185m 1245	1346	1222	1289
			4 4 4 7	1000
	M D5185m 7086 TM D445 213.9	5445 189	4147 183	4863 189

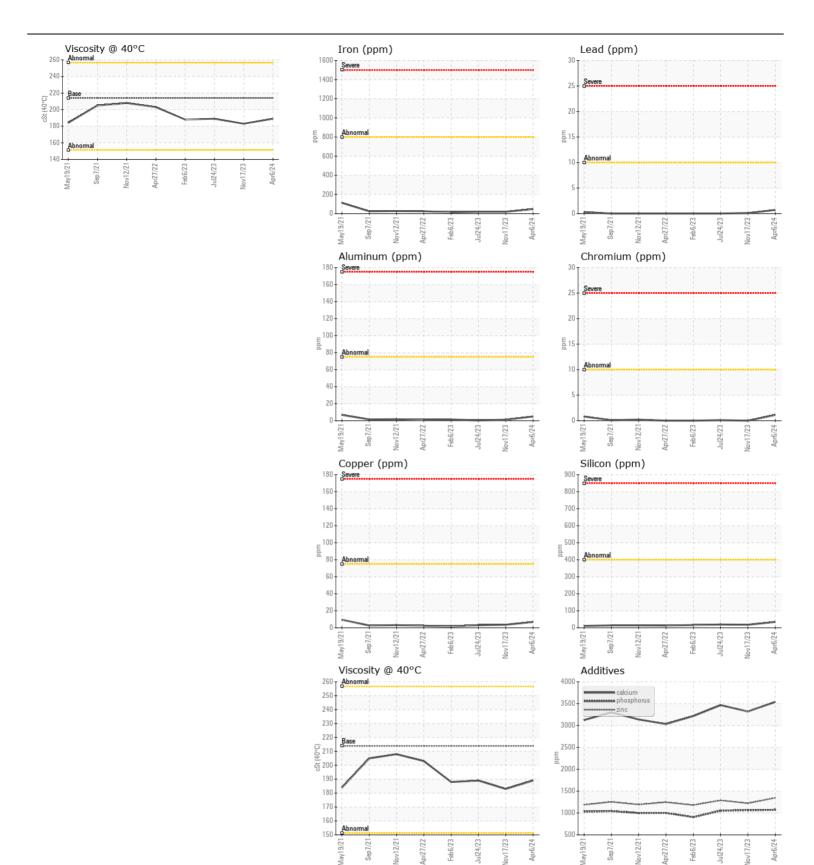



Certificate L2367

Laboratory Sample No.

Lab Number : 06149703 Unique Number : 10979781 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0086638

Received **Tested** Diagnosed

: 15 Apr 2024 : 16 Apr 2024 : 18 Apr 2024 - Don Baldridge

Kemp Quarries - Pryor Stone - Pryor 1050 E 520 Rd

Pryor, OK US 74361 Contact: pryor@pryorstone.com

> T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)