



PacLease

# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**857-3979**  
 Component  
**Diesel Engine**  
 Fluid  
**CHEVRON DELO 400 SAE 10W30 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>RPL0014224</b>	RPL0014200	RPL0010884
Sample Date		Client Info		<b>22 Mar 2024</b>	01 Feb 2024	16 Oct 2023
Machine Age	hrs	Client Info		<b>8544</b>	8475	245952
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Filter Changed		Client Info		<b>Changed</b>	Not Changd	Not Changd
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>24</b>	24	18
Chromium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185m	>4	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	<1
Silver	ppm	ASTM D5185m	>3	<b>0</b>	<1	<1
Aluminum	ppm	ASTM D5185m	>20	<b>4</b>	4	4
Lead	ppm	ASTM D5185m	>40	<b>0</b>	0	0
Copper	ppm	ASTM D5185m	>330	<b>&lt;1</b>	2	<1
Tin	ppm	ASTM D5185m	>15	<b>&lt;1</b>	<1	<1
Vanadium	ppm	ASTM D5185m		<b>0</b>	<1	<1
White Metal	scalar	*Visual	NONE	<b>LIGHT</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION








There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>10</b>	10	8
Potassium	ppm	ASTM D5185m	>20	<b>16</b>	19	16
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	<1.0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol		WC Method		<b>NEG</b>	NEG	NEG
Soot %	%	*ASTM D7844	>3	<b>0.6</b>	0.5	0.5
Nitration	Abs/cm	*ASTM D7624	>20	<b>10.4</b>	10.2	10.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>23.2</b>	22.4	22.7
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>5</b>	4	4
Boron	ppm	ASTM D5185m		<b>23</b>	23	23
Barium	ppm	ASTM D5185m		<b>0</b>	<1	0
Molybdenum	ppm	ASTM D5185m		<b>19</b>	21	18
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m		<b>819</b>	714	760
Calcium	ppm	ASTM D5185m		<b>1402</b>	1378	1330
Phosphorus	ppm	ASTM D5185m	1260	<b>832</b>	762	787
Zinc	ppm	ASTM D5185m	1400	<b>930</b>	875	893
Sulfur	ppm	ASTM D5185m		<b>3585</b>	2931	2989
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>17.4</b>	16.6	16.6
Base Number (BN)	mg KOH/g	ASTM D2896	10.1	<b>5.8</b>	6.2	6.2
Visc @ 100°C	cSt	ASTM D445	11.1	<b>12.1</b>	12.1	11.9

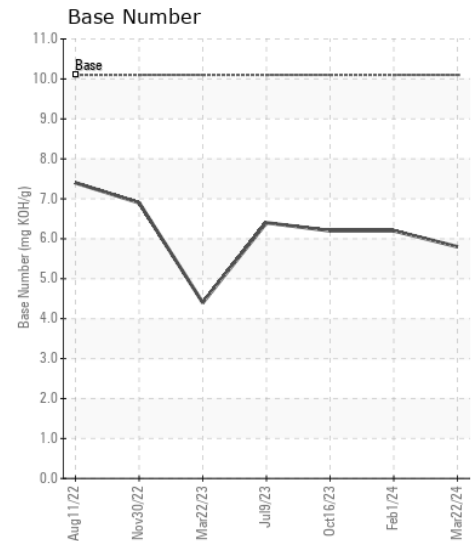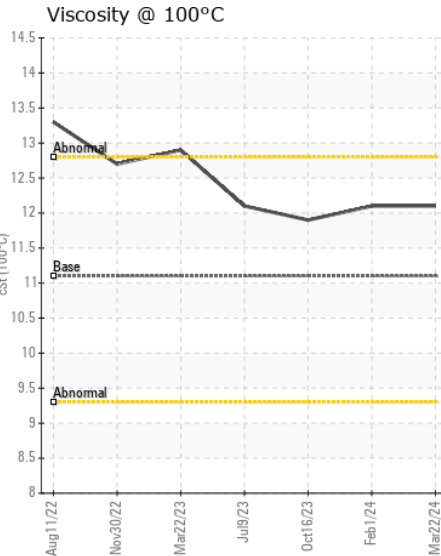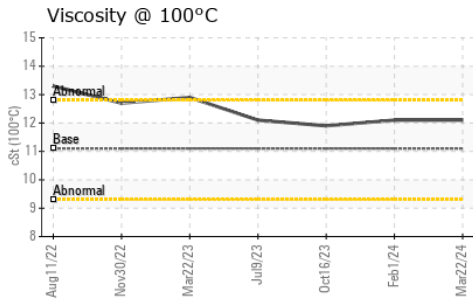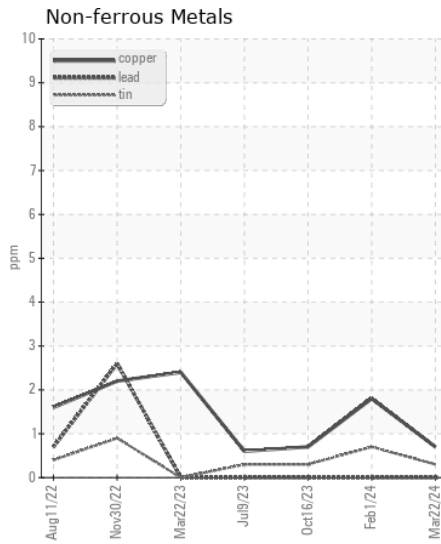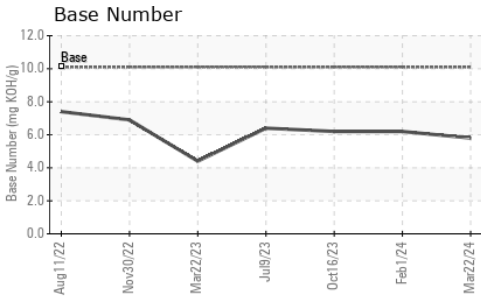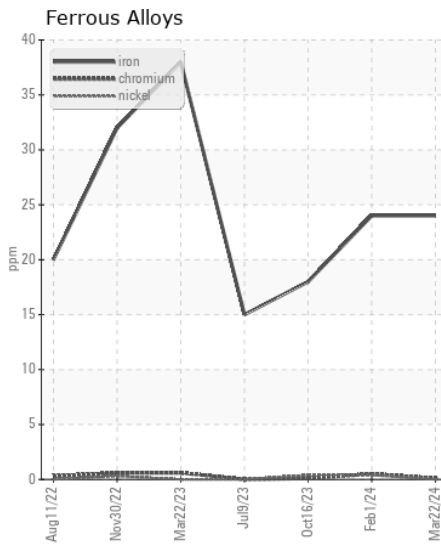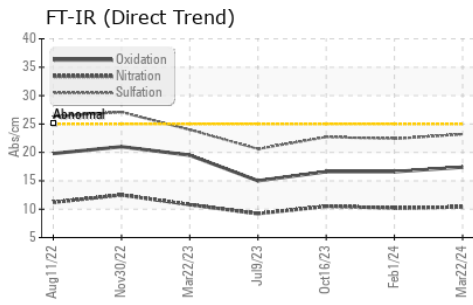

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : RPL0014224  
**Lab Number** : 06149980  
**Unique Number** : 10980058  
**Test Package** : FLEET

**RTL PACLEASE - 7001 - Houston**  
 6300 N. Loop East  
 Houston, TX  
 US 77026  
 Contact: RODNEY BRIGGS  
 briggs@rushenterprises.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: