



# OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id  
**OSHKOSH MIXER 4413**  
Component  
**Diesel Engine**  
Fluid  
**MOBIL 15W40 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>WC0917314</b>	WC0878797	---
Sample Date		Client Info		<b>26 Mar 2024</b>	02 Jan 2024	---
Machine Age	mls	Client Info		<b>29343</b>	3259	---
Oil Age	mls	Client Info		<b>0</b>	0	---
Filter Age	mls	Client Info		<b>0</b>	0	---
Oil Changed		Client Info		<b>Changed</b>	Changed	---
Filter Changed		Client Info		<b>Changed</b>	Changed	---
Sample Status				<b>NORMAL</b>	NORMAL	---

## WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185m	>100	<b>5</b>	3	---
Chromium	ppm	ASTM D5185m	>20	<b>1</b>	<1	---
Nickel	ppm	ASTM D5185m	>4	<b>1</b>	0	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	---
Silver	ppm	ASTM D5185m	>3	<b>&lt;1</b>	0	---
Aluminum	ppm	ASTM D5185m	>20	<b>1</b>	<1	---
Lead	ppm	ASTM D5185m	>40	<b>1</b>	<1	---
Copper	ppm	ASTM D5185m	>330	<b>&lt;1</b>	<1	---
Tin	ppm	ASTM D5185m	>15	<b>1</b>	<1	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	<1	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---

## CONTAMINATION












There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>4</b>	3	---
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	<1	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	<1.0	---
Water		WC Method	>0.2	<b>NEG</b>	NEG	---
Glycol		WC Method		<b>NEG</b>	NEG	---
Soot %	%	*ASTM D7844	>3	<b>0.2</b>	0.2	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>6.0</b>	6.0	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>17.8</b>	18.0	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	---

## FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>118	<b>1</b>	2	---
Boron	ppm	ASTM D5185m		<b>3</b>	7	---
Barium	ppm	ASTM D5185m		<b>0</b>	0	---
Molybdenum	ppm	ASTM D5185m		<b>55</b>	52	---
Manganese	ppm	ASTM D5185m		<b>1</b>	<1	---
Magnesium	ppm	ASTM D5185m		<b>881</b>	930	---
Calcium	ppm	ASTM D5185m		<b>1042</b>	1060	---
Phosphorus	ppm	ASTM D5185m		<b>986</b>	1005	---
Zinc	ppm	ASTM D5185m		<b>1161</b>	1171	---
Sulfur	ppm	ASTM D5185m		<b>3345</b>	3026	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>13.8</b>	13.6	---
Base Number (BN)	mg KOH/g	ASTM D2896		<b>8.6</b>	8.8	---
Visc @ 100°C	cSt	ASTM D445		<b>13.8</b>	13.8	---

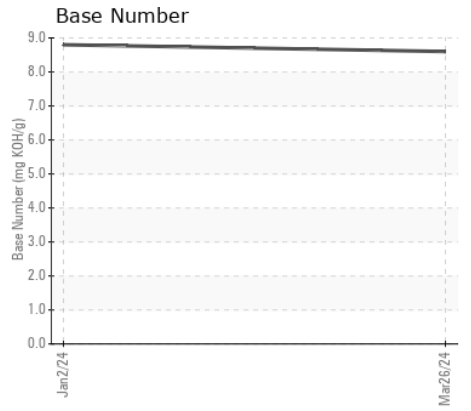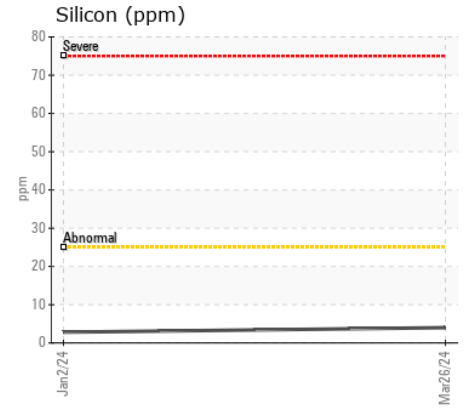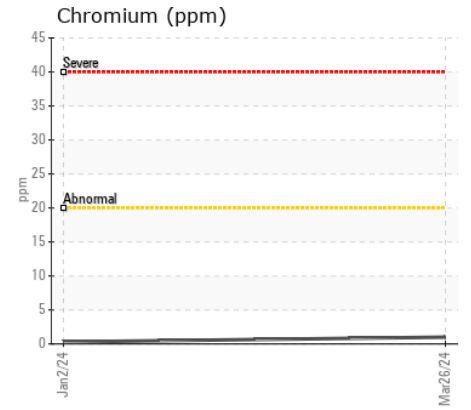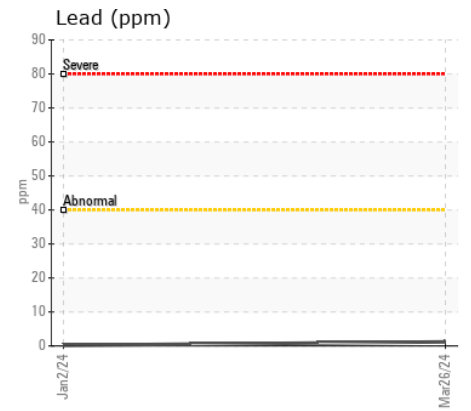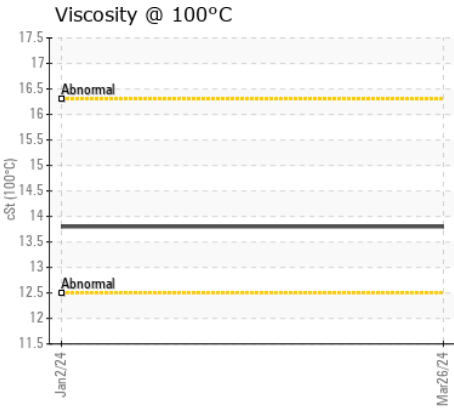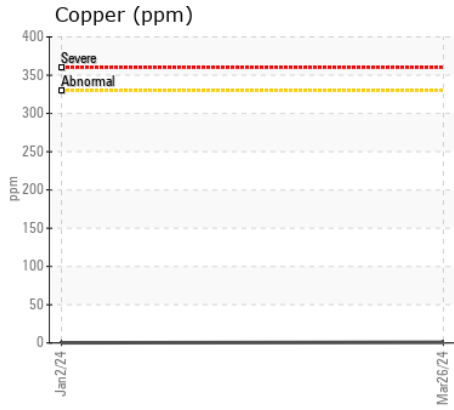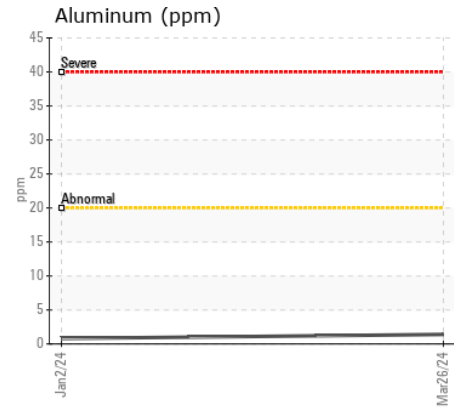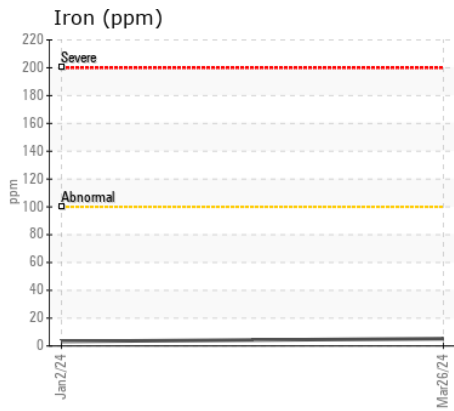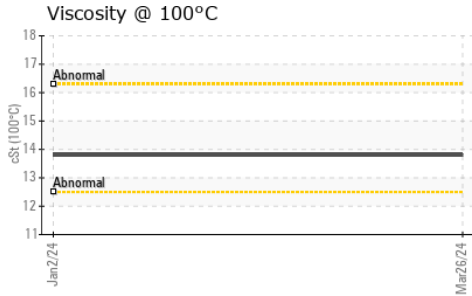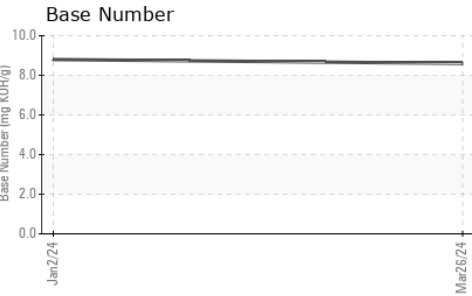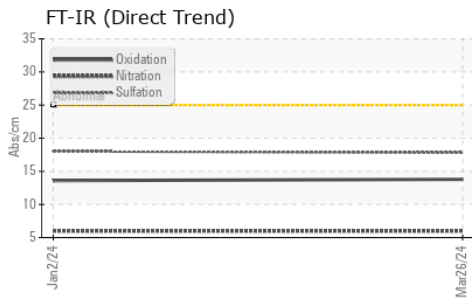

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0917314 **Received** : 18 Apr 2024  
**Lab Number** : 06152792 **Tested** : 18 Apr 2024  
**Unique Number** : 10982870 **Diagnosed** : 18 Apr 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: TBN )

**CONCRETE SERVICE CO - FAY BLOCK**  
 161 BUILDERS BLVD  
 FAYETTEVILLE, NC  
 US 28301  
 Contact: BRYAN VANNIMAN  
 bryanvanniman@fayblock.com  
 T: (800)326-9198  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)