



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**JOHN DEERE 35G 1FF035GXHPK302853**

Component  
**Hydraulic System**

Fluid  
**{not provided} (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0212406</b>	---	---
Sample Date		Client Info		<b>19 Apr 2024</b>	---	---
Machine Age	hrs	Client Info		<b>598</b>	---	---
Oil Age	hrs	Client Info		<b>598</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Not Changd</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

PQ		ASTM D8184	>50	<b>12</b>	---	---
Iron	ppm	ASTM D5185m	>32	<b>0</b>	---	---
Chromium	ppm	ASTM D5185m	>9	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>9	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	>28	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>50	<b>0</b>	---	---
Tin	ppm	ASTM D5185m	>5	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION










The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>11	<b>&lt;1</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Water		WC Method	>0.075	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>80000	<b>2283</b>	---	---
Particles >6µm		ASTM D7647	>20000	<b>367</b>	---	---
Particles >14µm		ASTM D7647	>640	<b>17</b>	---	---
Particles >21µm		ASTM D7647	>160	<b>8</b>	---	---
Particles >38µm		ASTM D7647	>40	<b>1</b>	---	---
Particles >71µm		ASTM D7647	>10	<b>1</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>23/21/16	<b>18/16/11</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.075	<b>NEG</b>	---	---

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>21	<b>0</b>	---	---
Boron	ppm	ASTM D5185m		<b>0</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>0</b>	---	---
Manganese	ppm	ASTM D5185m		<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>7</b>	---	---
Calcium	ppm	ASTM D5185m		<b>13</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>515</b>	---	---
Zinc	ppm	ASTM D5185m		<b>41</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>162</b>	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.046</b>	---	---
Visc @ 40°C	cSt	ASTM D445		<b>48.5</b>	---	---

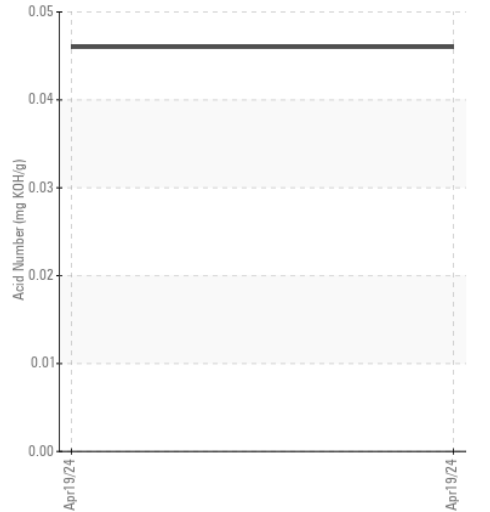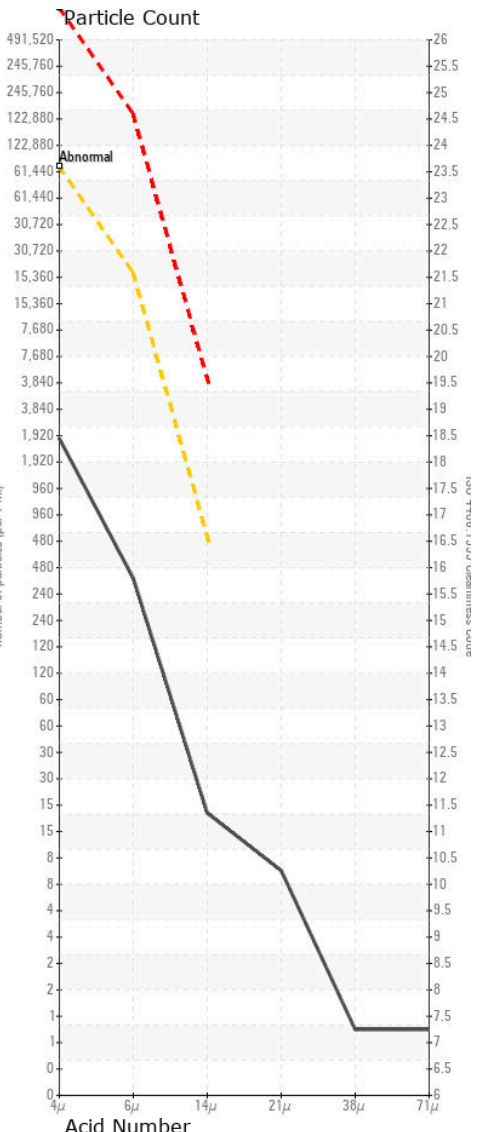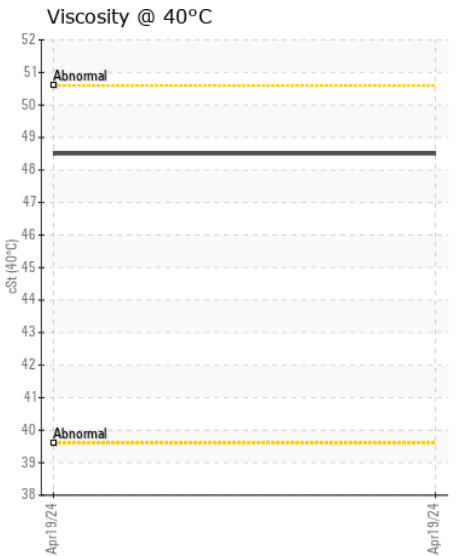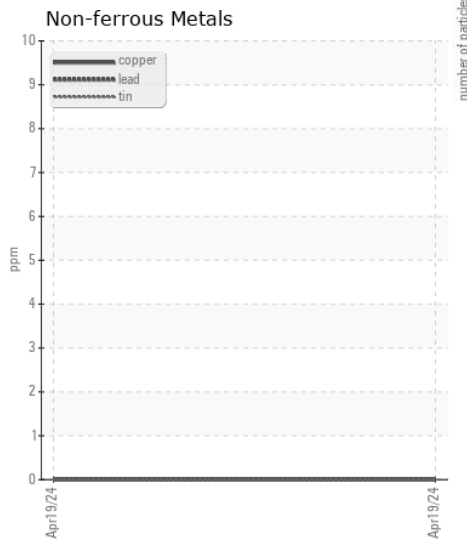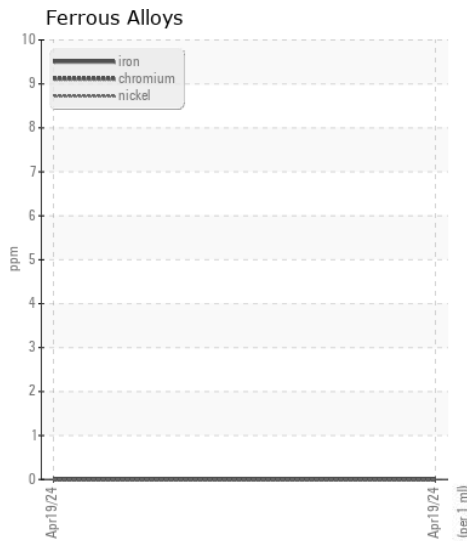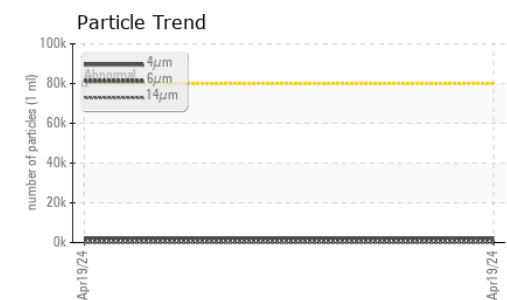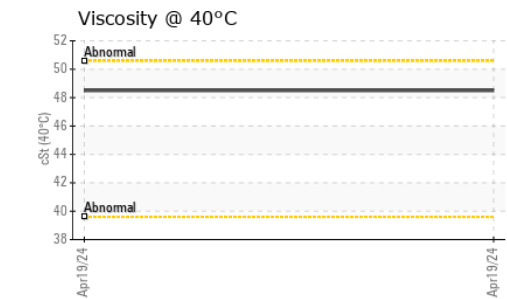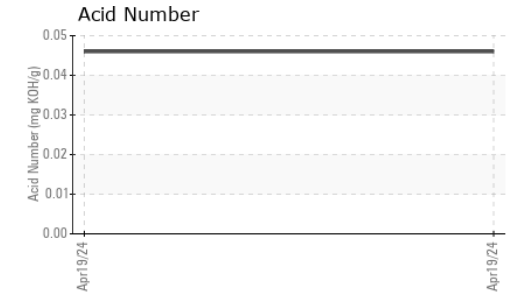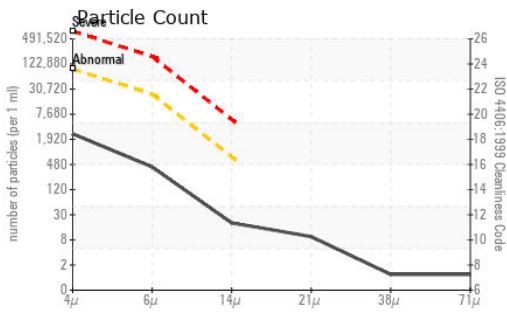

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0212406 **Received** : 22 Apr 2024  
**Lab Number** : 06155802 **Tested** : 23 Apr 2024  
**Unique Number** : 10991225 **Diagnosed** : 24 Apr 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: PQ )

**JRE - GARNER**  
 4161 AUBURN CHURCH RD  
 GARNER, NC  
 US 27529

Contact: RALEIGH SHOP  
 sean.betts@jamesriverequipment.com; catherine.anastasio@wearcheck.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (919)614-2260  
 F: (919)779-5432