

- - - - -



[702216 ALTA RENTS] VOLVO A30G 753623 **Drop Box**

VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP446163		
p	Sample Date		Client Info		17 Apr 2024		
	Machine Age	hrs	Client Info		749		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185m		139		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		2		
	Nickel	ppm	ASTM D5185m	>10	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		14		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		2		
	Tin	ppm	ASTM D5185m	>20	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	25		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	5		
	Water		WC Method	>0.2	NEG		
				, o.=			
	Silt	scalar	*Visual	NONE	NONE		
		scalar scalar			NONE NONE		
	Silt		*Visual	NONE			
	Silt Debris	scalar	*Visual *Visual	NONE NONE	NONE		
	Silt Debris Sand/Dirt	scalar scalar	*Visual *Visual *Visual	NONE NONE NONE	NONE NONE		
	Silt Debris Sand/Dirt Appearance	scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NORML	NONE NONE NORML	 	
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML	NONE NORE NORML NORML NEG	 	
FLUID CONDITION	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium	scalar scalar scalar scalar scalar ppm	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML >0.2	NONE NORML NORML NEG 4	 	
FLUID CONDITION The condition of the oil is acceptable for the time in service.	Silt Debris Sand/Dirt Appearance Odor Emulsified Water	scalar scalar scalar scalar scalar ppm	*Visual *Visual *Visual *Visual *Visual *Visual	NONE NONE NORML NORML >0.2	NONE NORML NORML NEG 4 143		
	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron	scalar scalar scalar scalar scalar ppm	*Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m	NONE NONE NORML NORML >0.2 1111 0.0	NONE NORML NORML NEG 4		
	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium	scalar scalar scalar scalar ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m	NONE NONE NORML NORML >0.2 1111 0.0 0.9	NONE NORML NORML NEG 4 143 <1		
	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum	scalar scalar scalar scalar ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NORML NORML >0.2 1111 0.0 0.9 0.0	NONE NORML NORML NEG 4 143 <1 14 5		
	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese	scalar scalar scalar scalar ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m	NONE NORML NORML >0.2 1111 0.0 0.9 0.0	NONE NORML NORML NEG 4 143 <1 14		
	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium	scalar scalar scalar scalar ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NONE NORML >0.2 1111 0.0 0.9 0.0 39	NONE NORML NORML NEG 4 143 <1 14 5 2		
	Silt Debris Sand/Dirt Appearance Odor Emulsified Water Sodium Boron Barium Molybdenum Manganese Magnesium Calcium	scalar scalar scalar scalar ppm ppm ppm ppm ppm	*Visual *Visual *Visual *Visual *Visual *Visual ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	NONE NORML NORML >0.2 1111 0.0 0.0 0.0 39 93 920	NONE NORML NORML NEG 4 143 <1 14 5 2 33		

Sulfur

Visc @ 40°C

Contact/Location: KENNY HANEY - VOLVO0093

29358

219

ASTM D5185m 20179


333


ASTM D445

ppm

cSt

- - - - -

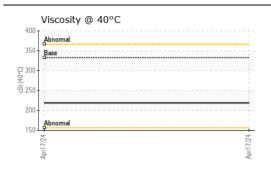

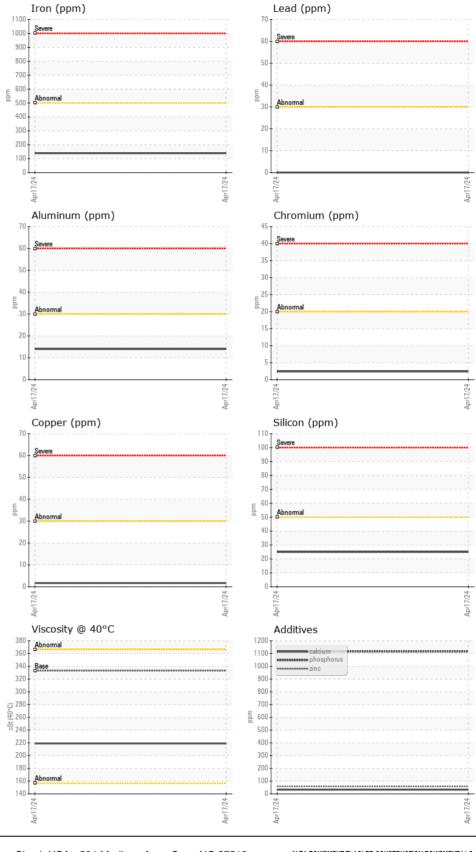

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP446163 : 22 Apr 2024 Lab Number : 06156408 Tested TAMPA, FL : 23 Apr 2024 Unique Number : 10991831 : 23 Apr 2024 - Wes Davis US 33619 Diagnosed Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

۱D

6

Contact/Location: KENNY HANEY - VOLVO0093 Page 2 of 2