



[702244 ALTA RENTS] VOLVO A30G 753626 nonent

Rear Axle

VOLVO PREMIUM GEAR OIL 85W-140 GL-5 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		VCP451307		
resample at the next service interval to monitor.	Sample Date		Client Info		18 Apr 2024		
	Machine Age	hrs	Client Info		727		
	Oil Age	hrs	Client Info		0		
	Filter Age	hrs	Client Info		0		
	Oil Changed		Client Info		Not Changd		
	Filter Changed		Client Info		Not Changd		
	Sample Status				ATTENTION		
WEAR	Iron	ppm	ASTM D5185m		224		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m		5		
	Nickel	ppm	ASTM D5185m	>10	2		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m		<1		
	Lead	ppm	ASTM D5185m		<1		
	Copper	ppm	ASTM D5185m		12		
	Tin	ppm	ASTM D5185m	>20	1		
	Vanadium	ppm	ASTM D5185m	NONE	<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>50	5		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	4		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
	Codium				 0		
FLUID CONDITION	Sodium	ppm	ASTM D5185m	111	2 227		
The oil viscosity is lower than normal. Confirm oil type.	Boron Barium	ppm	ASTM D5185m ASTM D5185m		3		
	Molybdenum	ppm	ASTM D5185m		3 11		
	Manganese	ppm	ASTM D5185m		11		
	Magnesium	ppm	ASTM D5185m		2		
	Calcium	ppm ppm	ASTM D5185m		2 836		
	Jaioutti		ASTM D5185m		1283		
	Phosphorus	nnm			1200		
	Phosphorus Zinc	ppm			355		
	Phosphorus Zinc Sulfur	ppm ppm ppm	ASTM D5185m ASTM D5185m	104	355 21670		


Visc @ 40°C


cSt

Contact/Location: KENNY HANEY - VOLVO0093

87.0

ASTM D445 333

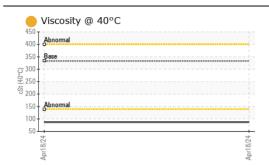

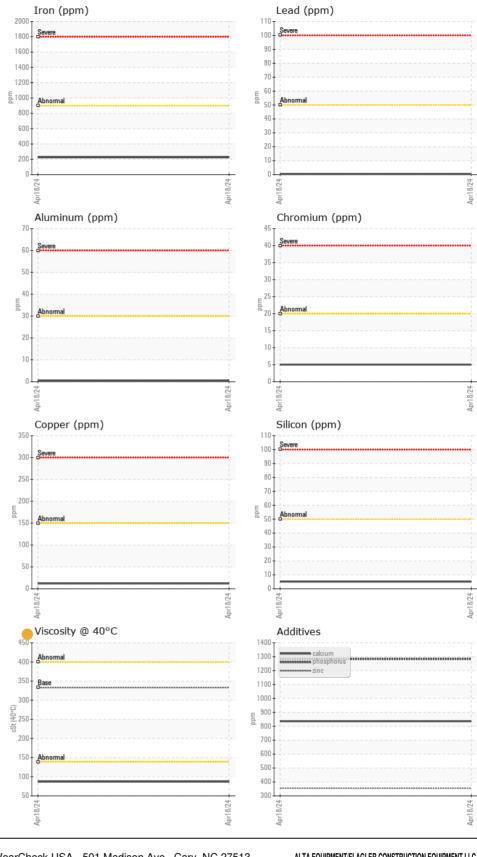

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP451307 : 22 Apr 2024 Lab Number : 06156416 Tested TAMPA, FL : 23 Apr 2024 Unique Number : 10991839 : 24 Apr 2024 - Don Baldridge US 33619 Diagnosed Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

Contact/Location: KENNY HANEY - VOLVO0093 Page 2 of 2