

# WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

[337558] Machine Id VOLVO A25G 752581

Bogie/Center Axle

GEAR OIL SAE 80W140 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W140. Please confirm.

#### **WEAR**

All component wear rates are normal.

### CONTAMINATION

There is no indication of any contamination in the oil.

## FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP445482		
Sample Date		Client Info		22 Apr 2024		
Machine Age	hrs	Client Info		1662		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Filter Changed		Client Info		N/A		
Sample Status				NORMAL		
Iron	ppm	ASTM D5185m	>900	161		
Chromium	ppm	ASTM D5185m	>20	2		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>30	0		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>150	13		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>50	2		
Potassium	ppm	ASTM D5185m	>20	0		
Water	ppin	WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
			20.2			
Sodium	ppm	ASTM D5185m		0		
Boron	ppm	ASTM D5185m	400	206		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	1		
Manganese	ppm	ASTM D5185m		4		
Magnesium	ppm	ASTM D5185m	12	0		
Calcium	ppm	ASTM D5185m	150	191		
Phosphorus	ppm	ASTM D5185m	1650	1189		
Zinc	ppm	ASTM D5185m	125	82		
Sulfur	ppm	ASTM D5185m	22500	30300		
Vice @ 40%C	- 0+		060	041		


Visc @ 40°C


cSt

ASTM D445 263

Contact/Location: KENNY HANEY - VOLVO0093

241

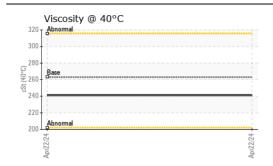

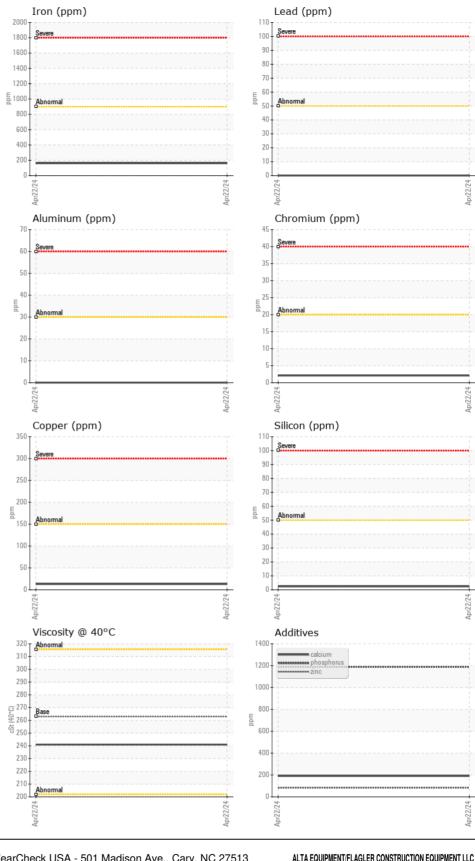

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP445482 : 24 Apr 2024 Lab Number : 06159452 Tested : 25 Apr 2024 TAMPA, FL Unique Number : 10994875 : 25 Apr 2024 - Wes Davis US 33619 Diagnosed Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

Contact/Location: KENNY HANEY - VOLVO0093 Page 2 of 2