

I337558] Machine Id VOLVO A25G 752581 Component Front Axle

GEAR OIL SAE 80W140 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W140. Please confirm.

WEAR

All component wear rates are normal.

CONTAMINATION

There is no indication of any contamination in the oil.

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

.)						
Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP437854		
Sample Date		Client Info		22 Apr 2024		
Machine Age	hrs	Client Info		1662		
Oil Age	hrs	Client Info		0		
Filter Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Filter Changed		Client Info		N/A		
Sample Status				NORMAL		
Iron	ppm	ASTM D5185m	>900	155		
Chromium	ppm	ASTM D5185m	>20	2		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	0.5	0		
Aluminum	ppm	ASTM D5185m	>30	0		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>150	13		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>50	3		
Potassium	ppm	ASTM D5185m	>20	0		
Water		WC Method	>0.2	NEG		
Silt	scalar	*Visual	NONE	LIGHT		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Sodium		ACTM DE105m		0		
Sodium Boron	ppm	ASTM D5185m ASTM D5185m	400	0 207		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	0 <1		
Manganese	ppm	ASTM D5185m	12	4		
Magnesium	ppm	ASTM D5185m	12	4 0		
Calcium	ppm	ASTM D5185m	150	149		
Phosphorus	ppm	ASTM D5185m	1650	149		
Zinc	ppm					
Sulfur	ppm	ASTM D5185m	125	62 20729		
Sullul	ppm	ASTM D5185m	22500	30738		

WEAR NORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL


Visc @ 40°C


cSt

ASTM D445 263

Contact/Location: KENNY HANEY - VOLVO0093

250

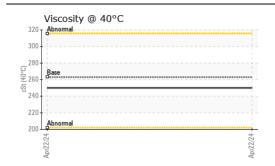

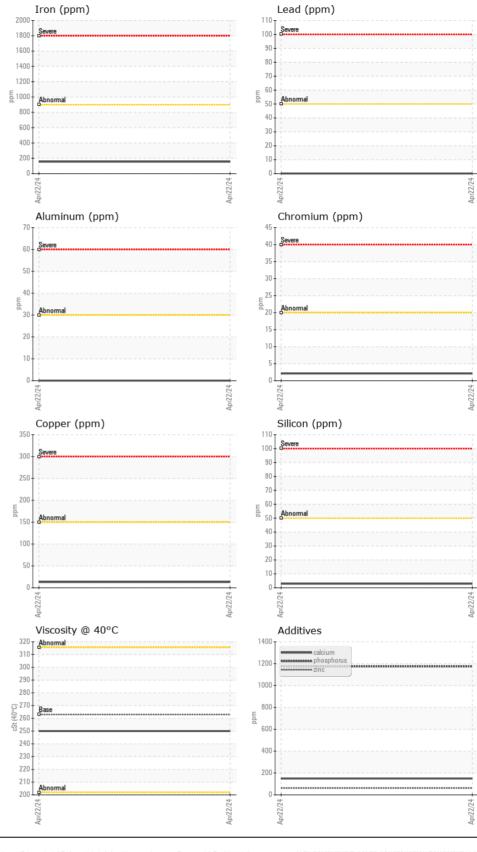

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. Received 8418 PALM RIVER ROAD : VCP437854 : 24 Apr 2024 Lab Number : 06159453 TAMPA, FL Tested : 25 Apr 2024 Unique Number : 10994876 : 25 Apr 2024 - Wes Davis US 33619 Diagnosed Test Package : MOB 1 Contact: KENNY HANEY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. khaney@flaglerce.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: (813)630-0077 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (813)630-2233

Contact/Location: KENNY HANEY - VOLVO0093 Page 2 of 2