



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**BOBSP 7352**  
 Component  
**Gearbox**  
 Fluid  
**MOBIL MOBILGEAR 600 XP ISO 150 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PTK0001428</b>	PTK0000294	PTK0000352
Sample Date		Client Info		<b>19 Apr 2024</b>	09 Nov 2023	13 Jun 2023
Machine Age	mths	Client Info		<b>0</b>	0	0
Oil Age	mths	Client Info		<b>0</b>	0	0
Filter Age	mths	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

## WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>200	<b>4</b>	2	2
Chromium	ppm	ASTM D5185m	>10	<b>&lt;1</b>	0	0
Nickel	ppm	ASTM D5185m	>10	<b>1</b>	0	0
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Silver	ppm	ASTM D5185m		<b>&lt;1</b>	0	<1
Aluminum	ppm	ASTM D5185m	>25	<b>2</b>	0	0
Lead	ppm	ASTM D5185m	>50	<b>1</b>	0	0
Copper	ppm	ASTM D5185m	>200	<b>4</b>	1	<1
Tin	ppm	ASTM D5185m	>10	<b>1</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>50	<b>4</b>	1	0
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	0	1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647		<b>1981</b>	1029	501
Particles >6µm		ASTM D7647	>2500	<b>420</b>	281	144
Particles >14µm		ASTM D7647	>320	<b>42</b>	25	16
Particles >21µm		ASTM D7647	>80	<b>13</b>	8	6
Particles >38µm		ASTM D7647	>20	<b>0</b>	1	0
Particles >71µm		ASTM D7647	>4	<b>0</b>	1	0
Oil Cleanliness		ISO 4406 (c)	>18/15	<b>16/13</b>	15/12	14/11
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>0</b>	<1	0
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>&lt;1</b>	0	2
Molybdenum	ppm	ASTM D5185m		<b>1</b>	0	0
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Magnesium	ppm	ASTM D5185m		<b>1</b>	0	<1
Calcium	ppm	ASTM D5185m		<b>6</b>	1	2
Phosphorus	ppm	ASTM D5185m		<b>287</b>	287	298
Zinc	ppm	ASTM D5185m		<b>6</b>	4	5
Sulfur	ppm	ASTM D5185m		<b>16804</b>	14738	17044
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.75</b>	0.59	0.73
Visc @ 40°C	cSt	ASTM D445	150	<b>156</b>	159	155

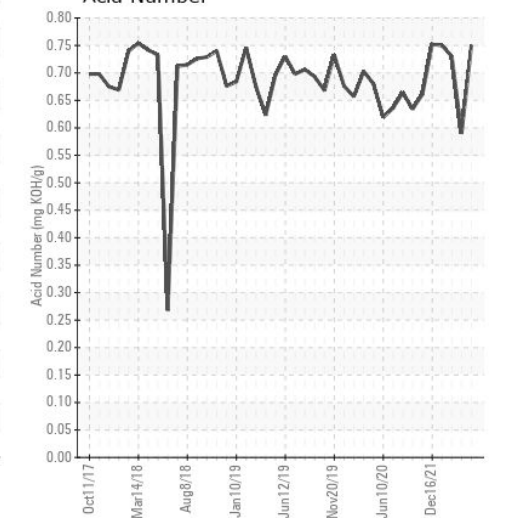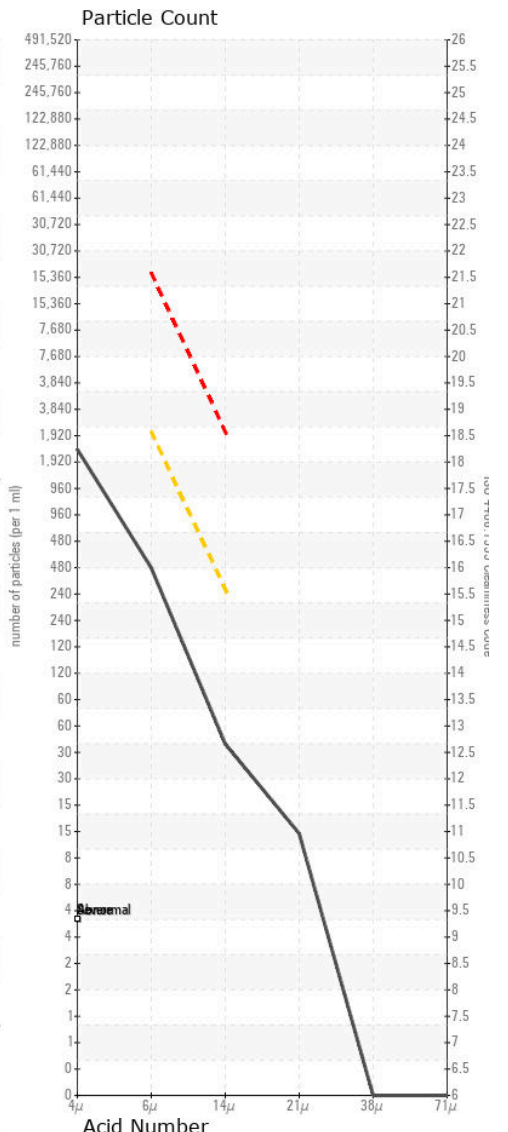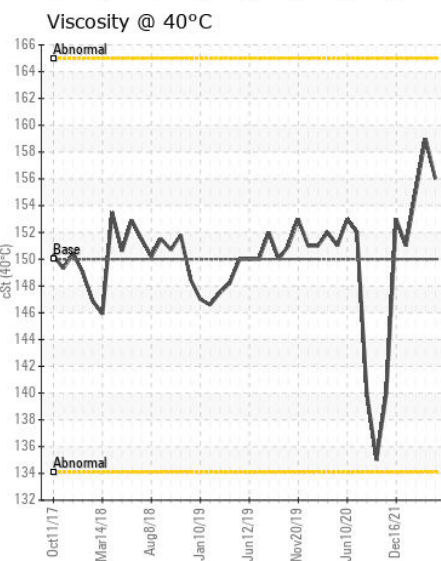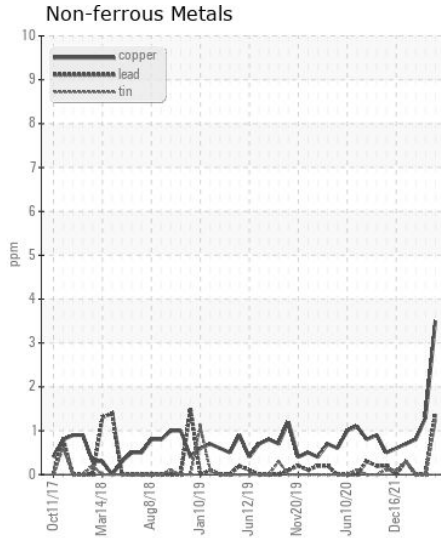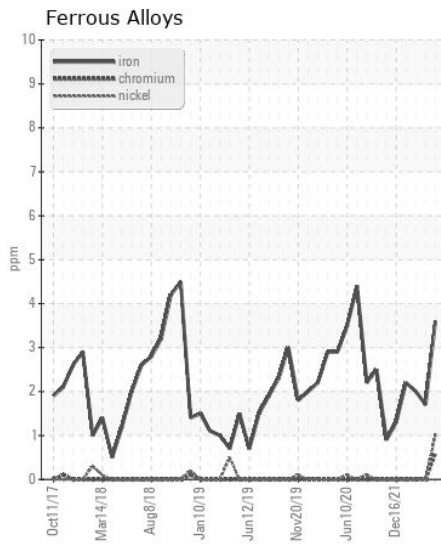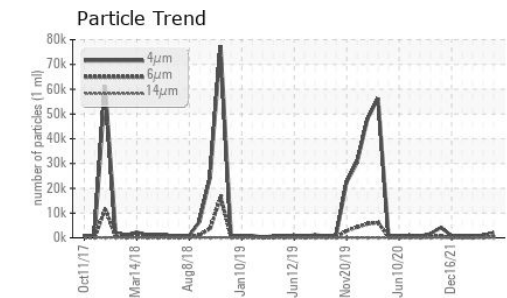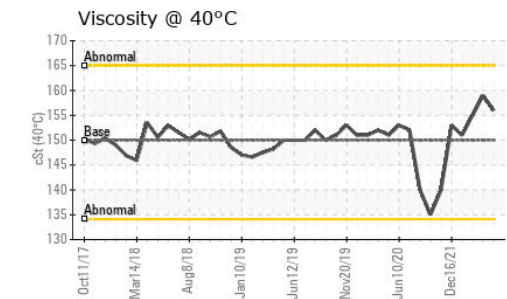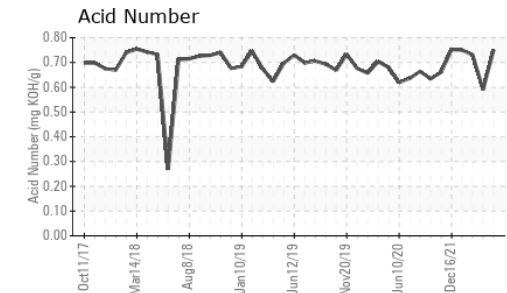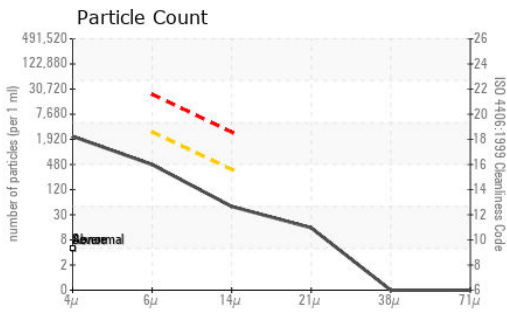

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : PTK0001428 **Received** : 24 Apr 2024  
**Lab Number** : 06159786 **Tested** : 25 Apr 2024  
**Unique Number** : 10995209 **Diagnosed** : 25 Apr 2024 - Wes Davis  
**Test Package** : MOB 2 ( Additional Tests: PrtCount )

**GRAPHIC PACKAGING**  
 1500 NICHOLAS BLVD  
 ELK GROVE, IL  
 US 60017  
 Contact: TONY HILDY  
 anthonyhildy@graphicpkg.com  
 T: (847)437-1700  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)