



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
[SPM701405]
 Machine Id
SENNEBOGEN 835ME 835.0.2718
 Component
Hydraulic System
 Fluid
VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP437969	VCP415009	VCP423382
Sample Date		Client Info		12 Apr 2024	12 Sep 2023	25 May 2023
Machine Age	hrs	Client Info		9760	8383	7855
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Chngd	Not Chngd	Changed
Filter Changed		Client Info		Not Chngd	Not Chngd	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>20	4	2	6
Chromium	ppm	ASTM D5185m	>10	2	<1	2
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	<1	<1
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>75	<1	<1	2
Tin	ppm	ASTM D5185m	>10	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>20	1	1	2
Potassium	ppm	ASTM D5185m	>20	<1	<1	0
Water		WC Method	>0.1	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>5000	1604	2559	1486
Particles >6µm		ASTM D7647	>1300	478	541	259
Particles >14µm		ASTM D7647	>160	34	33	21
Particles >21µm		ASTM D7647	>40	6	10	6
Particles >38µm		ASTM D7647	>10	0	2	0
Particles >71µm		ASTM D7647	>3	0	2	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	18/16/12	19/16/12	18/15/12
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		4	2	6
Boron	ppm	ASTM D5185m	14	3	4	14
Barium	ppm	ASTM D5185m	0.0	0	0	0
Molybdenum	ppm	ASTM D5185m	0.0	<1	<1	<1
Manganese	ppm	ASTM D5185m	0.0	0	0	<1
Magnesium	ppm	ASTM D5185m	2.6	18	26	54
Calcium	ppm	ASTM D5185m	49	309	368	888
Phosphorus	ppm	ASTM D5185m	354	419	471	610
Zinc	ppm	ASTM D5185m	419	519	572	785
Sulfur	ppm	ASTM D5185m	3719	1670	1788	3074
Acid Number (AN)	mg KOH/g	ASTM D8045		0.58	0.46	0.76
Visc @ 40°C	cSt	ASTM D445	46	40.7	40.6	40.9

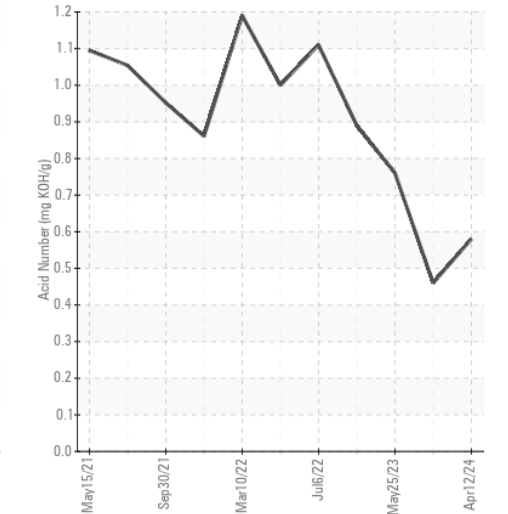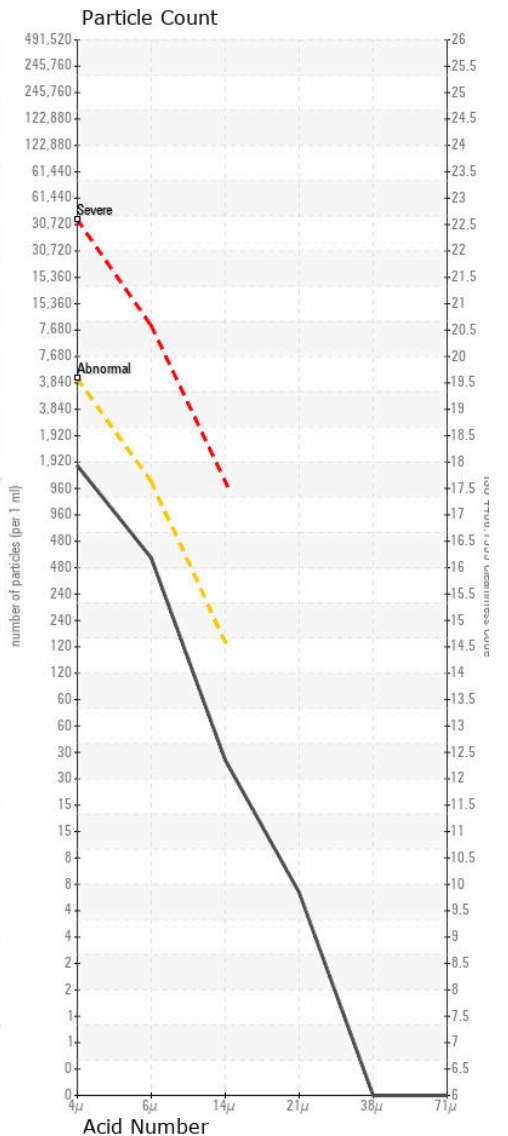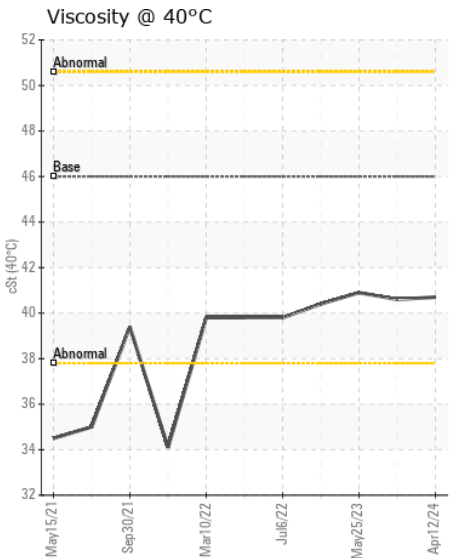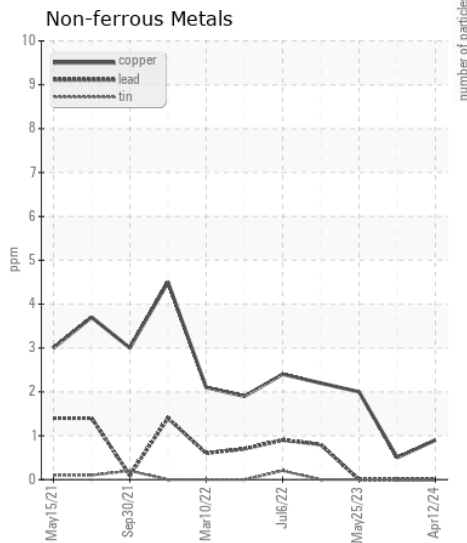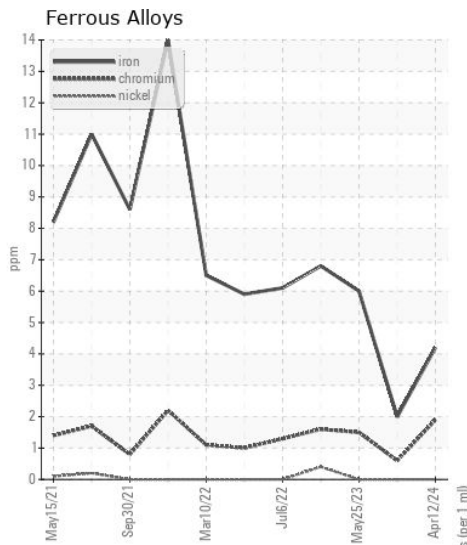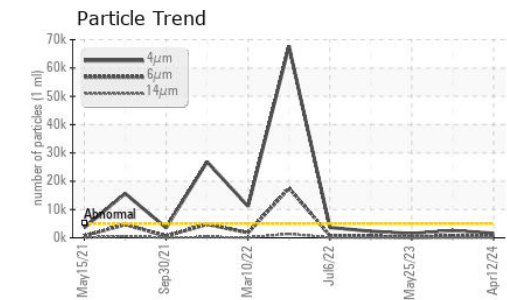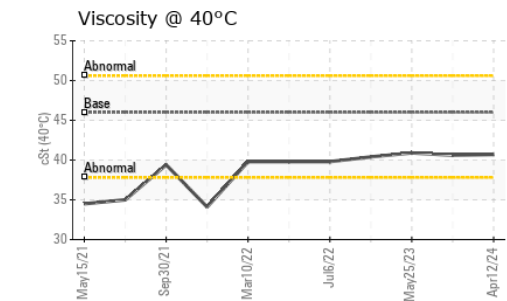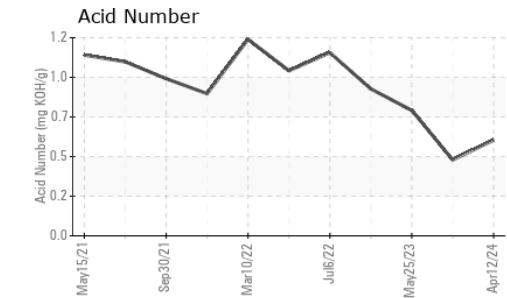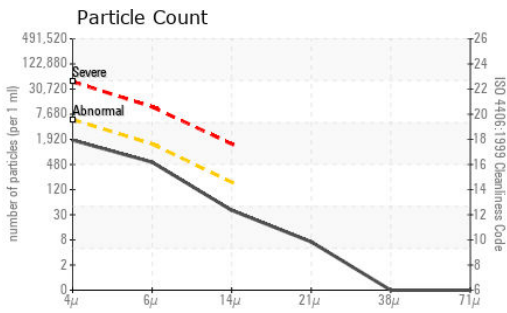

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513

Sample No. : VCP437969

Lab Number : 06160294

Unique Number : 10995717

Test Package : MOB 2

Received : 25 Apr 2024

Tested : 30 Apr 2024

Diagnosed : 30 Apr 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

BELSON STEEL

1685 N STATE RTE 50

BOURBONNAIS, IL

US 60914

Contact: M. POZAN

mpozan@belsonsteel.com

T: (815)932-7416

F: