



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area  
**[SWO-071569]**  
 Machine Id  
**VOLVO A45G 353092**  
 Component  
**Bogie/Center Axle**  
 Fluid  
**{not provided} (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP453646</b>	VCP443286	VCP431095
Sample Date		Client Info		<b>02 May 2024</b>	03 Jan 2024	19 Sep 2023
Machine Age	hrs	Client Info		<b>3022</b>	2545	2012
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Filter Changed		Client Info		<b>Not Changed</b>	Not Changed	Not Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>900	<b>202</b>	196	181
Chromium	ppm	ASTM D5185m	>20	<b>2</b>	2	2
Nickel	ppm	ASTM D5185m	>10	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>30	<b>0</b>	2	<1
Lead	ppm	ASTM D5185m	>50	<b>&lt;1</b>	<1	0
Copper	ppm	ASTM D5185m	>150	<b>3</b>	4	3
Tin	ppm	ASTM D5185m	>20	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>50	<b>5</b>	5	4
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	4	3
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	*Visual	NONE	<b>NONE</b>	MODER	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185m		<b>2</b>	0	2
Boron	ppm	ASTM D5185m		<b>210</b>	243	229
Barium	ppm	ASTM D5185m		<b>&lt;1</b>	8	0
Molybdenum	ppm	ASTM D5185m		<b>10</b>	11	12
Manganese	ppm	ASTM D5185m		<b>7</b>	7	6
Magnesium	ppm	ASTM D5185m		<b>1</b>	1	<1
Calcium	ppm	ASTM D5185m		<b>148</b>	143	137
Phosphorus	ppm	ASTM D5185m		<b>2511</b>	2328	2308
Zinc	ppm	ASTM D5185m		<b>83</b>	66	66
Sulfur	ppm	ASTM D5185m		<b>32468</b>	29323	27145
Visc @ 40°C	cSt	ASTM D445		<b>50.5</b>	52.4	50.4

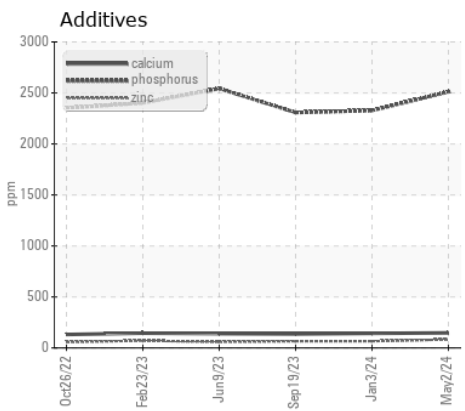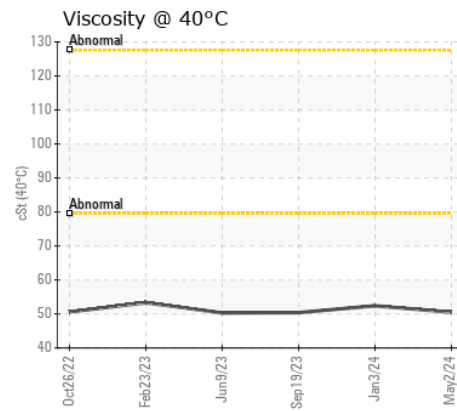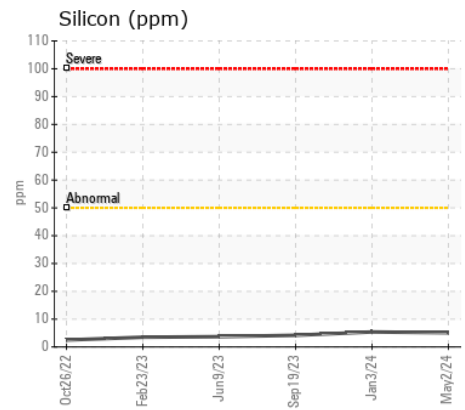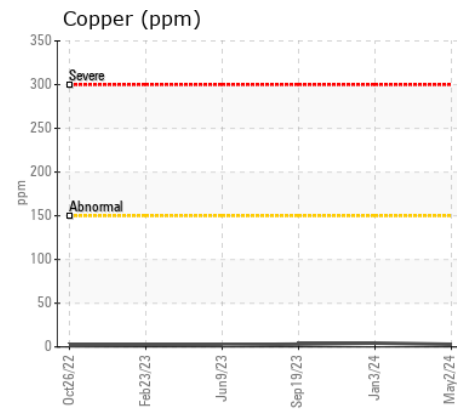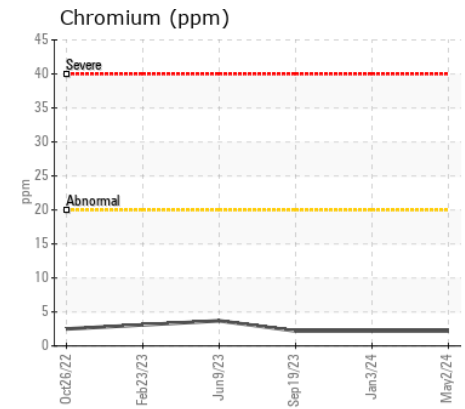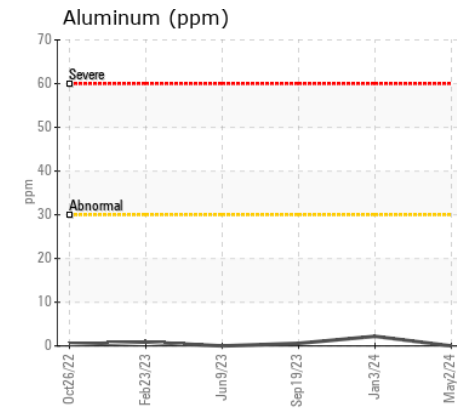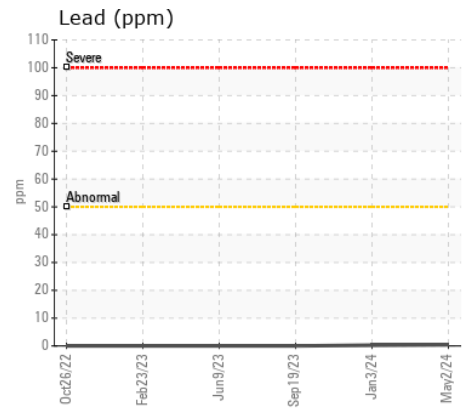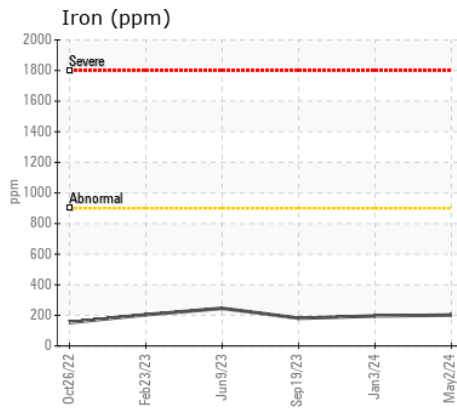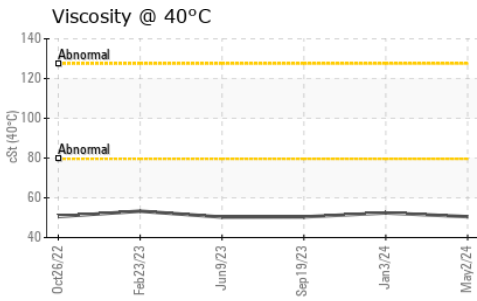

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP453646  
**Lab Number** : 06174249  
**Unique Number** : 11020302  
**Test Package** : MOB 1

**Received** : 09 May 2024  
**Tested** : 10 May 2024  
**Diagnosed** : 13 May 2024 - Angela Borella

**SAIIA CONSTRUCTION LLC**  
 4400 LEWISBURG RD  
 BIRMINGHAM, AL  
 US 35207

Contact: STEPHANI BRITTON  
 sbritton@saiia.com; doug.bogart@wearcheck.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (205)943-2268  
 F: (205)943-2269