



# VOLVO

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area

**[SPM703631 HERC]**

Machine Id

**VOLVO A30G 753419**

Component

**Diesel Engine**

Fluid

**VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3 (--- GAL)**

### RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>VCP454769</b>	---	---
Sample Date		Client Info		<b>03 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>567</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

Metal levels are typical for a new component breaking in.

Iron	ppm	ASTM D5185m	>100	<b>9</b>	---	---
Chromium	ppm	ASTM D5185m	>20	<b>0</b>	---	---
Nickel	ppm	ASTM D5185m	>2	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185m		<b>6</b>	---	---
Silver	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>25	<b>2</b>	---	---
Lead	ppm	ASTM D5185m	>40	<b>0</b>	---	---
Copper	ppm	ASTM D5185m	>330	<b>4</b>	---	---
Tin	ppm	ASTM D5185m	>15	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION












Fuel content negligible. There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>9</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>1</b>	---	---
Fuel	%	ASTM D3524	>6.0	<b>0.2</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	*ASTM D7844	>3	<b>0.2</b>	---	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>7.6</b>	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>18.9</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>2</b>	---	---
Boron	ppm	ASTM D5185m	2.5	<b>197</b>	---	---
Barium	ppm	ASTM D5185m	0.0	<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m	0.7	<b>64</b>	---	---
Manganese	ppm	ASTM D5185m	0.0	<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m	256	<b>485</b>	---	---
Calcium	ppm	ASTM D5185m	2057	<b>1604</b>	---	---
Phosphorus	ppm	ASTM D5185m	935	<b>892</b>	---	---
Zinc	ppm	ASTM D5185m	1223	<b>1010</b>	---	---
Sulfur	ppm	ASTM D5185m	4079	<b>3545</b>	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>13.8</b>	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	10	<b>7.5</b>	---	---
Visc @ 100°C	cSt	ASTM D445	15.0	<b>12.1</b>	---	---

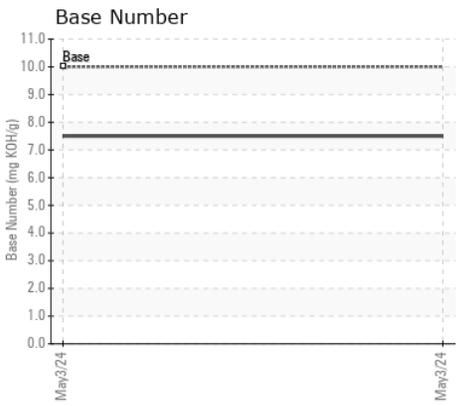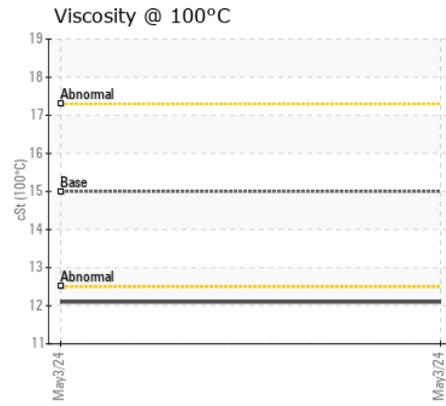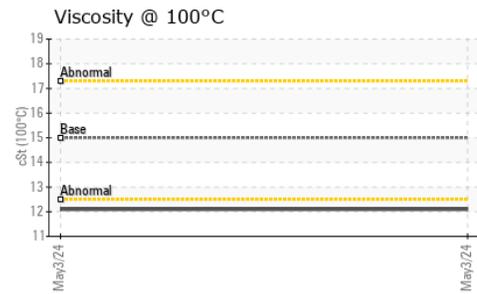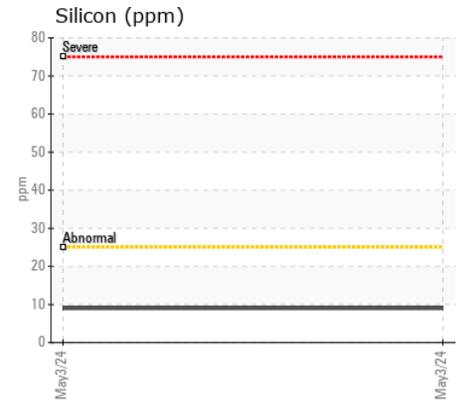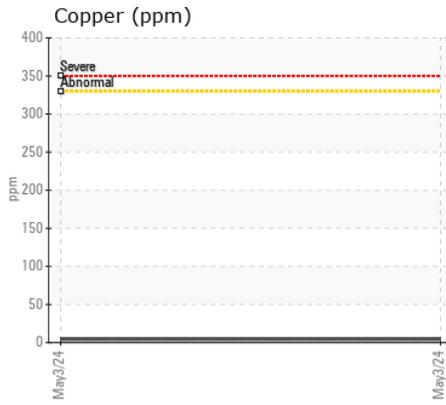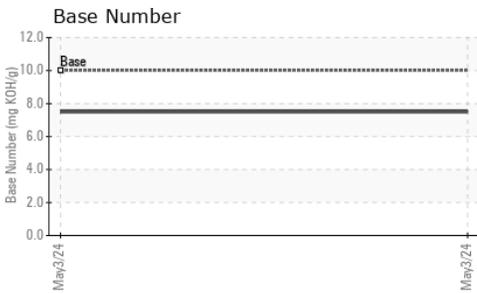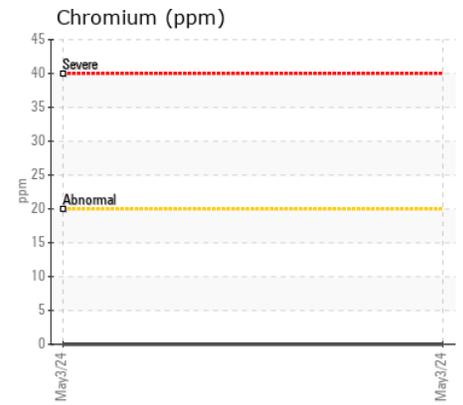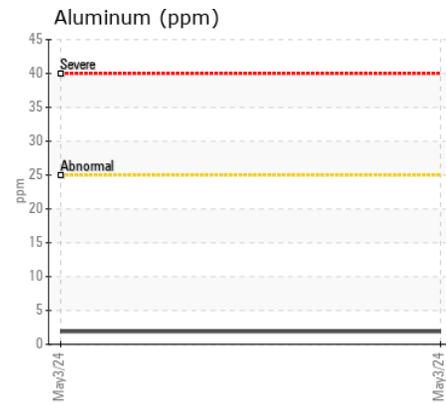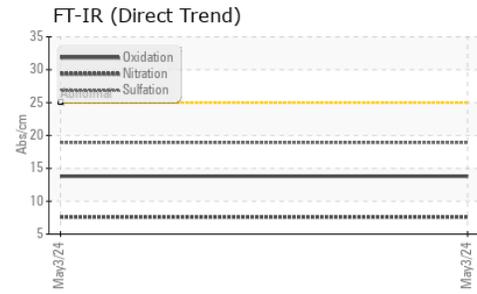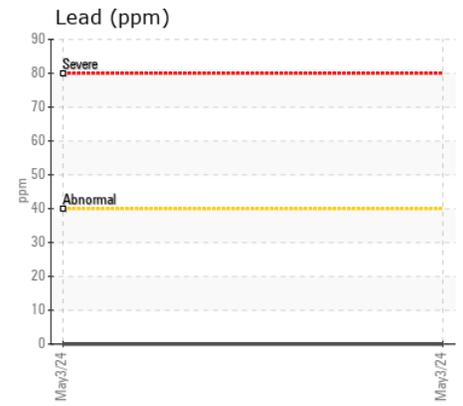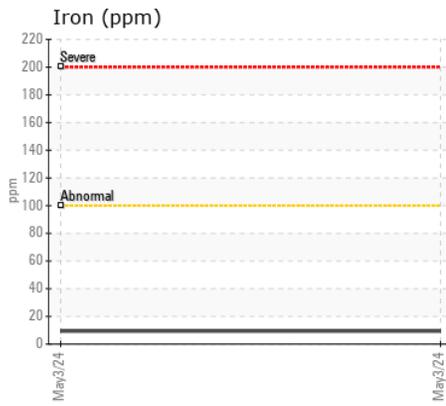

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP454769 **Received** : 10 May 2024  
**Lab Number** : 06175080 **Tested** : 15 May 2024  
**Unique Number** : 11021133 **Diagnosed** : 15 May 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: FuelDilution, PercentFuel, TBN )

**ALTA EQUIPMENT COMPANY**  
 5210 REESE ROAD  
 DAVIE, FL  
 US 33314  
 Contact: N. FACEY  
 nfacey@altaequipfl.com  
 T: (954)581-4744  
 F: (954)583-0318

Certificate L2367  
 To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)