



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>ATTENTION</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**JOHN DEERE 544L 400-002 (S/N 1DW544LZVLF705826)**

Component  
**Hydraulic System**

Fluid  
**JOHN DEERE HYDRAU (--- GAL)**

### RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0214766</b>	---	---
Sample Date		Client Info		<b>09 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>5868</b>	---	---
Oil Age	hrs	Client Info		<b>5868</b>	---	---
Filter Age	hrs	Client Info		<b>5868</b>	---	---
Oil Changed		Client Info		<b>Not Chngd</b>	---	---
Filter Changed		Client Info		<b>Not Chngd</b>	---	---
Sample Status				<b>ATTENTION</b>	---	---

### WEAR

All component wear rates are normal.

PQ	UOM	Method	Limit/Abn	Current	History1	History2
Iron	ppm	ASTM D5185m	>20	<b>8</b>	---	---
Chromium	ppm	ASTM D5185m	>10	<b>1</b>	---	---
Nickel	ppm	ASTM D5185m	>10	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m		<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>10	<b>2</b>	---	---
Lead	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Copper	ppm	ASTM D5185m	>75	<b>2</b>	---	---
Tin	ppm	ASTM D5185m	>10	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION










There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185m	>20	<b>2</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Water		WC Method	>0.1	<b>NEG</b>	---	---
Particles >4µm		ASTM D7647	>5000	<b>7417</b>	---	---
Particles >6µm		ASTM D7647	>1300	<b>1551</b>	---	---
Particles >14µm		ASTM D7647	>160	<b>142</b>	---	---
Particles >21µm		ASTM D7647	>40	<b>39</b>	---	---
Particles >38µm		ASTM D7647	>10	<b>1</b>	---	---
Particles >71µm		ASTM D7647	>3	<b>0</b>	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>20/18/14</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	---	---

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>3</b>	---	---
Boron	ppm	ASTM D5185m		<b>0</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Manganese	ppm	ASTM D5185m		<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>3</b>	---	---
Calcium	ppm	ASTM D5185m	87	<b>61</b>	---	---
Phosphorus	ppm	ASTM D5185m	727	<b>355</b>	---	---
Zinc	ppm	ASTM D5185m	900	<b>321</b>	---	---
Sulfur	ppm	ASTM D5185m	1500	<b>3794</b>	---	---
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	<b>0.43</b>	---	---
Visc @ 40°C	cSt	ASTM D445	65	<b>49.0</b>	---	---

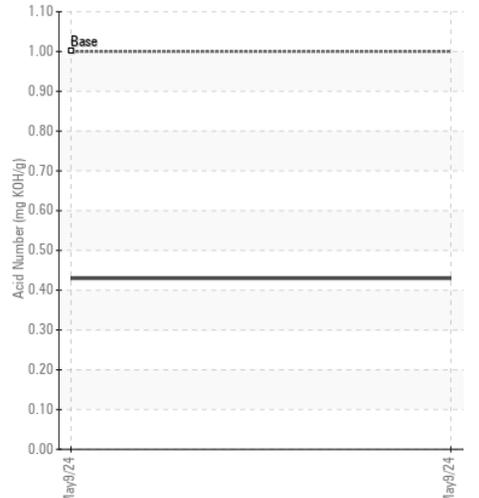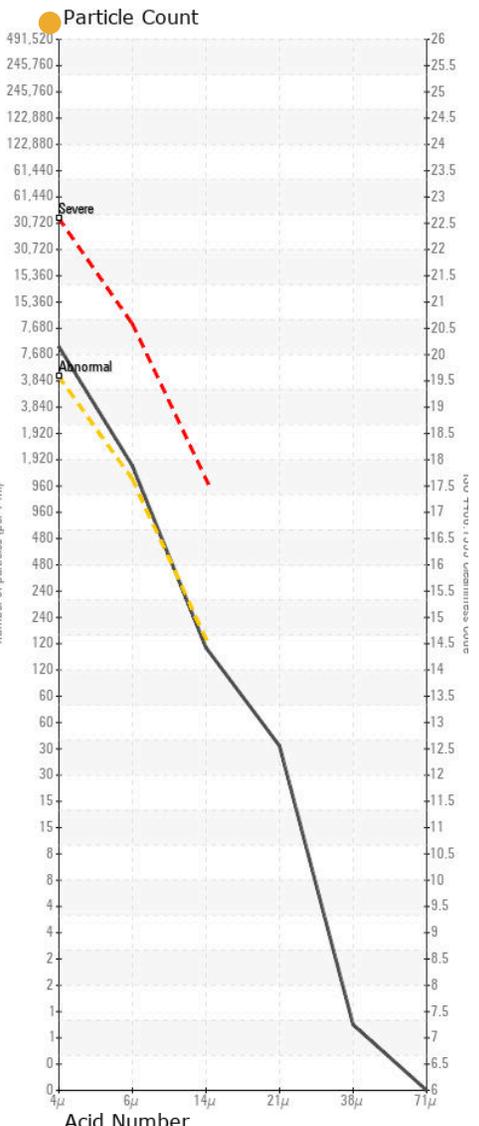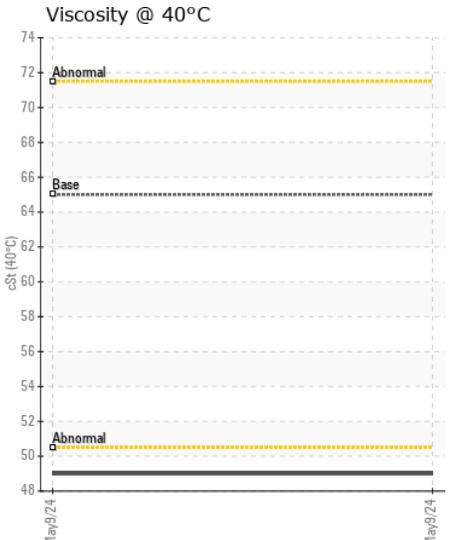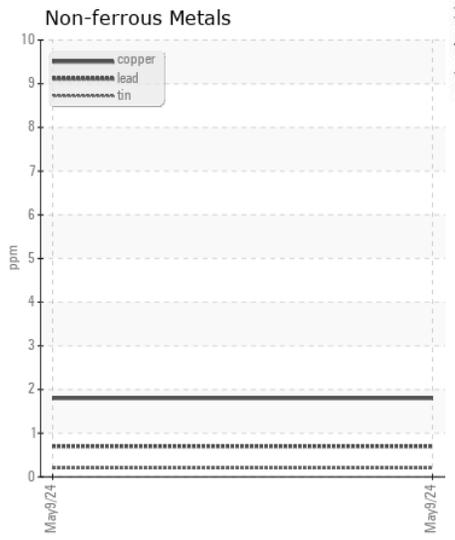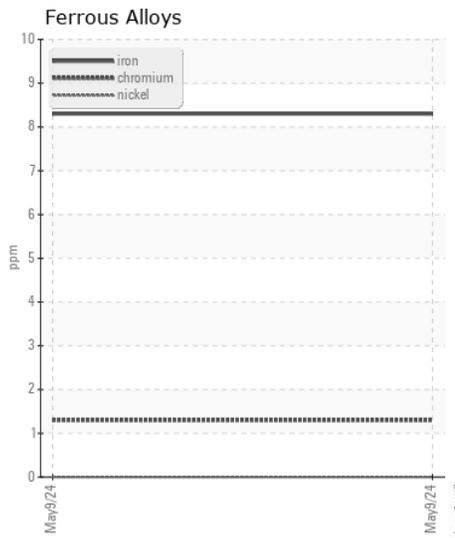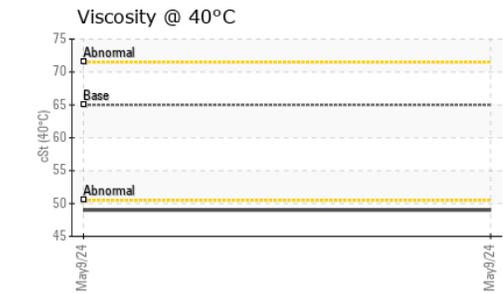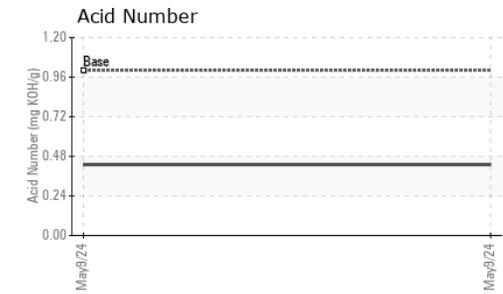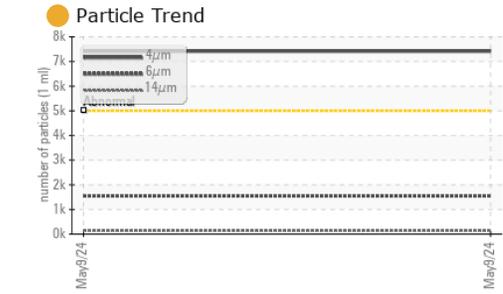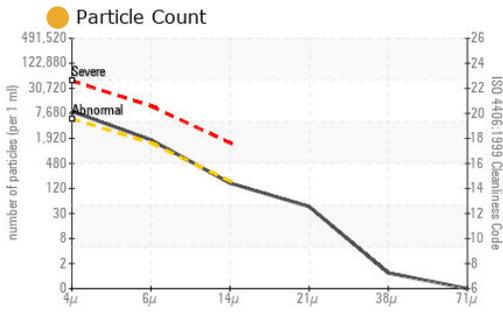

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0214766 **Received** : 10 May 2024  
**Lab Number** : 06175345 **Tested** : 13 May 2024  
**Unique Number** : 11021398 **Diagnosed** : 13 May 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: PQ )

**PLEASANT CONSTRUCTION INC**  
 24024 FREDERICK RD  
 CLARKSBURG, MD  
 US 20871  
 Contact: HERBIE TRENT

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (301)502-0163

F: