



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Area

**[16W16216]**

Machine Id

**CATERPILLAR D5K C331149 (S/N CAT00D5KCKY205397)**

Component

**Diesel Engine**

Fluid

**CAT DIESEL ENGINE OIL 15W40 (13 QTS)**

### RECOMMENDATION

Resample at the next service interval to monitor. ( Customer Sample Comment: 16W16216 )

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0206854</b>	---	---
Sample Date		Client Info		<b>08 May 2024</b>	---	---
Machine Age	hrs	Client Info		<b>5162</b>	---	---
Oil Age	hrs	Client Info		<b>1239</b>	---	---
Filter Age	hrs	Client Info		<b>1239</b>	---	---
Oil Changed		Client Info		<b>Changed</b>	---	---
Filter Changed		Client Info		<b>Changed</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>100	<b>47</b>	---	---
Chromium	ppm	ASTM D5185m	>20	<b>3</b>	---	---
Nickel	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Titanium	ppm	ASTM D5185m	>2	<b>&lt;1</b>	---	---
Silver	ppm	ASTM D5185m	>2	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185m	>25	<b>11</b>	---	---
Lead	ppm	ASTM D5185m	>40	<b>&lt;1</b>	---	---
Copper	ppm	ASTM D5185m	>330	<b>5</b>	---	---
Tin	ppm	ASTM D5185m	>15	<b>&lt;1</b>	---	---
Vanadium	ppm	ASTM D5185m		<b>0</b>	---	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	---	---

### CONTAMINATION








There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>15</b>	---	---
Potassium	ppm	ASTM D5185m	>20	<b>&lt;1</b>	---	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	*ASTM D7844	>3	<b>0.4</b>	---	---
Nitration	Abs/cm	*ASTM D7624	>20	<b>11.7</b>	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>23.3</b>	---	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	---	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	---	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	---	---

### FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>3</b>	---	---
Boron	ppm	ASTM D5185m		<b>24</b>	---	---
Barium	ppm	ASTM D5185m		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185m		<b>60</b>	---	---
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	---	---
Magnesium	ppm	ASTM D5185m		<b>503</b>	---	---
Calcium	ppm	ASTM D5185m		<b>1941</b>	---	---
Phosphorus	ppm	ASTM D5185m		<b>975</b>	---	---
Zinc	ppm	ASTM D5185m	1460	<b>1209</b>	---	---
Sulfur	ppm	ASTM D5185m		<b>3373</b>	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>23.4</b>	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	11.3	<b>6.8</b>	---	---
Visc @ 100°C	cSt	ASTM D445	15.5	<b>13.6</b>	---	---

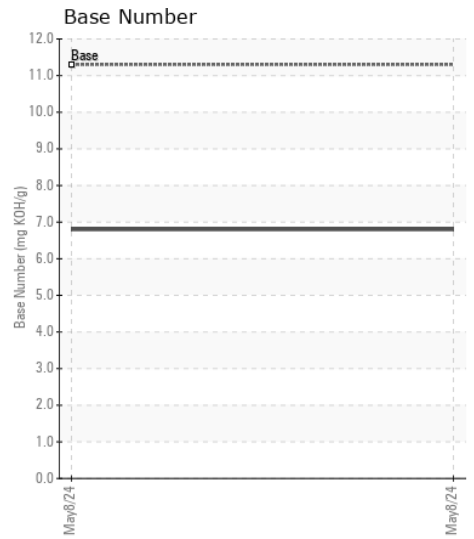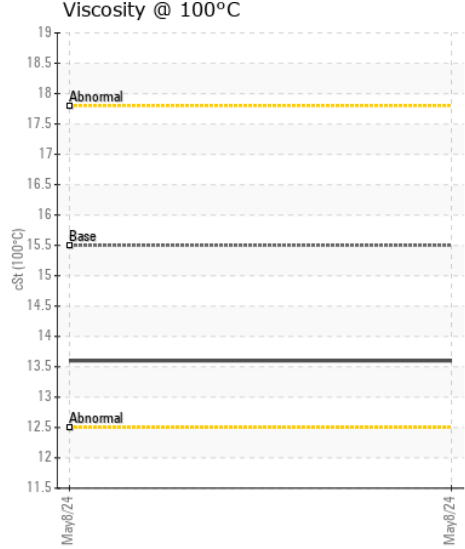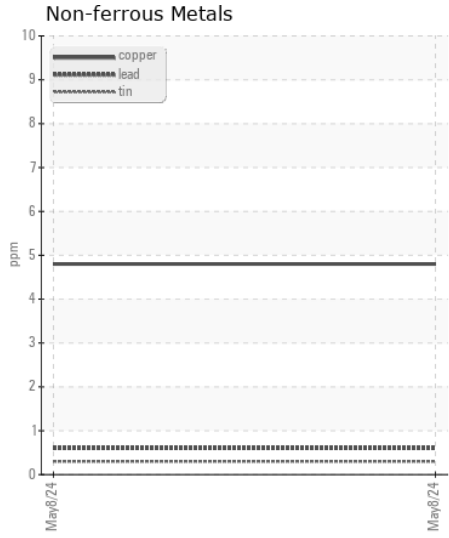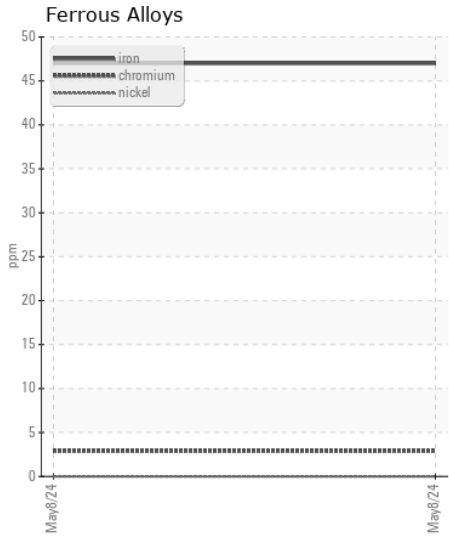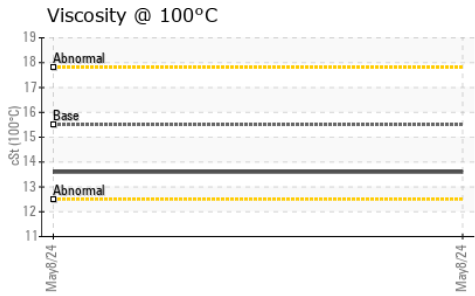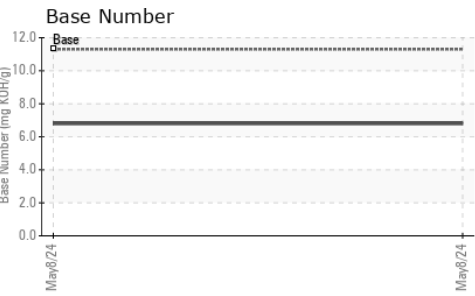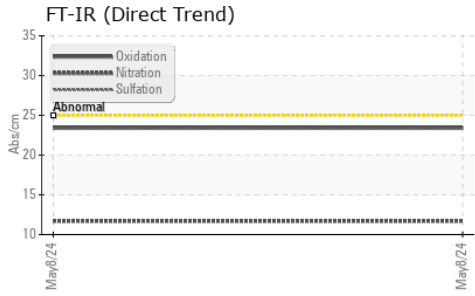

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0206854 **Received** : 13 May 2024  
**Lab Number** : 06176996 **Tested** : 14 May 2024  
**Unique Number** : 11023049 **Diagnosed** : 14 May 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: TBN )

**JRE - CASTLE HAYNE**  
 113 CROWATAN ROAD  
 CASTLE HAYNE, NC  
 US 28429-5819

Contact: WILMINGTON SHOP

tbod.simmmons@jamesriverequipment.com; canastasio@wearcheck.com; canastasio@we

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (910)675-9211

F: