

CORROSION CONTAMINANTS FUEL CONDITION NORMAL NORMAL


Machine Id


ISUZU 5067014

Component
Diesel Fuel

No.2 DIESEL FUEL (ULTRALOW SULPHUR) (--- QTS)

	·						
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
No corrective action is recommended at this time.	Sample Number		Client Info		LF0001648		
	Sample Date		Client Info		08 May 2024		
	Machine Age	hrs	Client Info		0		
	Sample Status				NORMAL		
CORROSION	Aluminum	ppm	ASTM D5185m	<0.1	0		
All metal levels are normal indicating no corrosion in the system.	Nickel	ppm	ASTM D5185m	<0.1	0		
	Lead	ppm	ASTM D5185m	<0.1	0		
	Vanadium	ppm	ASTM D5185m	<0.1	<1		
	Iron	ppm	ASTM D5185m	<0.1	0		
CONTAMINANTS	Silicon	ppm	ASTM D5185m	<1.0	<1		
The water content is negligible. There is no indication of any contamination in the fuel.	Sodium	ppm	ASTM D5185m	<0.1	1		
	Potassium	ppm	ASTM D5185m	<0.1	<1		
	Water	%	ASTM D6304	<0.05	0.002		
	ppm Water	ppm	ASTM D6304	<500	23		
	Calcium	ppm	ASTM D5185m	<0.1	0		
	Magnesium	ppm	ASTM D5185m	<0.1	0		
	Phosphorus	ppm	ASTM D5185m	<0.1	<1		
	Zinc	ppm	ASTM D5185m	<0.1	0		
FUEL CONDITION	Visc @ 40°C	cSt	ASTM D445	3.0	2.46		
The condition of the fuel is acceptable for the time in service.	Sulfur	ppm	ASTM D5185m	10	17		

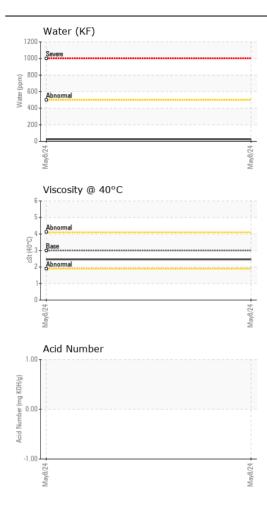

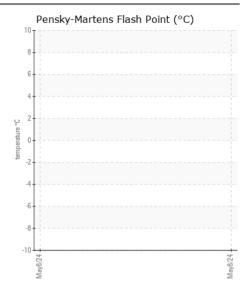



Certificate L2367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06178271

Unique Number : 11029597 Test Package : MOB 1 (Additional Tests: KF)

: LF0001648

Received **Tested** Diagnosed

: 13 May 2024 : 17 May 2024

: 17 May 2024 - Jonathan Hester

L&W DIESEL SERVICE 2600 W 43RD ODESSA, TX US 79764 Contact: DREW ALLEN

drew@lwdiesel.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: