



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area  
**Y.S. CHI**  
Machine Id  
**[Y.S. CHI] 012 503877-12**  
Component  
**Auxiliary Steering**  
Fluid  
**CHEVRON RANDO HDZ 68 (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>MW06186646</b>	MW0055635	MW0049514
Sample Date		Client Info		<b>01 May 2024</b>	01 Nov 2023	01 May 2023
Machine Age	hrs	Client Info		<b>32864</b>	28800	24330
Oil Age	hrs	Client Info		<b>0</b>	28800	24330
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>50	<b>0</b>	0	0
Chromium	ppm	ASTM D5185m	>15	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185m	>5	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Silver	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185m	>5	<b>0</b>	0	0
Lead	ppm	ASTM D5185m	>10	<b>2</b>	0	0
Copper	ppm	ASTM D5185m	>50	<b>12</b>	11	12
Tin	ppm	ASTM D5185m	>5	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**










There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable.

Silicon	ppm	ASTM D5185m	>15	<b>&lt;1</b>	<1	<1
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	0	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>2500	<b>718</b>	1598	1063
Particles >6µm		ASTM D7647	>640	<b>83</b>	373	237
Particles >14µm		ASTM D7647	>80	<b>5</b>	20	17
Particles >21µm		ASTM D7647	>20	<b>1</b>	6	6
Particles >38µm		ASTM D7647	>4	<b>0</b>	0	0
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>18/16/13	<b>17/14/10</b>	18/16/11	17/15/11
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>LIGHT</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>&lt;1</b>	0	<1
Boron	ppm	ASTM D5185m	0	<b>0</b>	0	0
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m		<b>0</b>	0	<1
Magnesium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Calcium	ppm	ASTM D5185m	75	<b>47</b>	46	49
Phosphorus	ppm	ASTM D5185m	275	<b>380</b>	368	367
Zinc	ppm	ASTM D5185m	350	<b>489</b>	460	476
Sulfur	ppm	ASTM D5185m	550	<b>1078</b>	979	1194
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>0.20</b>	0.27	0.23
Visc @ 40°C	cSt	ASTM D445	68.0	<b>67.9</b>	68.6	68.5

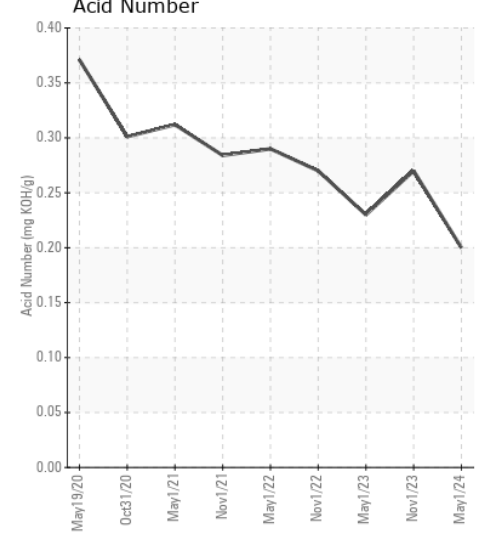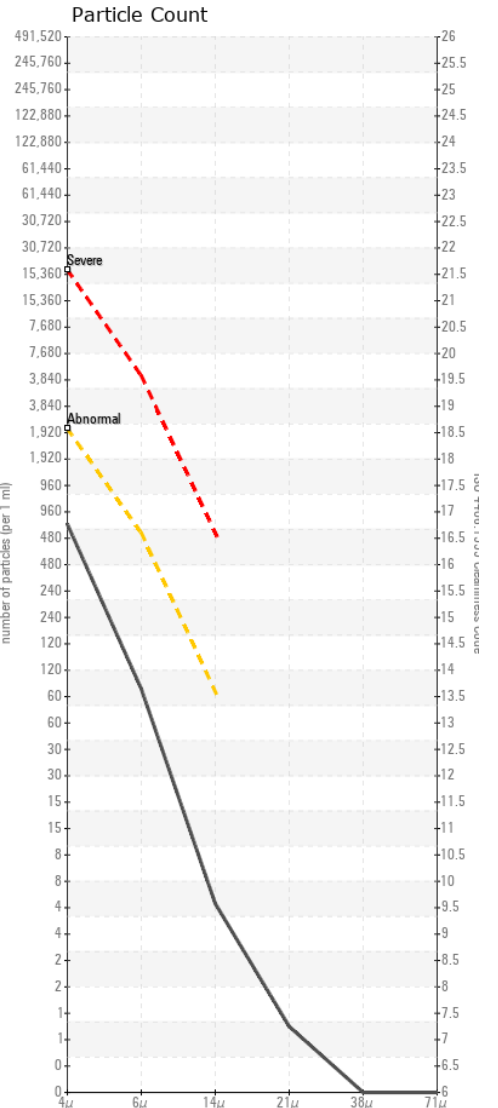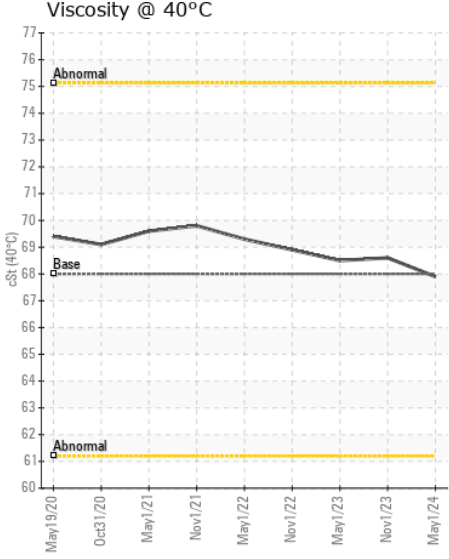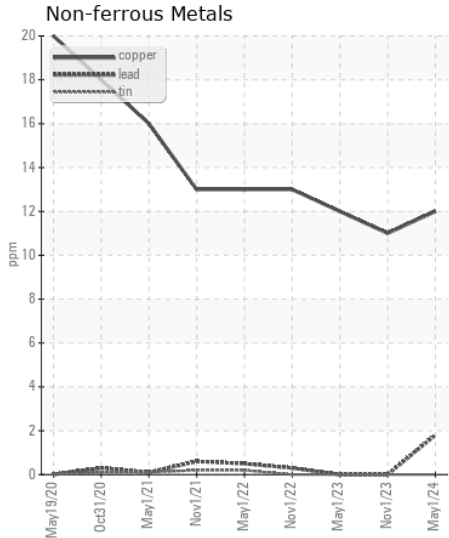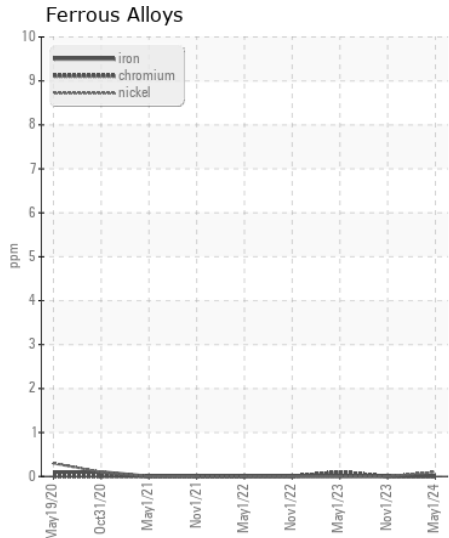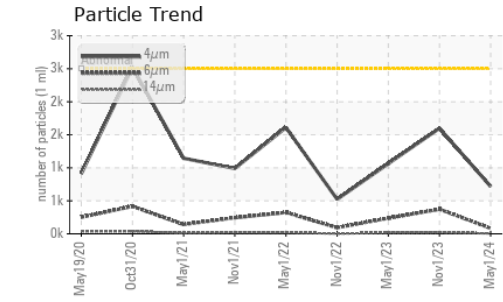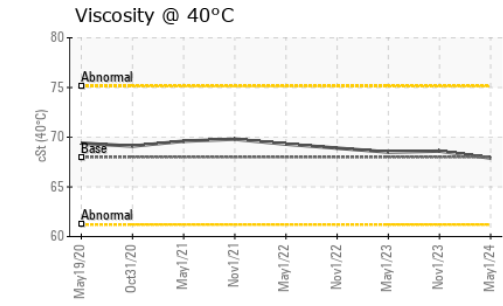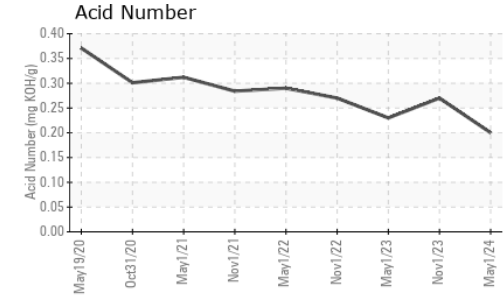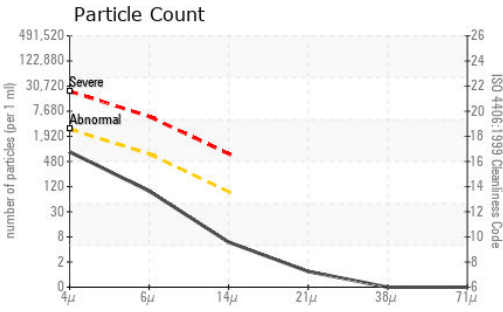

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : MW06186646 **Received** : 21 May 2024  
**Lab Number** : 06186646 **Tested** : 23 May 2024  
**Unique Number** : 11043398 **Diagnosed** : 23 May 2024 - Jonathan Hester  
**Test Package** : MAR 2 ( Additional Tests: PrtCount )

**INGRAM BARGE**  
 900 S 3RD ST  
 PADUCAH, KY  
 US 42003  
 Contact: JUSTIN WHEELER  
 justin.wheeler@ingrambarga.com  
 T:  
 F: (615)695-3697

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)