



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>ATTENTION</b>
FLUID CONDITION	<b>NORMAL</b>

Area  
**TRUCK - URBAN**  
Machine Id  
**WESTERN STAR T147**  
Component  
**Transmission (Auto)**  
Fluid  
**NOT GIVEN (8 GAL)**

## RECOMMENDATION

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PE0003253</b>	PE0002403	---
Sample Date		Client Info		<b>29 Apr 2024</b>	24 Jul 2023	---
Machine Age	mls	Client Info		<b>204318</b>	101260	---
Oil Age	mls	Client Info		<b>103050</b>	101260	---
Filter Age	mls	Client Info		<b>103050</b>	101260	---
Oil Changed		Client Info		<b>Changed</b>	Changed	---
Filter Changed		Client Info		<b>Changed</b>	Changed	---
Sample Status				<b>ATTENTION</b>	ABNORMAL	---

## WEAR

All component wear rates are normal.

PQ		ASTM D8184	>100	<b>20</b>	22	---
Iron	ppm	ASTM D5185m	>300	<b>62</b>	66	---
Chromium	ppm	ASTM D5185m	>2	<b>&lt;1</b>	<1	---
Nickel	ppm	ASTM D5185m	>4	<b>&lt;1</b>	<1	---
Titanium	ppm	ASTM D5185m	>3	<b>&lt;1</b>	0	---
Silver	ppm	ASTM D5185m	>5	<b>&lt;1</b>	<1	---
Aluminum	ppm	ASTM D5185m	>70	<b>31</b>	36	---
Lead	ppm	ASTM D5185m	>85	<b>52</b>	8	---
Copper	ppm	ASTM D5185m	>90	<b>23</b>	12	---
Tin	ppm	ASTM D5185m	>10	<b>6</b>	7	---
Vanadium	ppm	ASTM D5185m		<b>&lt;1</b>	0	---
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	---

## CONTAMINATION











There is a moderate amount of silt (particulates < 6 microns in size) present in the fluid.

Silicon	ppm	ASTM D5185m	>20	<b>6</b>	4	---
Potassium	ppm	ASTM D5185m	>20	<b>4</b>	5	---
Water		WC Method	>0.1	<b>NEG</b>	NEG	---
Particles >4µm		ASTM D7647	>10000	<b>15723</b>	▲ 106031	---
Particles >6µm		ASTM D7647	>2500	<b>1054</b>	▲ 6486	---
Particles >14µm		ASTM D7647	>320	<b>36</b>	94	---
Particles >21µm		ASTM D7647	>80	<b>11</b>	11	---
Particles >38µm		ASTM D7647	>20	<b>0</b>	0	---
Particles >71µm		ASTM D7647	>4	<b>0</b>	0	---
Oil Cleanliness		ISO 4406 (c)	>20/18/15	<b>21/17/12</b>	▲ 24/20/14	---
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	---
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	---
Emulsified Water	scalar	*Visual	>0.1	<b>NEG</b>	NEG	---

## FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

Sodium	ppm	ASTM D5185m		<b>7</b>	5	---
Boron	ppm	ASTM D5185m		<b>208</b>	99	---
Barium	ppm	ASTM D5185m		<b>0</b>	0	---
Molybdenum	ppm	ASTM D5185m		<b>1</b>	<1	---
Manganese	ppm	ASTM D5185m		<b>2</b>	2	---
Magnesium	ppm	ASTM D5185m		<b>4</b>	0	---
Calcium	ppm	ASTM D5185m		<b>232</b>	57	---
Phosphorus	ppm	ASTM D5185m		<b>473</b>	264	---
Zinc	ppm	ASTM D5185m		<b>29</b>	0	---
Sulfur	ppm	ASTM D5185m		<b>3100</b>	1268	---
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>1.81</b>	1.20	---
Visc @ 40°C	cSt	ASTM D445		<b>32.9</b>	33.7	---

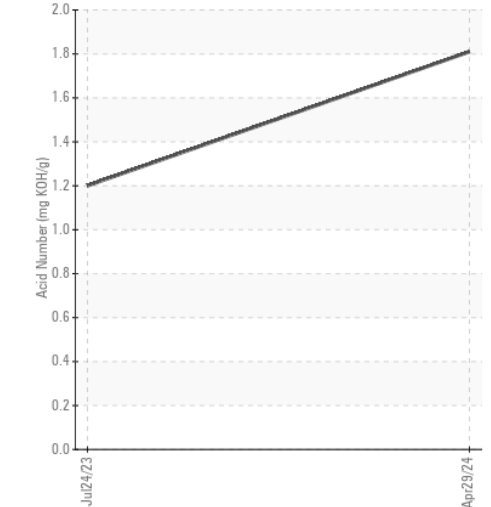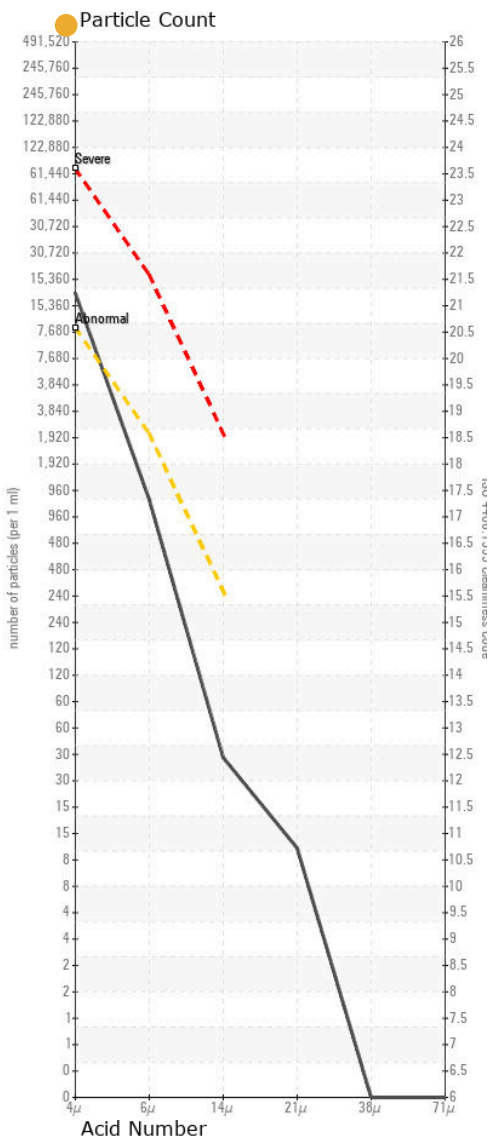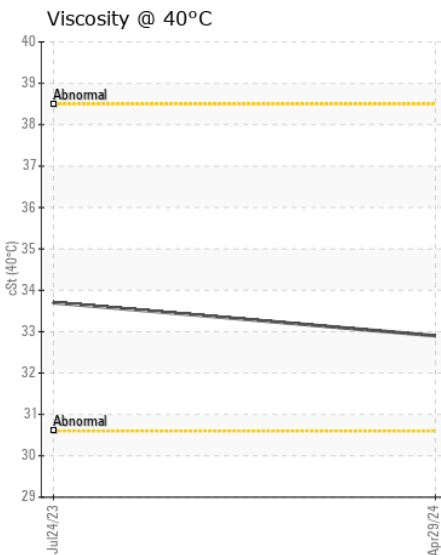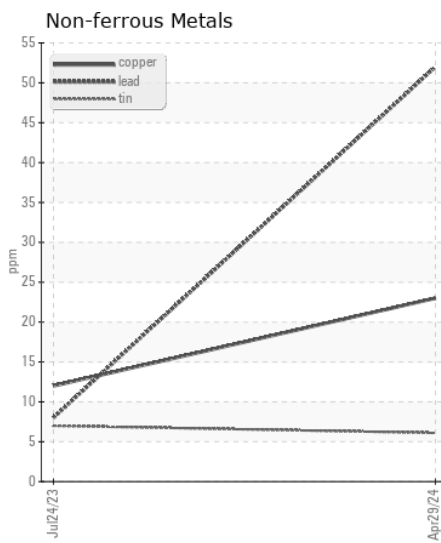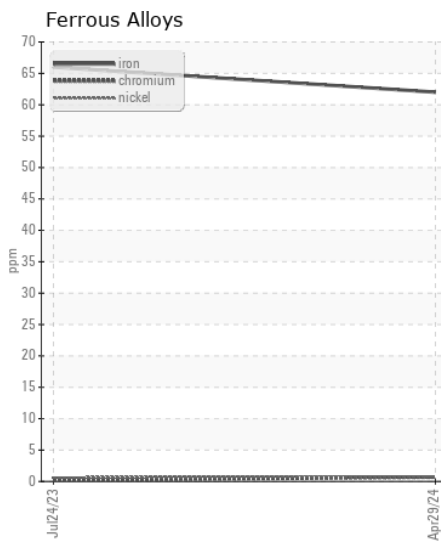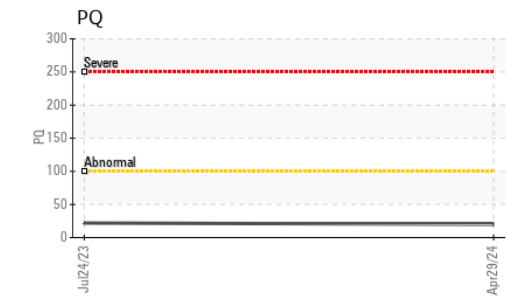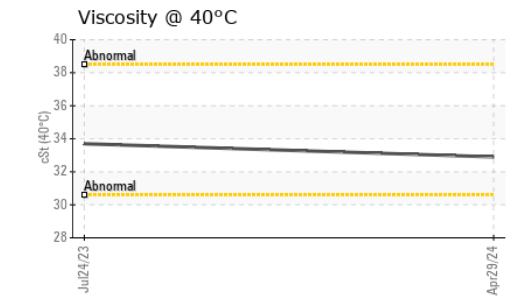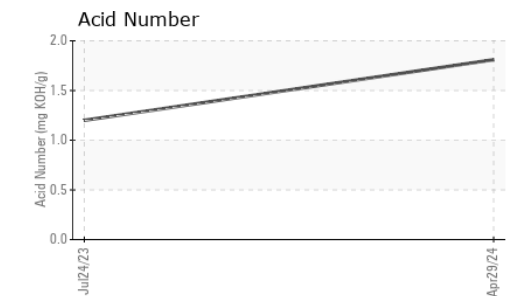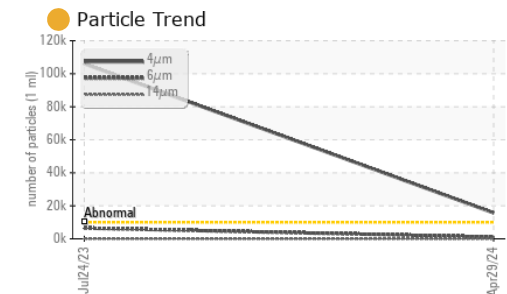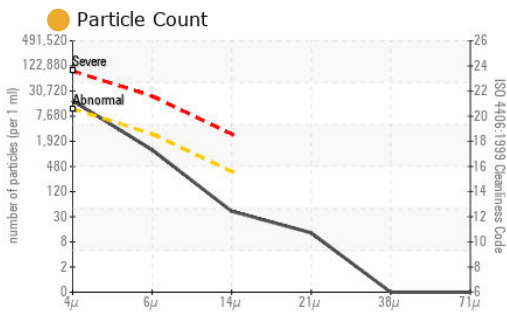

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : PE0003253  
**Lab Number** : 06186985  
**Unique Number** : 11043737  
**Test Package** : CONST ( Additional Tests: ICP, KV40, PQ, PRTCOUNT, SCREEN )

**Received** : 21 May 2024  
**Tested** : 29 May 2024  
**Diagnosed** : 29 May 2024 - Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**PetroCard - Aberdeen**  
 110 Commerce St  
 Aberdeen, WA  
 US 98520  
 Contact: ED ROZMARYN  
 erozmaryn@petrocard.com

T:  
F: