



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Area

**[16W16276]**

Machine Id

**JOHN DEERE 135G 1FF135GXTMF503175**

Component

**Hydraulic System**

Fluid

**HITACHI HYDRAULIC SUPER EX 46HN (16 GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor. ( Customer Sample Comment: 16W16276 )

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>JR0207187</b>	JR0185665	JR0161145
Sample Date		Client Info		<b>17 May 2024</b>	22 Nov 2023	19 Apr 2023
Machine Age	hrs	Client Info		<b>1454</b>	964	560
Oil Age	hrs	Client Info		<b>1454</b>	964	560
Filter Age	hrs	Client Info		<b>489</b>	964	560
Oil Changed		Client Info		<b>Not Chngd</b>	Not Chngd	Not Chngd
Filter Changed		Client Info		<b>Not Chngd</b>	Not Chngd	Not Chngd
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

PQ		ASTM D8184	>50	<b>14</b>	15	14
Iron	ppm	ASTM D5185m	>32	<b>8</b>	6	2
Chromium	ppm	ASTM D5185m	>9	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185m		<b>0</b>	<1	0
Silver	ppm	ASTM D5185m		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>9	<b>&lt;1</b>	2	<1
Lead	ppm	ASTM D5185m	>28	<b>0</b>	<1	0
Copper	ppm	ASTM D5185m	>50	<b>1</b>	2	1
Tin	ppm	ASTM D5185m	>5	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	0
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION











The amount and size of particulates present in the system is acceptable. There is no indication of any contamination in the component.

Silicon	ppm	ASTM D5185m	>11	<b>2</b>	2	1
Potassium	ppm	ASTM D5185m	>20	<b>2</b>	4	0
Water		WC Method	>0.075	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>80000	<b>134</b>	350	387
Particles >6µm		ASTM D7647	>20000	<b>36</b>	75	66
Particles >14µm		ASTM D7647	>640	<b>5</b>	8	11
Particles >21µm		ASTM D7647	>160	<b>2</b>	2	3
Particles >38µm		ASTM D7647	>40	<b>0</b>	0	0
Particles >71µm		ASTM D7647	>10	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>23/21/16	<b>14/12/10</b>	16/13/10	16/13/11
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.075	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m	>21	<b>2</b>	0	<1
Boron	ppm	ASTM D5185m		<b>0</b>	0	0
Barium	ppm	ASTM D5185m		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m		<b>0</b>	<1	0
Manganese	ppm	ASTM D5185m		<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m		<b>0</b>	<1	1
Calcium	ppm	ASTM D5185m		<b>0</b>	8	2
Phosphorus	ppm	ASTM D5185m	827	<b>455</b>	392	473
Zinc	ppm	ASTM D5185m	0	<b>39</b>	45	36
Sulfur	ppm	ASTM D5185m	13	<b>38</b>	110	0
Acid Number (AN)	mg KOH/g	ASTM D8045	0.06	<b>0.11</b>	0.12	0.11
Visc @ 40°C	cSt	ASTM D445	47	<b>45.4</b>	45.7	45.0

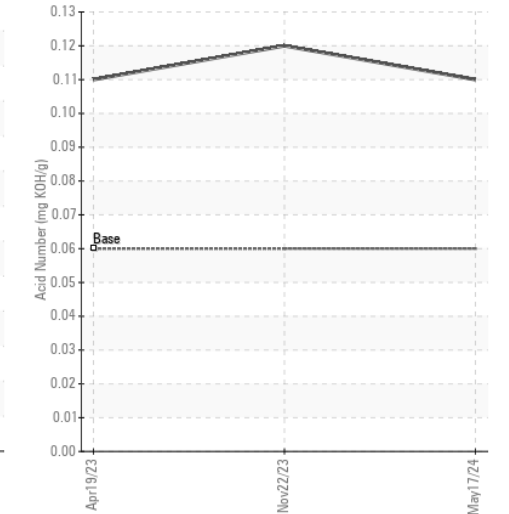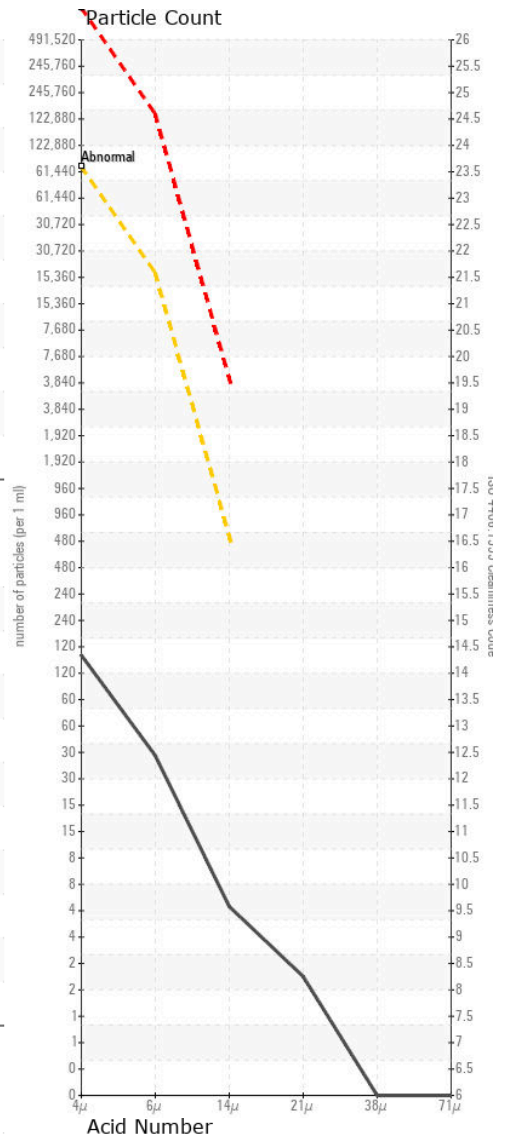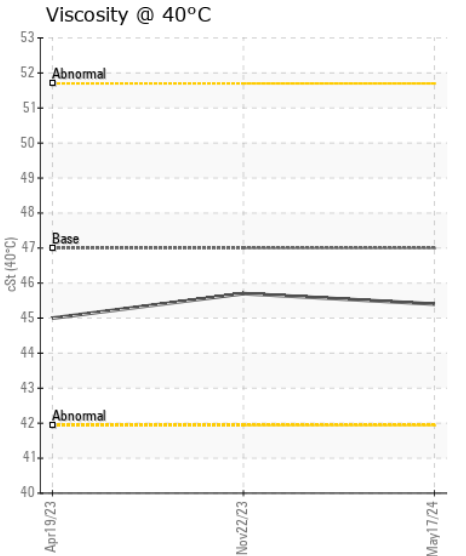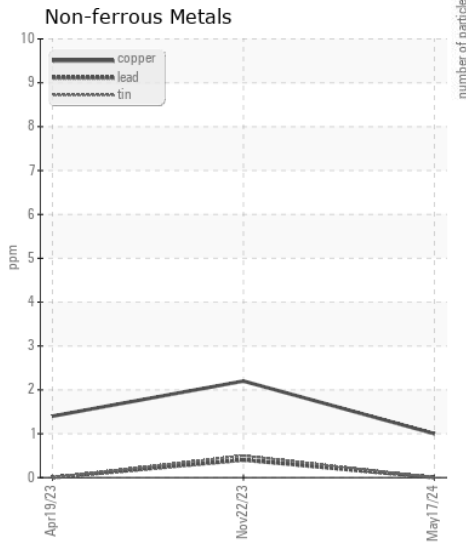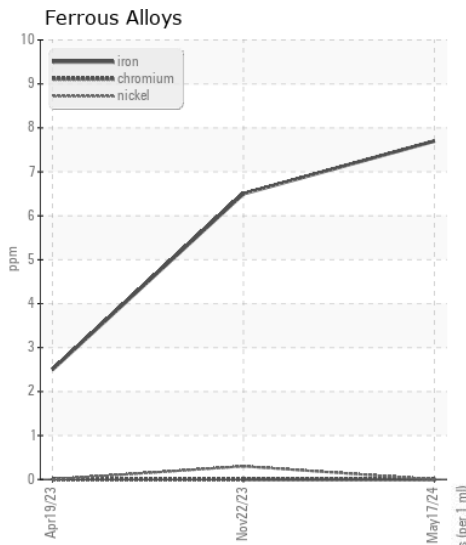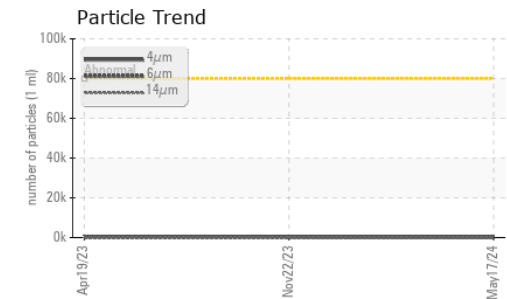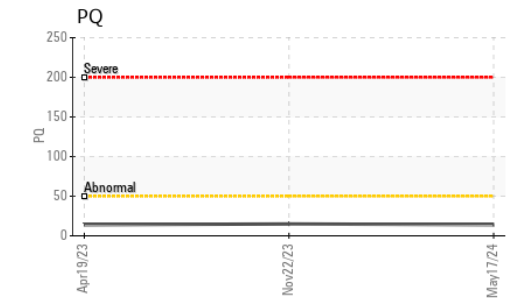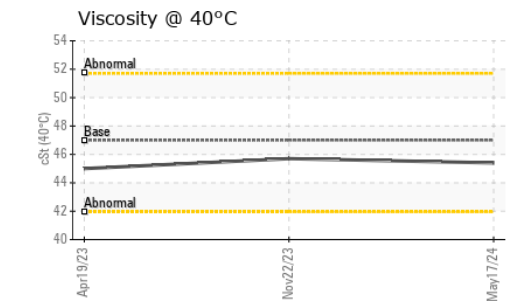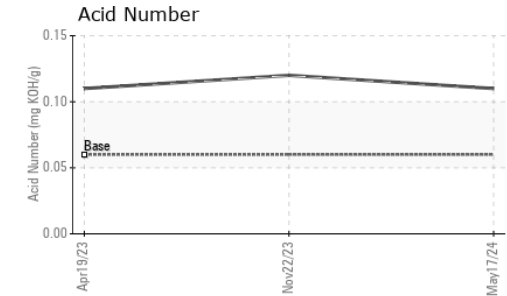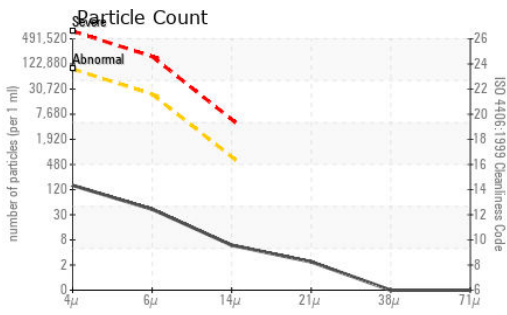

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : JR0207187 **Received** : 22 May 2024  
**Lab Number** : 06187539 **Tested** : 23 May 2024  
**Unique Number** : 11044291 **Diagnosed** : 24 May 2024 - Don Baldrige  
**Test Package** : CONST ( Additional Tests: PQ )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**JRE - CASTLE HAYNE**  
 113 CROWATAN ROAD  
 CASTLE HAYNE, NC  
 US 28429-5819

Contact: WILMINGTON SHOP

todd.simmons@jamesriverequipment.com; canastasio@wearcheck.com; canastasio@we

T: (910)675-9211

F: