



VOLVO

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Area
[WIRE TRACK(?) RECYCL]

Machine Id
VOLVO EC300 310153

Component
Hydraulic System

Fluid
VOLVO SUPER HYDRAULIC OIL 46 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VCP447473	VCP414648	VCP377789
Sample Date		Client Info		21 Mar 2024	04 Oct 2023	01 Aug 2022
Machine Age	hrs	Client Info		5897	5303	3343
Oil Age	hrs	Client Info		0	2300	1500
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changed	Changed	Not Changed
Filter Changed		Client Info		Not Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>25	9	12	8
Chromium	ppm	ASTM D5185m	>10	<1	2	<1
Nickel	ppm	ASTM D5185m	>10	0	<1	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>20	<1	2	2
Lead	ppm	ASTM D5185m	>20	0	1	1
Copper	ppm	ASTM D5185m	>150	12	23	36
Tin	ppm	ASTM D5185m	>10	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE

CONTAMINATION










The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185m	>50	5	9	12
Potassium	ppm	ASTM D5185m	>20	2	2	<1
Water		WC Method	>0.1	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>40000	2456	11634	30224
Particles >6µm		ASTM D7647	>10000	788	948	1413
Particles >14µm		ASTM D7647	>2500	88	47	35
Particles >21µm		ASTM D7647	>640	23	10	5
Particles >38µm		ASTM D7647	>160	1	1	0
Particles >71µm		ASTM D7647	>40	0	0	0
Oil Cleanliness		ISO 4406 (c)	>22/20/18	18/17/14	21/17/13	22/18/12
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		3	2	0
Boron	ppm	ASTM D5185m	14	<1	0	4
Barium	ppm	ASTM D5185m	0.0	<1	0	0
Molybdenum	ppm	ASTM D5185m	0.0	3	<1	2
Manganese	ppm	ASTM D5185m	0.0	<1	<1	0
Magnesium	ppm	ASTM D5185m	2.6	6	10	10
Calcium	ppm	ASTM D5185m	49	93	100	131
Phosphorus	ppm	ASTM D5185m	354	324	355	391
Zinc	ppm	ASTM D5185m	419	389	463	503
Sulfur	ppm	ASTM D5185m	3719	1410	1417	1949
Acid Number (AN)	mg KOH/g	ASTM D8045		0.45	0.27	0.43
Visc @ 40°C	cSt	ASTM D445	46	39.7	39.0	46.5

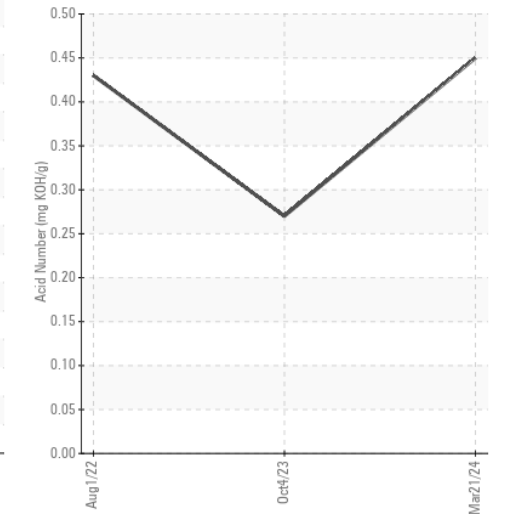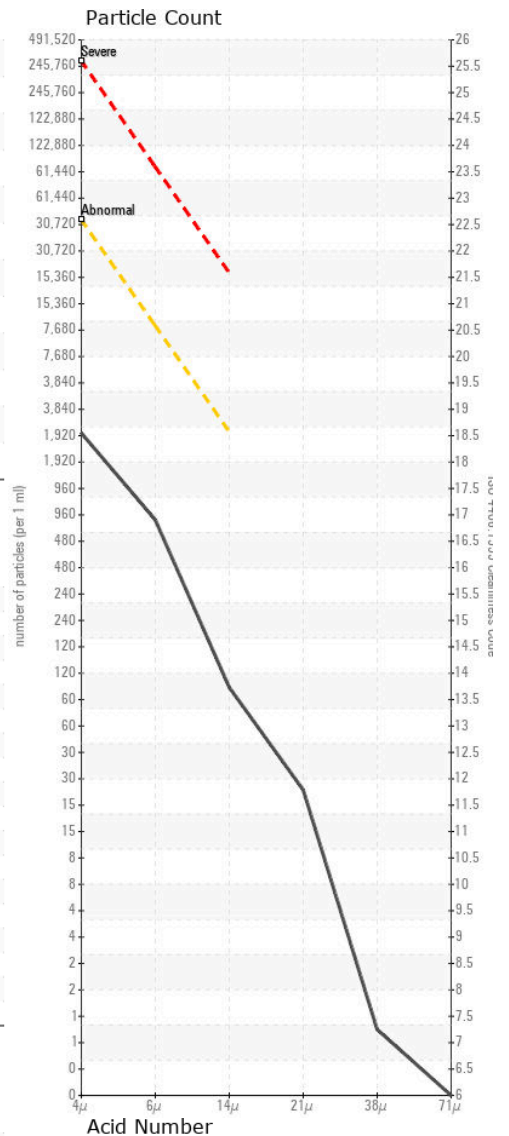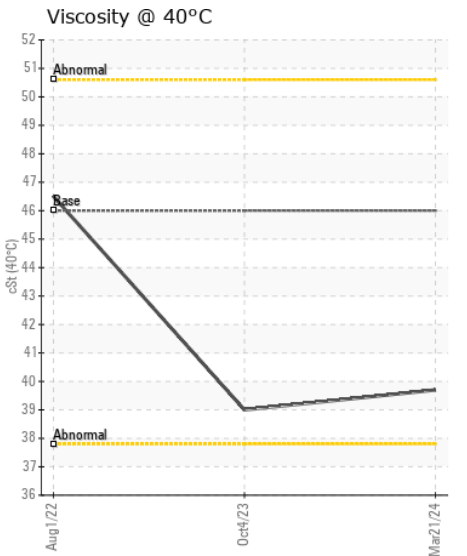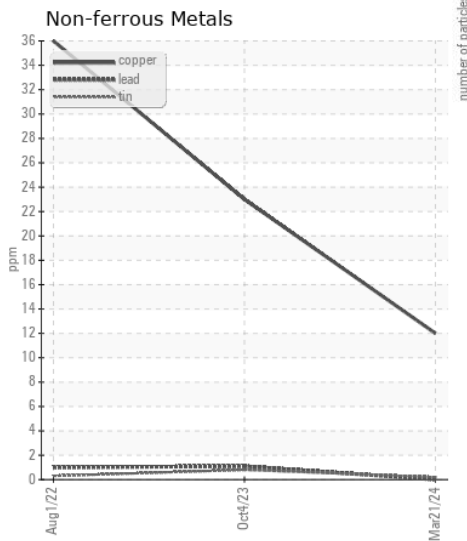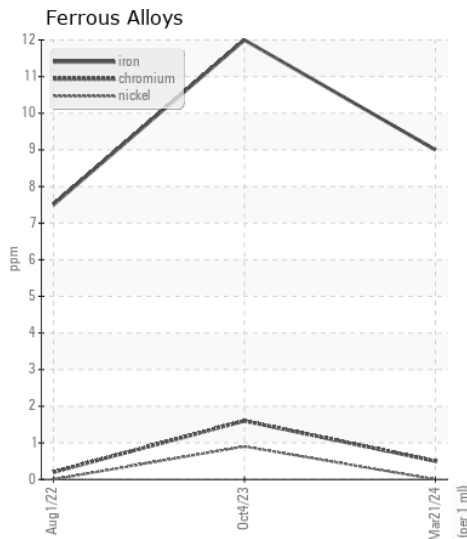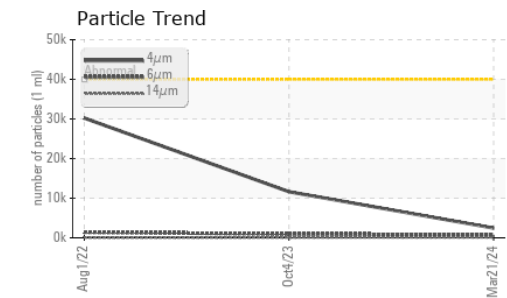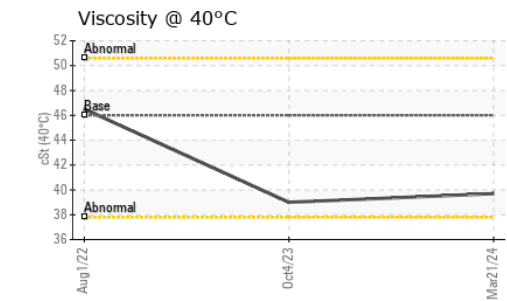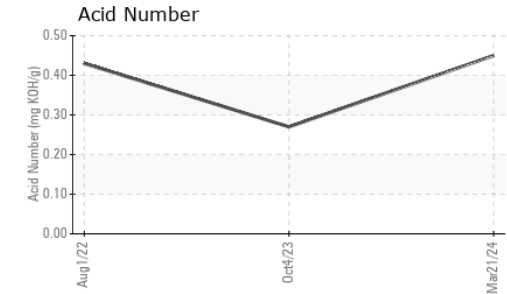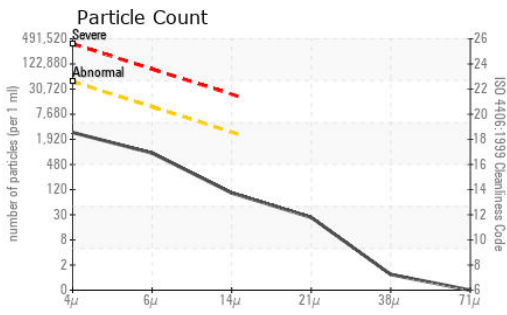

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP447473
Lab Number : 06187578
Unique Number : 11044330
Test Package : MOB 2

Received : 22 May 2024
Tested : 23 May 2024
Diagnosed : 23 May 2024 - Wes Davis

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)