WEAR
CONTAMINATION
FLUID CONDITION

NORMAL NORMAL


Machine Id


## VOLVO L90H 622617


**Front Axle** 


VOLVO SUPER WET BRAKE TRANSAXLE OIL WR102 (--- GAL)

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Resample at the next service interval to monitor.	Sample Number		Client Info		ML0001856		
	Sample Date		Client Info		21 May 2024		
	Machine Age	hrs	Client Info		1163		
	Oil Age	hrs	Client Info		1163		
	Filter Age	hrs	Client Info		1163		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	lvon		ACTM DE10Em	. 500	AE		
VEAN	Iron	ppm	ASTM D5185m		45		
All component wear rates are normal.	Chromium Nickel	ppm	ASTM D5185m		2		
		ppm	ASTM D5185m	>10	0		
	Titanium Silver	ppm	ASTM D5185m ASTM D5185m		0		
	Aluminum	ppm	ASTM D5185m	<b>\25</b>	1		
	Lead	ppm	ASTM D5185m		0		
	Copper	ppm	ASTM D5185m		0		
	Tin	ppm	ASTM D5185m		<1		
	Vanadium	ppm	ASTM D5185m	>10	0		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>75	11		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185m	>20	6		
	Water		WC Method	>0.2	NEG		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185m		4		
	Boron	ppm	ASTM D5185m		50		
The condition of the oil is acceptable for the time in service.	Barium	ppm	ASTM D5185m		0		
	Molybdenum	ppm	ASTM D5185m		22		
	Manganese	ppm	ASTM D5185m		6		
	Magnesium	ppm	ASTM D5185m		75		
	Calcium	ppm	ASTM D5185m		2788		
	Phosphorus	ppm	ASTM D5185m		1002		
	Zinc	ppm	ASTM D5185m		1127		
	Sulfur	ppm	ASTM D5185m		4888		

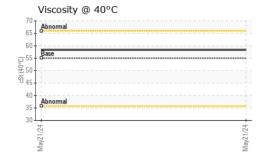

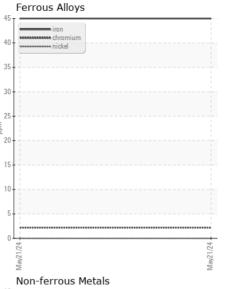

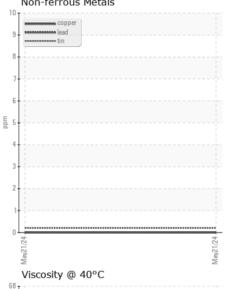

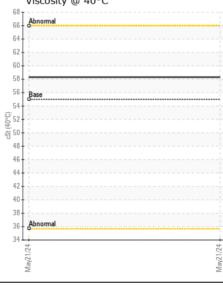



Certificate L2367

Laboratory Sample No.

: ML0001856 Lab Number : 06188045 Unique Number : 11044797 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 22 May 2024 **Tested** : 24 May 2024 Diagnosed

: 24 May 2024 - Sean Felton

MCCLUNG-LOGAN EQUIPMENT CO - RICHMOND

1345 MOUNTAIN ROAD GLEN ALLEN, VA US 23060

Contact: KYLE RATLIFFE KRATLIFFE@MCCLUNG-LOGAN.COM

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (804)266-1611

T: